




Aristo®

# ***Mig 5000i, Mig 5000i WeldCloud™ 460 V***

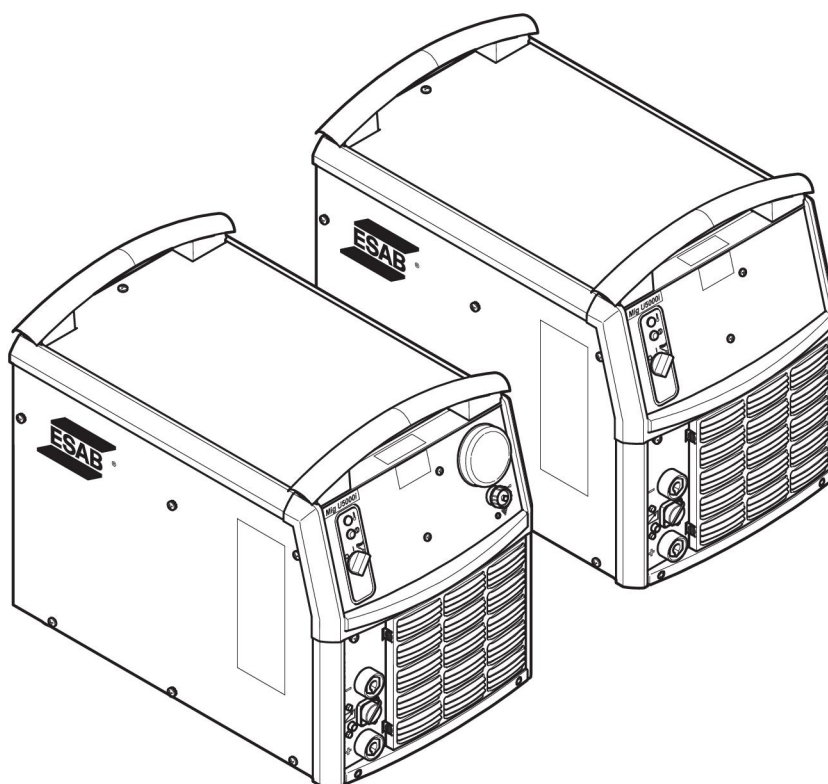

## **Instruction manual**



## EU DECLARATION OF CONFORMITY

According to  
The Low Voltage Directive 2014/35/EU, entering into force 20 April 2016  
The EMC Directive 2014/30/EU, entering into force 20 April 2016  
The RoHS Directive 2011/65/EU, entering into force 2 January 2013

**Type of equipment**  
Welding Power Source

**Type designation**  
Mig 5000i/5000iw from serial number 626-xxx-xxxx (2016 w/26)  
Mig U5000i/U5000iw from serial number 626-xxx-xxxx (2016 w/26)

**Brand name or trade mark**  
ESAB

**Manufacturer or his authorised representative established within the EEA**  
**Name, address, and telephone No:**  
ESAB AB  
Lindholmsallén 9, Box 8004, SE-402 77 Göteborg, Sweden  
Phone: +46 31 50 90 00, Fax: +46 31 50 92 22

**The following harmonised standard in force within the EEA has been used in the design:**  
EN 60974-1:2012, Arc Welding Equipment – Part 1: Welding power sources  
EN 60974-2:2013, Arc Welding Equipment – Part 2: Liquid Cooling Systems  
EN 60974-3:2014, Arc Welding Equipment – Part 3: Arc striking and stabilizing devices  
EN 60974-10:2014/A1:2015, Arc Welding Equipment – Part 10: Electromagnetic compatibility (EMC) requirements

**Additional Information:**  
Restrictive use, Class A equipment, intended for use in location other than residential

**By signing this document, the undersigned declares as manufacturer, or the manufacturer's authorised representative established within the EEA, that the equipment in question complies with the safety requirements stated above.**

**Date**

**Signature**

**Position**

Gothenburg  
2017-09-27

Stephen Argo

Global Director Equipment

CE 2017



## EU DECLARATION OF CONFORMITY

According to  
The Radio Equipment Directive 2014/53/EU, entering into force 13 June 2016  
The RoHS Directive 2011/65/EU, entering into force 2 January 2013

**Type of equipment**  
Welding Power Source

**Type designation**  
Mig 5000i/5000iw WeldCloud from serial number 626-xxx-xxxx (2016 w/26)  
Mig U5000i/U5000iw WeldCloud from serial number 626-xxx-xxxx (2016 w/26)

**Brand name or trade mark**  
ESAB

**Manufacturer or his authorised representative established within the EEA**  
**Name, address, and telephone No:**  
ESAB AB  
Lindholmsallén 9, Box 8004, SE-402 77 Göteborg, Sweden  
Phone: +46 31 50 90 00, Fax: +46 31 50 92 22

**The following harmonised standard in force within the EEA has been used in the design:**  
EN 303 446-2 ElectroMagnetic Compatibility (EMC) standard for combined and/or integrated radio and non-radio equipment; Part 2: Specific conditions for equipment intended to be used in industrial locations.  
EN 301 489-1 V2.2.0 Part 1: Common technical requirements  
EN 301 489-17 V3.2.0 Part 17: Specific conditions for Broadband Data Transmission Systems  
EN 301 489-19 V2.1.0 Part 19: Specific conditions for GPS  
EN 301 489-52 V1.1.0 Part 52: Specific conditions for Cellular Communication

**Additional Information:**  
Restrictive use, Class A equipment, intended for use in location other than residential

**By signing this document, the undersigned declares as manufacturer, or the manufacturer's authorised representative established within the EEA, that the equipment in question complies with the safety requirements stated above.**

**Date**

**Signature**

**Position**

Gothenburg  
2017-09-27

Stephen Argo

Global Director Equipment

CE 2017

<b>1</b>	<b>SAFETY .....</b>	<b>5</b>
1.1	Meaning of symbols .....	5
1.2	Safety precautions .....	5
1.3	User responsibility .....	9
<b>2</b>	<b>INTRODUCTION .....</b>	<b>12</b>
2.1	Equipment .....	12
<b>3</b>	<b>TECHNICAL DATA .....</b>	<b>13</b>
<b>4</b>	<b>INSTALLATION .....</b>	<b>15</b>
4.1	Lifting instructions .....	15
4.2	Placing .....	15
4.3	Primary input .....	15
4.4	Terminating resistor .....	16
<b>5</b>	<b>OPERATION .....</b>	<b>17</b>
5.1	Connections and control devices .....	17
5.2	Turning on the power source .....	18
5.3	Fan control .....	18
5.4	Overheating protection .....	18
5.5	Remote control unit .....	18
5.6	WeldCloud™ unit .....	18
<b>6</b>	<b>MAINTENANCE .....</b>	<b>19</b>
6.1	Cleaning the air filter .....	19
<b>7</b>	<b>TROUBLESHOOTING .....</b>	<b>20</b>
<b>8</b>	<b>ORDERING SPARE PARTS .....</b>	<b>21</b>
	<b>DIAGRAM .....</b>	<b>22</b>
	<b>ORDERING NUMBERS .....</b>	<b>23</b>
	<b>SPARE PARTS LIST .....</b>	<b>24</b>
	<b>ACCESSORIES .....</b>	<b>25</b>

# 1 SAFETY

## 1.1 Meaning of symbols

As used throughout this manual: Means Attention! Be Alert!



### **DANGER!**

Means immediate hazards which, if not avoided, will result in immediate, serious personal injury or loss of life.



### **WARNING!**

Means potential hazards which could result in personal injury or loss of life.



### **CAUTION!**

Means hazards which could result in minor personal injury.



### **WARNING!**

Before use, read and understand the instruction manual and follow all labels, employer's safety practices and Safety Data Sheets (SDSs).



## 1.2 Safety precautions



### **WARNING!**

These Safety Precautions are for your protection. They summarise precautionary information from the references listed in the Additional Safety Information section. Before performing any installation or operating procedures, be sure to read and follow the safety precautions listed below as well as all other manuals, material safety data sheets, labels, etc. Failure to observe the Safety Precautions could result in injury or death.



### **PROTECT YOURSELF AND OTHERS**

**Some welding, cutting and gouging processes are noisy and require hearing protection. The arc, like the sun, emits ultraviolet (UV) and other radiation and can injure the skin and eyes. Hot metal can cause burns. Training in the proper use of the processes and equipment is essential to prevent accidents. Therefore:**

1. Wear a welding helmet fitted with a proper shade of filter to protect your face and eyes when welding or watching.
2. Always wear safety glasses with side shields in any work area, even if welding helmets, face shields and goggles are also required.
3. Use a face shield fitted with the correct filter and cover plates to protect your eyes, face, neck and ears from sparks and rays of the arc when operating or observing operations. Warn bystanders not to look at the arc and not to expose themselves to the rays of the electric-arc or hot metal.

4. Wear flameproof gauntlet-type gloves, heavy long-sleeve shirt, cuffless pants, high-topped shoes, and a welding helmet or cap for protection, to protect against arc rays and hot sparks or hot metal. A flameproof apron may also be desirable as protection against radiated heat and sparks.
5. Hot sparks or metal can lodge in rolled up sleeves, trouser cuffs, or pockets. Sleeves and collars should be kept buttoned and open pockets eliminated from the front of the clothing.
6. Protect other personnel from arc rays and hot sparks with a suitable non-flammable partition or curtains.
7. Use goggles over safety glasses when chipping slag or grinding. Chipped slag may be hot and can fly for long distances. Bystanders should also wear goggles over safety glasses.



### **FIRES AND EXPLOSIONS**

**The heat from flames and arcs can start fires. Hot slag or sparks can also cause fires and explosions. Therefore:**

1. Protect yourself and others from flying sparks and hot metal.
2. Move all combustible materials well away from the work area or cover the materials with a protective non-flammable covering. Combustible materials include wood, cloth, sawdust, liquid and gas fuels, solvents, paints, and coating paper, etc.
3. Hot sparks or hot metal can fall through cracks or crevices in floors or wall openings and cause a hidden smoldering fire or fires on the floor below. Make certain that such openings are protected from hot sparks and metal.
4. Do not weld, cut, or perform other hot work until the work piece has been completely cleaned so that there are no substances on the work piece which might produce flammable or toxic vapors. Do not perform hot work on closed containers, they may explode.
5. Have fire extinguishing equipment handy for instant use, such as a garden hose, water pail, sand bucket, or portable fire extinguisher. Be sure you are trained in its use.
6. Do not use equipment beyond its ratings. For example, an overloaded welding cable can overheat and create a fire hazard.
7. After completing work, inspect the work area to make sure there are no hot sparks or hot metal that could cause a fire later. Use fire watchers when necessary.



### **ELECTRICAL SHOCK**

**Contact between live electrical parts and earth can cause severe injury or death. DO NOT use AC welding current in damp areas, if movement is confined, or if there is danger of falling. Therefore:**

1. Be sure the power source frame (chassis) is connected to the earth system of the input power.
2. Connect the workpiece to a good electrical earth.
3. Connect the work cable to the workpiece. A poor or missing connection can expose you or others to a fatal shock.
4. Use well-maintained equipment. Replace worn or damaged cables.
5. Keep everything dry, including clothing, work area, cables, torch/electrode holder and power source.
6. Make sure that all parts of your body are insulated from both the work piece and from the ground.
7. Do not stand directly on metal or the ground while working in tight quarters or a damp area; stand on dry boards or an insulating platform and wear rubber-soled shoes.

8. Put on dry, hole-free gloves before turning on the power.
9. Turn off the power, before removing your gloves.
10. Refer to ANSI/ASC Standard Z49.1 for specific grounding recommendations. Do not mistake the work lead for a earth cable.



### **ELECTRIC AND MAGNETIC FIELDS**

**May be dangerous. Electric current flowing through any conductor causes localised Electric and Magnetic Fields (EMF). Welding and cutting current creates EMF around welding cables and welding machines. Therefore:**

1. Welders with pacemakers fitted should consult their doctor before welding. EMF may interfere with some pacemakers.
2. Exposure to EMF may have other health effects which are unknown.
3. Welders should use the following procedures to minimise exposure to EMF:
  - a) Route the electrode and work cables together. Secure them with tape when possible.
  - b) Never coil the torch or work cable around your body.
  - c) Do not place your body between the torch and work cables. Route cables on the same side of your body.
  - d) Connect the work cable to the workpiece as close as possible to the area being welded.
  - e) Keep the welding power source and cables as far away from your body as possible.



### **FUMES AND GASES**

**Fumes and gases, can cause discomfort or harm, particularly in confined spaces. Shielding gases can cause asphyxiation. Therefore:**

1. Keep your head out of the fumes. Do not breathe the fumes and gases.
2. Always provide adequate ventilation in the work area by natural or mechanical means. Do not weld, cut or gouge on materials such as galvanized steel, stainless steel, copper, zinc, lead beryllium or cadmium unless positive mechanical ventilation is provided. Do not breathe in the fumes from these materials.
3. Do not operate near degreasing and spraying operations. The heat or arc can react with chlorinated hydrocarbon vapors to form phosgene, a highly toxic gas, and other irritant gases.
4. If you develop momentary eye, nose or throat irritation while operating, this is an indication that the ventilation is not adequate. Stop work and take the necessary steps to improve ventilation in the work area. Do not continue to operate if physical discomfort persists.
5. Refer to ANSI/ASC Standard Z49.1 for specific ventilation recommendations.
6. **WARNING:** This product when used for welding or cutting, produces fumes or gases that contain chemicals known to the State of California to cause birth defects and in some cases cancer (California Health & Safety Code §25249.5 et seq.)



### **CYLINDER HANDLING**

**Cylinders, if mishandled, can rupture and violently release gas. A sudden rupture of cylinder valve or relief device can injure or kill. Therefore:**



1. Locate cylinders away from heat, sparks and flames. Never strike an arc on a cylinder.
2. Use the proper gas for the process and use the proper pressure reducing regulator designed to operate from the compressed gas cylinder. Do not use adapters. Maintain hoses and fittings in good condition. Follow the manufacturer's operating instructions for mounting a regulator to a compressed gas cylinder.
3. Always secure cylinders in an upright position, by chain or strap, to suitable hand trucks, undercarriages, benches, wall, post or racks. Never secure cylinders to work tables or fixtures where they may become part of an electrical circuit.
4. When not in use, keep cylinder valves closed. Have valve protection cap in place if regulator is not connected. Secure and move cylinders by using suitable hand trucks.



### MOVING PARTS

**Moving parts, such as fans, rotors and belts can cause injury. Therefore:**

1. Keep all doors, panels, guards, and covers closed and securely in place.
2. Stop the engine or drive systems before installing or connecting a unit.
3. Have only qualified people remove covers for maintenance and troubleshooting as necessary
4. To prevent accidental starting of equipment during service, disconnect negative (-) battery cable from battery.
5. Keep hands, hair, loose clothing and tools away from moving parts.
6. Reinstall panels or covers and close doors when service is finished and before starting engine.



### WARNING!

#### FALLING EQUIPMENT CAN INJURE

- Only use lifting eye to lift unit. Do NOT use running gear, gas cylinders or any other accessories.
- Use equipment of adequate capacity to lift and support unit.
- If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.
- Keep cables and cords away from moving vehicles when working from an aerial location.





## **WARNING!** **EQUIPMENT MAINTENANCE**

**Faulty or improperly maintained equipment can cause injury or death.  
Therefore:**

1. Always have qualified personnel perform the installation, troubleshooting and maintenance work. Do not perform any electrical work unless you are qualified to perform such work.
2. Before performing any maintenance work inside a power source, disconnect the power source from the incoming electrical power.
3. Maintain cables, earthing wire, connections, power cord and power supply in safe working order. Do not operate any equipment in faulty condition.
4. Do not abuse any equipment or accessories. Keep equipment away from heat sources such as furnaces, wet conditions such as water puddles, oil or grease, corrosive atmospheres and inclement weather.
5. Keep all safety devices and cabinet covers in position and in good repair.
6. Use equipment only for its intended purpose. Do not modify it in any manner.



## **CAUTION!** **ADDITIONAL SAFETY INFORMATION**

**For more information on safe practices for electric arc welding and cutting equipment, ask your supplier for a copy of "Precautions and Safe Practices for Arc Welding, Cutting and Gouging." Form 52-529.**

The following publications are recommended to you:

1. ANSI/ASC Z49.1 - "Safety in Welding and Cutting"
2. AWS C5.5 - "Recommended Practices for Gas Tungsten Arc Welding"
3. AWS C5.6 - "Recommended Practices for Gas Metal Arc Welding"
4. AWS SP - "Safe Practices" - Reprint, Welding Handbook
5. ANSI/AWS F4.1 - "Recommended Safe Practices for Welding and Cutting of Containers That Have Held Hazardous Substances"
6. OSHA 29 CFR 1910 - "Safety and Health Standards"
7. CSA W117.2 - "Code for Safety in Welding and Cutting"
8. NFPA Standard 51B, "Fire Prevention During Welding, Cutting, and Other Hot Work"
9. CGA Standard P-1, "Precautions for Safe Handling of Compressed Gases in Cylinders"
1. ANSI Z87.1, "Occupational and Educational Personal Eye and Face Protection Devices"
- 0.

## **1.3 User responsibility**

Users of ESAB equipment have the ultimate responsibility for ensuring that anyone who works on or near the equipment observes all the relevant safety precautions. Safety precautions must meet the requirements that apply to this type of equipment. The following recommendations should be observed, in addition to the standard regulations that apply to the workplace.

All work must be carried out by trained personnel well-acquainted with the operation of the equipment. Incorrect operation of the equipment may lead to hazardous situations, which could result in injury to the operator and damage to the equipment.

1. Anyone who uses the equipment must be familiar with:
  - its operation
  - the location of emergency stops
  - its function
  - the relevant safety precautions
  - welding and cutting or other applicable operation of the equipment
2. The operator must ensure that:
  - no unauthorized person is within the working area of the equipment when it is started up
  - no-one is unprotected when the arc is struck or work is started with the equipment
3. The workplace must:
  - be suitable for the purpose
  - be free from drafts
4. Personal safety equipment:
  - Always wear recommended personal safety equipment, such as safety glasses, flame-proof clothing, safety gloves
  - Do not wear loose-fitting items, such as scarves, bracelets, rings, etc., which could become trapped or cause burns
5. General precautions:
  - Make sure the return cable is connected securely
  - Work on high voltage equipment **may only be carried out by a qualified electrician**
  - Appropriate fire extinguishing equipment must be clearly marked and close at hand
  - Lubrication and maintenance must **not** be carried out on the equipment during operation



### **WARNING!**

Arc welding and cutting may cause injury to yourself and others. Take precautions when welding and cutting.



### **ELECTRIC SHOCK - Can kill**

- Install and ground the unit in accordance with instruction manual.
- Do not touch live electrical parts or electrodes with bare skin, wet gloves, or wet clothing.
- Insulate yourself from work and ground.
- Ensure your working position is safe



### **ELECTRIC AND MAGNETIC FIELDS - Pose health risks**

- Welders with pacemakers fitted should consult their doctor before welding. EMF may interfere with some pacemakers.
- Exposure to EMF may have other health effects which are unknown.
- Welders should use the following procedures to minimize exposure to EMF:
  - Route the electrode and work cables together on the same side of your body. Secure them with tape when possible. Do not place your body between the torch and work cables. Never coil the torch or work cable around your body. Keep the welding power source and cables as far away from your body as possible.
  - Connect the work cable to the workpiece as close as possible to the area being welded.



### **FUMES AND GASES - Can be dangerous to your health**

- Keep your head out of the fumes.
- Use ventilation, extraction at the arc, or both, to take fumes and gases away from your breathing zone and the general area.



### **ARC RAYS - Can injure eyes and burn skin**

- Protect your eyes and body. Use the correct welding screen and filter lens and wear protective clothing.
- Protect bystanders with suitable screens or curtains.



### **NOISE - Excessive noise can damage hearing**

Protect your ears. Use ear defenders or other hearing protection.



### **MOVING PARTS - Can cause injuries**

- Keep all doors, panels and covers closed and securely in place. Have only qualified people remove covers for maintenance and troubleshooting as necessary. Reinstall panels or covers and close doors when service is finished and before starting engine.
- Stop engine before installing or connecting unit.
- Keep hands, hair, loose clothing and tools away from moving parts.



### **FIRE HAZARD**

- Sparks (spatter) can cause a fire. Make sure there are no inflammable materials nearby.
- Do not use on closed containers.

**MALFUNCTION - Call for expert assistance in the event of malfunction.**

**PROTECT YOURSELF AND OTHERS!**



#### **WARNING!**

Do not use the power source for thawing frozen pipes.



#### **CAUTION!**

This product is solely intended for arc welding.

**ESAB has an assortment of welding accessories and personal protection equipment for purchase. For ordering information, contact your local ESAB dealer or visit us on our website.**

## 2 INTRODUCTION

---

The **Mig 5000i** is a GMAW (MIG/MAG) welding power source, which can also be used for SMAW (MMA) welding.

There are several versions of the power source:

- Mig 5000i
- Mig 5000i with WeldCloud™ unit



### **NOTE!**

These instructions describe an Mig 5000i with a cooling unit.

The power source is intended for use with the Feed 3004 or Feed 4804 wire feed units.

The **Mig 5000i WeldCloud™** power source is combined with U8<sub>2</sub> and provides a control box which enables wireless monitoring.

For more information about the feed units and WeldCloud™, refer to the Instruction manuals.

**ESAB accessories for the product can be found in the "ACCESSORIES" chapter of this manual.**

### 2.1 Equipment

The power source is supplied complete with terminating resistor, 5-m return cable and instruction manual.

### 3 TECHNICAL DATA

	Mig 5000i	Mig 5000i WeldCloud™
<b>Main voltage</b>	460 V $\pm 10\%$ , 3~ 60 Hz	460 V $\pm 10\%$ , 3~ 60 Hz
<b>Main supply</b>	$S_{scmin}$ 14.54 MVA $Z_{max}$ 0.011 $\Omega$	$S_{scmin}$ 14.54 MVA $Z_{max}$ 0.011 $\Omega$
<b>Primary current</b>		
$I_{max}$ GMAW (MIG/MAG)	37 A	37 A
$I_{max}$ GTAW (TIG)	30 A	30 A
$I_{max}$ SMAW (MMA)	38 A	38 A
<b>No-load power</b> demand in energy-saving mode, 6.5 min. after welding		
GTAW/GMAW (TIG/MIG)	36 W	36 W
SMAW (MMA)	43 W	43 W
<b>Voltage/current range</b>		
GMAW (MIG/MAG)	8 - 60 V / 16 - 500 A	8 - 60 V / 16 - 500 A
GMAW (MIG/MAG), control panel M2	8 - 42 V	8 - 42 V
SMAW (MMA)	4 - 500 A	4 - 500 A
<b>Permissible load at GMAW (MIG/MAG)</b>		
60% duty cycle	500 A/39 V	500 A/39 V
100% duty cycle	400 A/34 V	400 A/34 V
<b>Permissible load at TIG</b>		
60% duty cycle	500 A/30 V	500 A/30 V
100% duty cycle	400 A/26 V	400 A/26 V
<b>Permissible load at SMAW (MMA)</b>		
60% duty cycle	500 A/40 V	500 A/40 V
100% duty cycle	400 A/36 V	400 A/36 V
<b>Power factor</b> at maximum current ( $I_2$ ) SMAW/GTAW/GMAW (MMA/TIG/MIG)	0.90	0.90
<b>Efficiency</b> at maximum current ( $I_2$ )		
SMAW (MMA)	85%	85%
GTAW (TIG)	82%	82%
GMAW (MIG)	84%	84%
<b>Open-circuit voltage <math>U_0</math> max</b>		
GMAW (MIG/MAG) without VRD function <b>1)</b>	72 - 88 V	72 - 88 V
SMAW (MMA) without VRD function <b>1)</b>	68 - 80 V	68 - 80 V

	<b>Mig 5000i</b>	<b>Mig 5000i WeldCloud™</b>
GMAW (MIG/MAG), SMAW (MMA), VRD function deactivated <b>2)</b>	59 V	59 V
VRD function activated <b>2)</b>	< 35 V	< 35 V
<b>Operating temperature</b>	14 to 104°F (-10 to +40°C)	14 to 104°F (-10 to +40°C)
<b>Transport temperature</b>	-4 to 131°F (-20 to +55°C)	-4 to 131°F (-20 to +55°C)
<b>Dimensions l × w × h</b> without cooling unit  with cooling unit	24.6 × 15.5 × 19.5 in. (625 × 394 × 496 mm)	24.6 × 15.5 × 19.5 in. (625 × 394 × 496 mm)
	24.6 × 15.5 × 30.6 in. (625 × 394 × 776 mm)	24.6 × 15.5 × 30.6 in. (625 × 394 × 776 mm)
<b>Continual A-weighted sound pressure</b>	<70 dB	<70 dB
<b>Weight</b> without cooling unit with cooling unit	150 lb (68 kg)	174 lb (79 kg)
	194 lb (88 kg)	218 lb (99 kg)
<b>Insulation class</b> transformer	H	H
<b>Enclosure class</b>	IP23	IP23
<b>Application class</b>	<b>S</b>	<b>S</b>

1) Valid for power sources without VRD specification on the rating plate.

2) Valid for power sources with VRD specification on the rating plate. The VRD function is explained in the instruction manuals for the control panel, if the panel has that function.

### Duty cycle

The duty cycle refers to the time as a percentage of a ten-minute period that you can weld or cut at a certain load without overloading. The duty cycle is valid for 104 °F (40 °C) or below.

### Enclosure class

The **IP** code indicates the enclosure class, i.e. the degree of protection against penetration by solid objects or water.

Equipment marked **IP23** is intended for indoor and outdoor use.

### Application class

The symbol **S** indicates that the power source is designed for use in areas with increased electrical hazard.

## 4 INSTALLATION

The installation must be carried out by a professional.

**NOTE!****Mains supply requirements**

This equipment complies with IEC 61000-3-12 provided that the short-circuit power is greater than or equal to  $S_{scmin}$  at the interface point between the user's supply and the public system. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment is connected only to a supply with a short-circuit power greater than or equal to  $S_{scmin}$ . Refer to the technical data in the TECHNICAL DATA chapter.

### 4.1 Lifting instructions

**CAUTION!**

### 4.2 Placing

Position the welding power source such that its cooling air inlets and outlets are not obstructed.

### 4.3 Primary input


**WARNING!**

ELECTRIC SHOCK CAN KILL! PRECAUTIONARY MEASURES SHOULD BE TAKEN TO PROVIDE MAXIMUM PROTECTION AGAINST ELECTRIC SHOCK. BE SURE THAT ALL POWER IS OFF BY OPENING THE LINE (WALL) DISCONNECT SWITCH WHEN PRIMARY ELECTRICAL CONNECTIONS ARE MADE TO THE POWER SOURCE. BE SURE TO CHECK YOUR INPUT LEADS WITH A VOLTMETER TO MAKE SURE ALL POWER IS OFF.



Check that the unit is connected to the correct main supply voltage, and that it is protected by the correct fuse sizes.

A protective ground connection must be made, in accordance with regulations.

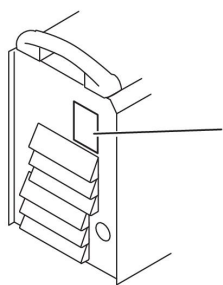

Rating plate with supply connection data

#### Recommended fuse sizes and minimum cable areas

Mig 5000i	460 V 3~ 60 Hz
<b>Main voltage</b>	460 V
<b>Main cable area, CU/AWG (mm<sup>2</sup>)</b>	4G6
<b>Phase current, I RMS</b>	28 A
<b>Fuse Time Delay</b>	50 A




#### NOTE!

Sizes per National Electric Code for 90°C rated copper conductors @ 30°C ambient. Not more than three conductors in raceway or cable. Local codes should be followed if they specify larger sizes other than those listed above.

## 4.4 Terminating resistor

In order to avoid communication interference, the ends of the CAN bus must have terminating resistors.



One end of the CAN bus is at the control panel, which has an integral terminating resistor. The other end at the power source must have a terminating resistor, as shown on the right.

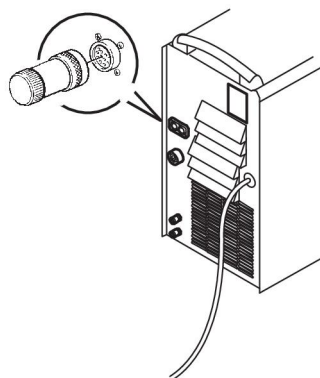

## 5 OPERATION

General safety regulations for handling the equipment can be found in the "SAFETY" chapter of this manual. Read it through before you start using the equipment!

### 5.1 Connections and control devices

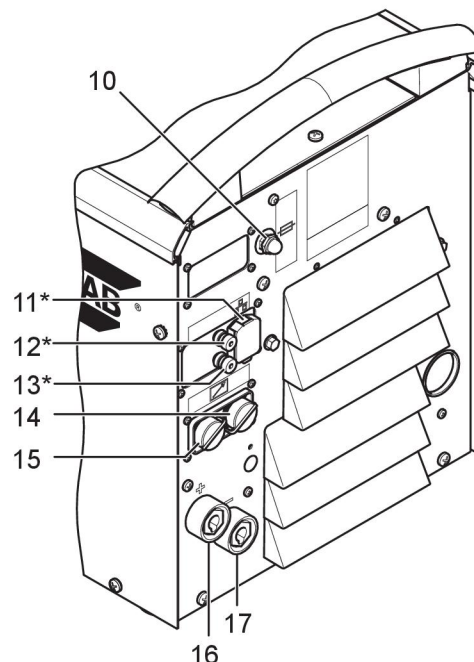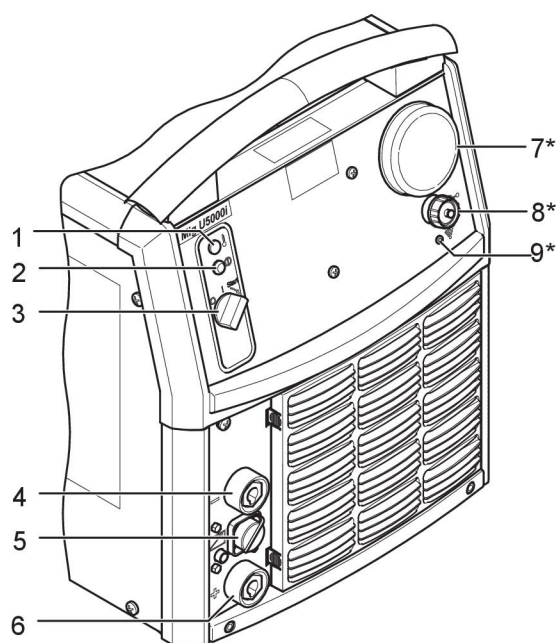

- |  |  |
|--|--|
| <b>1</b> Orange indicating lamp - Overheating  | <b>10</b> Fuse for supply voltage for feeder unit, 42 V                                      |
| <b>2</b> White indicating lamp - Power supply ON   | <b>11*</b> *Only on WeldCloud™ version: Connection for Ethernet                              |
| <b>3</b> Main power supply switch, 0 / 1 / START   | <b>12*</b> *Only on WeldCloud™ version: Measure outlet screw terminal - RED (+)              |
| <b>4</b> Connection (-) for return cable at SMAW and GMAW or for welding current cable at GTAW | <b>13*</b> *Only on WeldCloud™ version: Measure outlet screw terminal - BLACK (-)            |
| <b>5</b> Connection for remote control   | <b>14</b> Connection for control cable to the wire feed unit or for the terminating resistor |
| <b>6</b> Connection (+) for welding current cable at SMAW or for return cable at GTAW          | <b>15</b> Connection for control cable to the wire feed unit or for the terminating resistor |
| <b>7*</b> *Only on WeldCloud™ version: Antenna   | <b>16</b> Connection (+) for welding current cable to the wire feed unit                     |
| <b>8*</b> *Only on WeldCloud™ version: USB Connectivity  | <b>17</b> Connection (-) for the return cable wire feed unit                                 |
| <b>9*</b> *Only on WeldCloud™ version: Red indicating lamp - Wi-Fi Connectivity                |  |

## 5.2 Turning on the power source

Turn on the main power by turning switch (3) to the “START” position. Release the switch, and it will return to the “1” position.

If the main power supply is interrupted while welding is in progress, and then is restored, the power source will remain de-energized until the switch is again turned manually to the “START” position.

Turn the unit off by turning the switch to the “0” position.

If the supply power fails or the power source is turned off in the normal manner, the welding data will be stored so that it is available next time the unit is started.

## 5.3 Fan control

The power source fans continue to run for 6.5 minutes after welding has stopped, and the unit switches to energy-saving mode. They start again when welding resumes.

The fans run at reduced speed for welding currents up to 180 A, and at full speed for higher currents.

## 5.4 Overheating protection

The power source has three thermal overload trips which operate if the internal temperature becomes too high, interrupting the welding current and lighting the orange indicating lamp on the front of the unit. They reset automatically when the temperature has fallen.

## 5.5 Remote control unit

The program version in U8 should be 1.20 or higher. Power sources with integral control panels should have program version 1.21 or higher, in order for the remote control to function correctly.

When the remote control unit is connected, the power source and wire feed unit are in remote control mode; the buttons and knobs are blocked. The functions can only be adjusted via the remote unit.

If the remote control unit is not to be used, the remote control unit must be disconnected from the power source/wire feed unit, as otherwise it will remain in remote control mode.

For more information about the operation of the remote control unit, see the operating instructions for the control panel.

## 5.6 WeldCloud™ unit

The WeldCloud™ unit connects the welding power source with a local WeldCloud™ server through Wi-Fi, Wired LAN or 3G. The WeldCloud™ unit is equipped with GPS to track the location of the welding power source. It also has Bluetooth connectivity to enable connection with 3<sup>rd</sup> party input devices, for example a Bluetooth enabled barcode/QR scanner.

The WeldCloud™ unit Wi-Fi is enabled at power up of the power source. It will start as a hotspot that appears as an available Wi-Fi network. After establishing connection, it is possible to access the web interface of the power source for a one-time set-up. After set-up and restart, the power source will be visible in WeldCloud™. For more information about the WeldCloud™ unit and features, see the WeldCloud™ instruction manual.

## 6 MAINTENANCE

**NOTE!**

Regular maintenance is important for safe and reliable operation.


Only individuals with the appropriate electrical knowledge (authorised personnel) may remove the safety plates to connect or carry out service, maintenance or repair work on welding equipment.

**CAUTION!**

All warranty undertakings from the supplier cease to apply if the customer attempts any work to rectify any faults in the product during the warranty period.

### 6.1 Cleaning the air filter

1. Release the cover plate with the dust filter (1).
2. Swing out the cover plate (2).
3. Remove the dust filter (3).
4. Blow it clean with compressed air at reduced pressure.
5. Reinstall the filter with the finer mesh on the side against the cover plate (2).
6. Reinstall the cover plate with the filter.

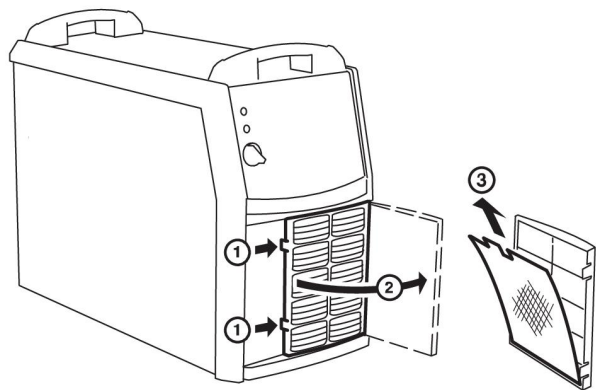

---

## 7 TROUBLESHOOTING

---

Try these recommended checks and inspections before sending for an authorized service technician.

Type of fault	Action
No arc.	<ul style="list-style-type: none"><li>• Check that the main power supply switch is turned on.</li><li>• Check that the welding current supply and return cables are correctly connected.</li><li>• Check that the correct current value is set.</li></ul>
Welding current is interrupted during welding	<ul style="list-style-type: none"><li>• Check whether the thermal overload trips have operated (indicated by the orange lamp on the front panel).</li><li>• Check the main power supply fuses.</li></ul>
The thermal overload trips operate frequently.	<ul style="list-style-type: none"><li>• Check to see whether the air filters are clogged.</li><li>• Make sure that you are not exceeding the rated data for the power source (i.e. that the unit is not being overloaded).</li></ul>
Poor welding performance.	<ul style="list-style-type: none"><li>• Check that the welding current supply and return cables are correctly connected.</li><li>• Check that the correct current value is set.</li><li>• Check that the correct wire is being used.</li><li>• Check the main power supply fuses.</li></ul>

## 8 ORDERING SPARE PARTS

---

Mig 5000i and Mig 5000i WeldCloud™ are designed and tested in accordance with the international and European standards **IEC/EN 60974-1/-2** and **EN 60974-10**.

It is the obligation of the service unit which carried out the service or repair work to make sure that the product still conforms to these standards.




### **CAUTION!**

Repair and electrical work should be performed by an authorised ESAB service technician. Use only ESAB original spare and wear parts.

Spare parts and wear parts can be ordered through your nearest ESAB dealer, see the back cover of this document. When ordering, please state product type, serial number, designation and spare part number in accordance with the spare parts list. This facilitates dispatch and ensures correct delivery.

# DIAGRAM

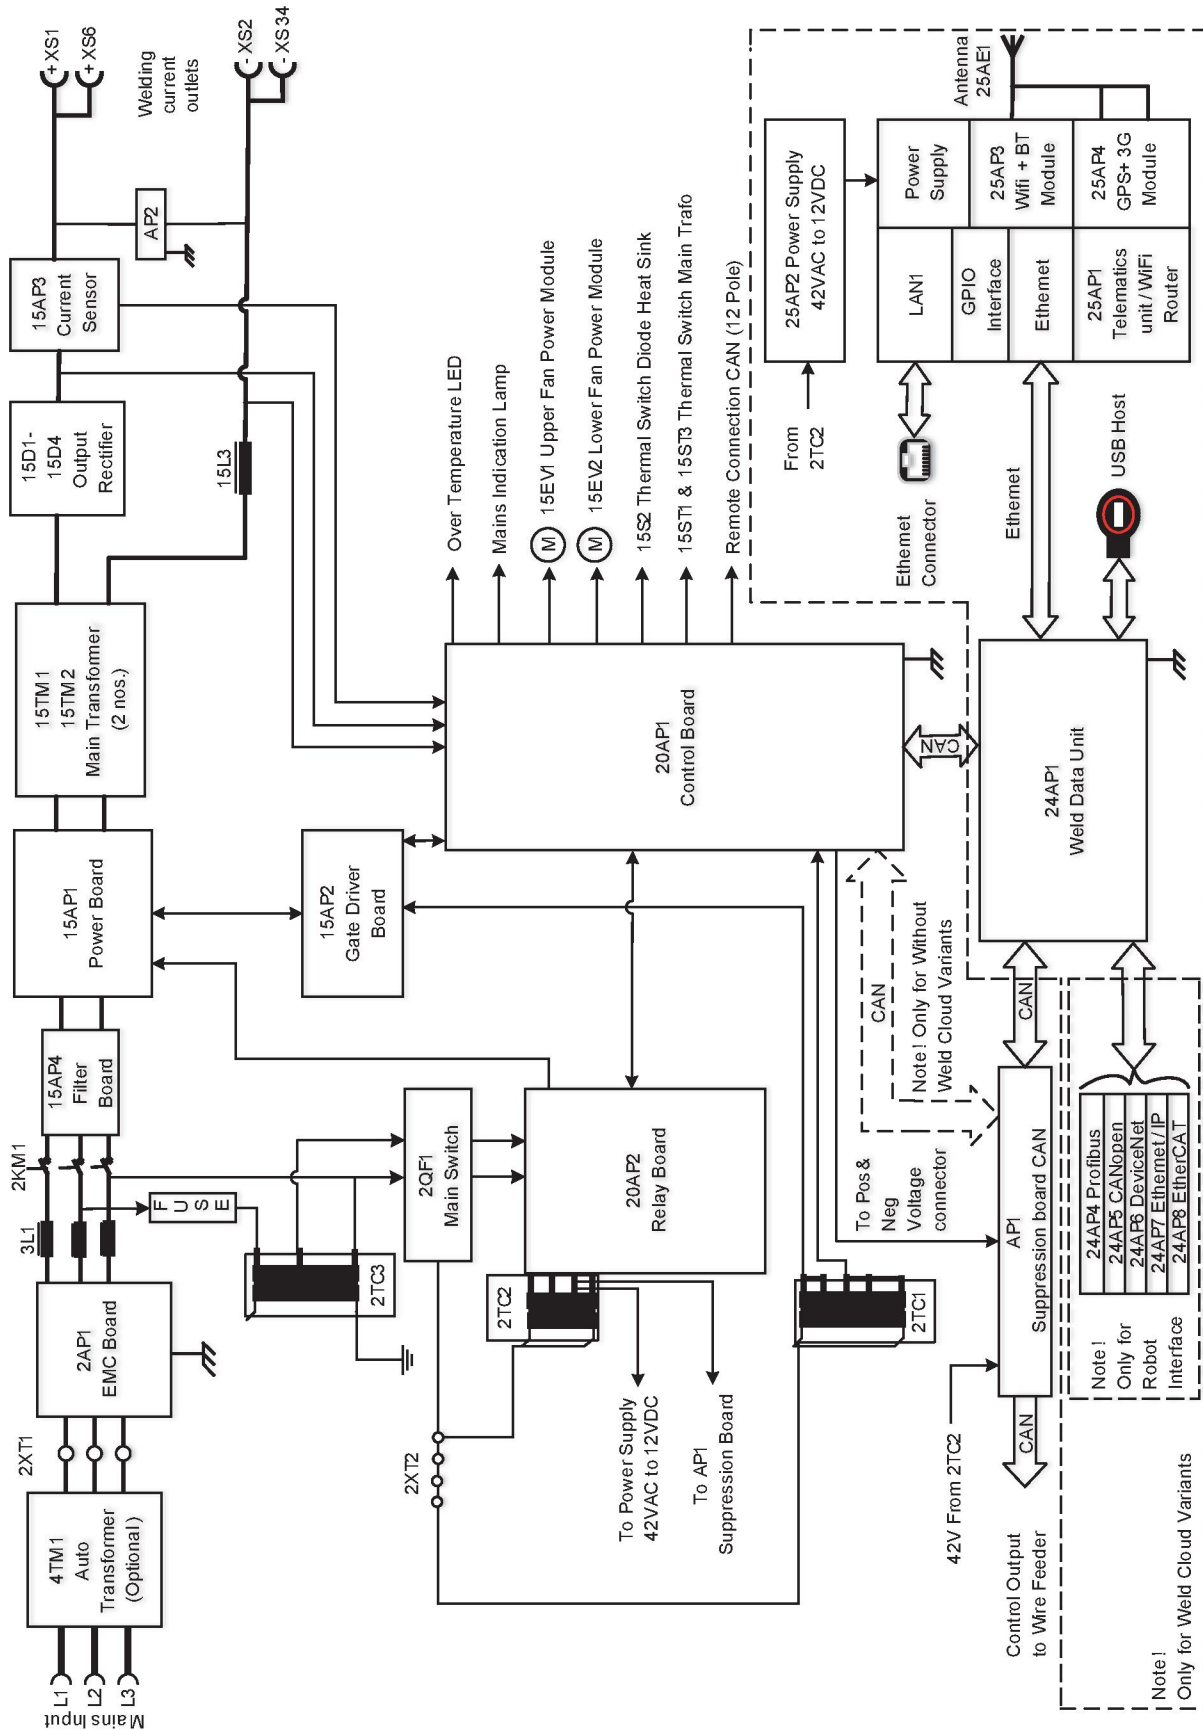




---

## ORDERING NUMBERS

---

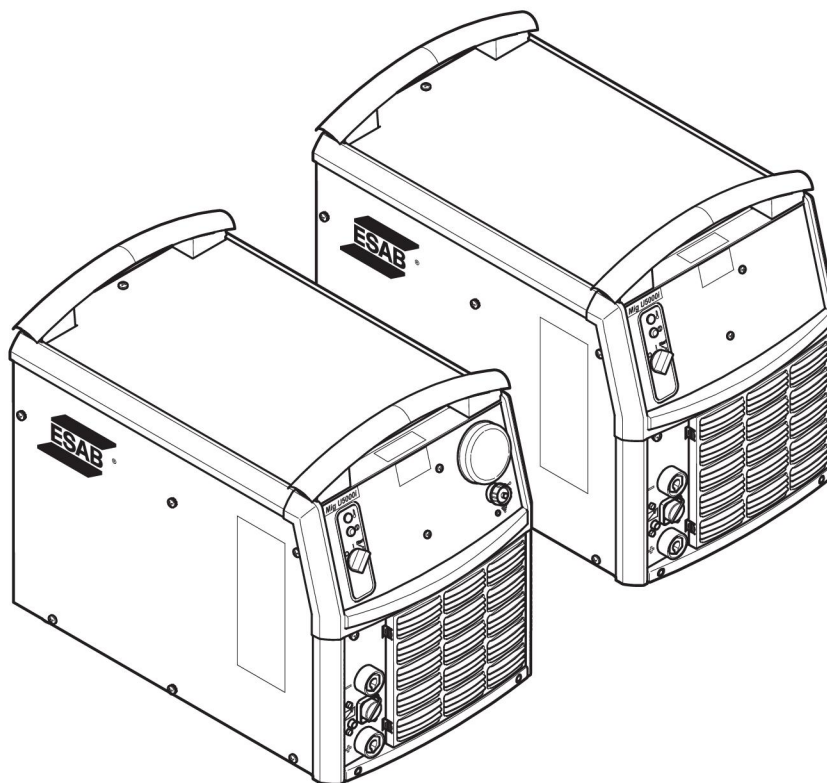

Ordering no.	Denomination	Product	Note
0459 230 884	Welding power source	Mig 5000i	
0445 400 884	Welding power source	Mig 5000i WeldCloud™	With WeldCloud™ unit
0459 839 020	Spare parts list	Mig 5000i, Mig U5000i, Mig 5000i WeldCloud™, Mig U5000i WeldCloud™	


Technical documentation is available on the Internet at: [www.esab.com](http://www.esab.com)

---

## SPARE PARTS LIST


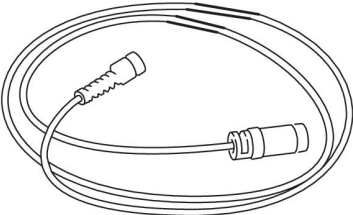
---


Item	Ordering no.	Denomination
1	0458 398 001	Filter
2	0458 383 991	Front grill

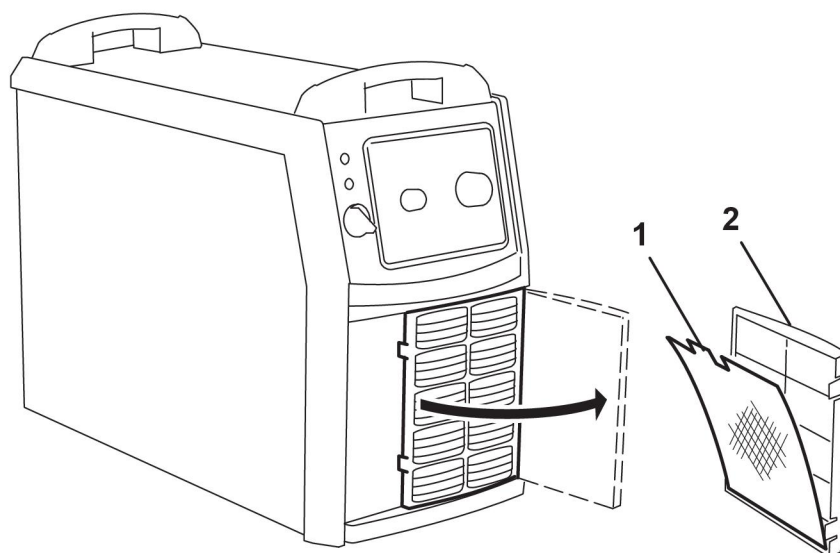



## ACCESSORIES

0458 530 880	<b>Cart</b>	
0458 731 880 0278 300 401	<b>Guide pin</b> <b>Insulating bushing (B)</b> , included in guide pin	
0459 145 880	<b>Autotransformer TUA2</b>	
0459 491 910	<b>Remote control adapter RA12</b> 12 pole For analogue remote controls to CAN based equipment.	
0459 491 880	<b>Remote control unit MTA1 CAN</b> GMAW: wire feed speed and voltage SMAW: current and arc force GTAW: current, pulse and background current	
0459 491 882	<b>Remote control unit M1 10Prog CAN</b> Choice of one of 10 programs GMAW: voltage deviation GTAW and SMAW: current deviation	

0459 491 883	<b>Remote control unit AT1 CAN</b> SMAW and GTAW: current	
0459 491 884	<b>Remote control unit AT1 CF CAN</b> SMAW and GTAW: rough and fine setting of current.	
	<b>Remote control cable 4 pole - 12 pole</b>	
0459 554 884	0.8 ft (0.25 m)	
0459 554 880	16.4 ft (5 m)	
0459 554 881	32.9 ft (10 m)	
0459 554 882	49.4 ft (15 m)	
0459 554 883	82.0 ft (25 m)	

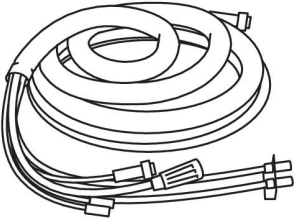	<b>Connection set CAN 12-12 pole</b>	
0456 528 880	5.6 ft (1.7 m)	
0456 528 890	16.4 ft (5 m)	
0456 528 881	32.9 ft (10 m)	
0456 528 882	49.4 ft (15 m)	
0456 528 883	82.0 ft (25 m)	
0456 528 884	115 ft (35 m)	
	<b>Connection set air-cooled CAN 12-10 pole</b>	
0456 528 960	5.6 ft (1.7 m)	
0456 528 961	16.4 ft (5 m)	
0456 528 962	32.9 ft (10 m)	
	<b>Connection set water CAN 12-12 pole</b>	
0456 528 885	5.6 ft (1.7 m)	
0456 528 895	16.4 ft (5 m)	
0456 528 886	32.9 ft (10 m)	
0456 528 887	49.4 ft (15 m)	
0456 528 888	82.0 ft (25 m)	
0456 528 889	115 ft (35 m)	
	<b>Connection set water CAN 12-10 pole</b>	
0459 528 970	5.6 ft (1.7 m)	
0459 528 971	16.4 ft (5 m)	
0459 528 972	32.9 ft (10 m)	
0459 528 973	49.4 ft (15 m)	
0459 528 974	82.0 ft (25 m)	
0459 528 975	115 ft (35 m)	
	<b>Connection set air-cooled CAN 12-10 pole</b>	
0459 528 960	5.6 ft (1.7 m)	
0459 528 961	16.4 ft (5 m)	
0459 528 962	32.9 ft (10 m)	

## ACCESSORIES

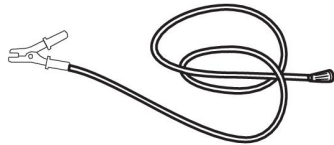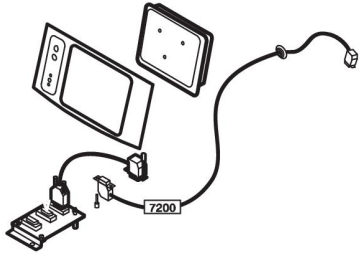0700 006 897	<b>Return cable</b> 16.4 ft (5 m), 2/0 AWG	
0459 579 880	<b>MMC kit for power source Mig</b>	





# ESAB subsidiaries and representative offices

## Europe

### AUSTRIA

ESAB Ges.m.b.H  
Vienna-Liesing  
Tel: +43 1 888 25 11  
Fax: +43 1 888 25 11 85

### BELGIUM

S.A. ESAB N.V.  
Heist-op-den-Berg  
Tel: +32 15 25 79 30  
Fax: +32 15 25 79 44

### BULGARIA

ESAB Kft Representative Office  
Sofia  
Tel: +359 2 974 42 88  
Fax: +359 2 974 42 88

### THE CZECH REPUBLIC

ESAB VAMBERK s.r.o.  
Vamberk  
Tel: +420 2 819 40 885  
Fax: +420 2 819 40 120

### DENMARK

Aktieselskabet ESAB  
Herlev  
Tel: +45 36 30 01 11  
Fax: +45 36 30 40 03

### FINLAND

ESAB Oy  
Helsinki  
Tel: +358 9 547 761  
Fax: +358 9 547 77 71

### GREAT BRITAIN

ESAB Group (UK) Ltd  
Waltham Cross  
Tel: +44 1992 76 85 15  
Fax: +44 1992 71 58 03

ESAB Automation Ltd  
Andover

Tel: +44 1264 33 22 33  
Fax: +44 1264 33 20 74

### FRANCE

ESAB France S.A.  
Cergy Pontoise  
Tel: +33 1 30 75 55 00  
Fax: +33 1 30 75 55 24

### GERMANY

ESAB Welding & Cutting GmbH  
Langenfeld  
Tel: +49 2173 3945-0  
Fax: +49 2173 3945-218

### HUNGARY

ESAB Kft  
Budapest  
Tel: +36 1 20 44 182  
Fax: +36 1 20 44 186

### ITALY

ESAB Saldatura S.p.A.  
Bareggio (Mi)  
Tel: +39 02 97 96 8.1  
Fax: +39 02 97 96 87 01

## THE NETHERLANDS

ESAB Nederland B.V.  
Amersfoort  
Tel: +31 33 422 35 55  
Fax: +31 33 422 35 44

## NORWAY

AS ESAB  
Larvik  
Tel: +47 33 12 10 00  
Fax: +47 33 11 52 03

## POLAND

ESAB Sp. z o.o.  
Katowice  
Tel: +48 32 351 11 00  
Fax: +48 32 351 11 20

## PORTUGAL

ESAB Lda  
Lisbon  
Tel: +351 8 310 960  
Fax: +351 1 859 1277

## ROMANIA

ESAB Romania Trading SRL  
Bucharest  
Tel: +40 316 900 600  
Fax: +40 316 900 601

## RUSSIA

LLC ESAB  
Moscow  
Tel: +7 (495) 663 20 08  
Fax: +7 (495) 663 20 09

## SLOVAKIA

ESAB Slovakia s.r.o.  
Bratislava  
Tel: +421 7 44 88 24 26  
Fax: +421 7 44 88 87 41

## SPAIN

ESAB Ibérica S.A.  
San Fernando de Henares  
(MADRID)  
Tel: +34 91 878 3600  
Fax: +34 91 802 3461

## SWEDEN

ESAB Sverige AB  
Gothenburg  
Tel: +46 31 50 95 00  
Fax: +46 31 50 92 22

ESAB International AB  
Gothenburg  
Tel: +46 31 50 90 00  
Fax: +46 31 50 93 60

## SWITZERLAND

ESAB Europe GmbH  
Baar  
Tel: +41 1 741 25 25  
Fax: +41 1 740 30 55

## UKRAINE

ESAB Ukraine LLC  
Kiev  
Tel: +38 (044) 501 23 24  
Fax: +38 (044) 575 21 88

## North and South America

### ARGENTINA

CONARCO  
Buenos Aires  
Tel: +54 11 4 753 4039  
Fax: +54 11 4 753 6313

### BRAZIL

ESAB S.A.  
Contagem-MG  
Tel: +55 31 2191 4333  
Fax: +55 31 2191 4440

### CANADA

ESAB Group Canada Inc.  
Mississauga, Ontario  
Tel: +1 905 670 0220  
Fax: +1 905 670 4879

### MEXICO

ESAB Mexico S.A.  
Monterrey  
Tel: +52 8 350 5959  
Fax: +52 8 350 7554

### USA

ESAB Welding & Cutting  
Products  
Florence, SC  
Tel: +1 843 669 4411  
Fax: +1 843 664 5748

## Asia/Pacific

### AUSTRALIA

ESAB South Pacific  
Archerfield BC QLD 4108  
Tel: +61 1300 372 228  
Fax: +61 7 3711 2328

### CHINA

Shanghai ESAB A/P  
Shanghai  
Tel: +86 21 2326 3000  
Fax: +86 21 6566 6622

### INDIA

ESAB India Ltd  
Calcutta  
Tel: +91 33 478 45 17  
Fax: +91 33 468 18 80

### INDONESIA

P.T. ESABindo Pratama  
Jakarta  
Tel: +62 21 460 0188  
Fax: +62 21 461 2929

### JAPAN

ESAB Japan  
Tokyo  
Tel: +81 45 670 7073  
Fax: +81 45 670 7001

### MALAYSIA

ESAB (Malaysia) Snd Bhd  
USJ  
Tel: +603 8023 7835  
Fax: +603 8023 0225

### SINGAPORE

ESAB Asia/Pacific Pte Ltd  
Singapore  
Tel: +65 6861 43 22  
Fax: +65 6861 31 95

## SOUTH KOREA

ESAB SeAH Corporation  
Kyungnam  
Tel: +82 55 269 8170  
Fax: +82 55 289 8864

## UNITED ARAB EMIRATES

ESAB Middle East FZE  
Dubai  
Tel: +971 4 887 21 11  
Fax: +971 4 887 22 63

## Africa

### EGYPT

ESAB Egypt  
Dokki-Cairo  
Tel: +20 2 390 96 69  
Fax: +20 2 393 32 13

## SOUTH AFRICA

ESAB Africa Welding & Cutting  
Ltd  
Durbanvill 7570 - Cape Town  
Tel: +27 (0)21 975 8924

## Distributors

*For addresses and phone numbers to our distributors in other countries, please visit our home page*

[www.esab.com](http://www.esab.com)



[www.esab.com](http://www.esab.com)

