



Aristo®

U8₂



Instruction manual

1	SAFETY	5
2	INTRODUCTION	7
2.1	Control panel Aristo U82	7
2.1.1	Keys and knobs.....	7
2.2	Location	8
2.3	USB connection	8
2.3.1	Insert the USB memory.....	9
2.4	First step – choose the language	9
2.5	Display	10
2.5.1	Symbols in the display	11
2.6	General information about settings	12
2.6.1	Setting of numerical values	12
2.6.2	Setting with given alternatives.....	12
2.6.3	Settings ON/OFF.....	12
2.6.4	QUIT and ENTER	12
3	MENUS	13
3.1	Main menu	13
3.1.1	Configuration menu.....	14
3.1.2	Tools menu.....	14
3.1.3	Weld Data Setting menu	15
3.1.4	Measure	16
3.1.5	Weld Data Memory menu	17
3.1.6	Fast mode menu	17
4	MIG/MAG WELDING	18
4.1	Settings in the Weld Data Setting menu	18
4.1.1	MIG/MAG welding with short-/sprayarc.....	18
4.1.2	MIG/MAG welding with pulsing	19
4.1.3	MIG/MAG welding with SuperPulse, primary/secondary, short-/sprayarc/pulsing	20
4.2	Function explanations for settings	21
4.2.1	QSet	27
4.2.2	Synergy group.....	27
4.3	SuperPulse	28
4.3.1	Wire and gas combinations.....	29
4.3.2	Different pulsing methods	29
4.3.3	Wire feed unit.....	29
5	MMA WELDING	32
5.1	MMA welding DC	32
5.2	MMA welding AC	32
5.3	Function explanations for settings	33

6	TIG WELDING	34
6.1	Settings in the Weld Data Setting menu	34
6.1.1	TIG welding without pulsing DC	34
6.1.2	TIG welding with pulsing DC	34
6.1.3	TIG welding without pulsing AC	35
6.2	Function explanations for settings	35
6.3	Other function explanations	40
7	ARC AIR GOUGING	41
7.1	Settings in the Weld Data Setting menu	41
7.2	Explanation of functions	41
8	MEMORY MANAGEMENT	42
8.1	Control panel working method	42
8.2	Store	43
8.3	Recall	44
8.4	Delete	45
8.5	Copy	45
8.6	Edit	46
8.7	Name	48
9	CONFIGURATION MENU	49
9.1	Code lock	49
9.1.1	Lock code status	50
9.1.2	Specify/edit lock code	50
9.2	Remote controls	50
9.2.1	Forget override.....	51
9.2.2	Configuration for digital remote control unit	51
9.2.3	Configuration for analog remote control unit.....	51
9.2.4	Scale on inputs.....	52
9.3	MIG/MAG defaults	52
9.3.1	Gun trigger mode (2-stroke/4-stroke).....	53
9.3.2	4-stroke configuration.....	54
9.3.3	Soft key configuration.....	55
9.3.4	Voltage measurement in pulsing.....	56
9.3.5	AVC feeder	56
9.3.6	Release pulse	56
9.4	MMA defaults	56
9.5	Fast mode soft keys	56
9.6	Double start sources	57
9.7	Panel remote enable	57
9.8	WF supervision	57
9.9	Auto save mode	57

9.10	Trigger weld data switch	58
9.11	Multiple wire feeders	59
9.12	Quality functions	60
9.13	Maintenance	60
9.14	Unit of length	61
9.15	Measure value frequency	61
9.16	Register key	61
10	TOOLS	63
10.1	Error log	63
10.1.1	Error code descriptions	64
10.2	Export/Import	67
10.3	File Manager	68
10.3.1	Deleting a file/folder	69
10.3.2	Renaming a file/folder	69
10.3.3	Creating new folder	70
10.3.4	Copying and pasting files	70
10.4	Edit setting limits	70
10.5	Edit measure limits	71
10.6	Production statistics	72
10.7	Quality functions	73
10.7.1	Store quality data	73
10.8	User-defined synergic data	74
10.8.1	Specify voltage/wire coordinates	75
10.8.2	Specify valid wire/gas combination	75
10.8.3	Create your own wire/gas alternative	76
10.9	Calendar	77
10.10	User accounts	77
10.11	Unit information	78
11	ORDERING SPARE PARTS	79
	MENU STRUCTURE	80
	WIRE AND GAS DIMENSIONS	86
	ORDERING NUMBERS	93
	ACCESSORIES	94

1 SAFETY

**NOTE!**

The unit is tested by ESAB in a general set-up. The responsibility for the safety and function of the specific set-up lies with the integrator.

Users of ESAB equipment have the ultimate responsibility for ensuring that anyone who works on or near the equipment observes all the relevant safety precautions. Safety precautions must meet the requirements that apply to this type of equipment. The following recommendations should be observed, in addition to the standard regulations that apply to the workplace.

All work must be carried out by trained personnel well-acquainted with the operation of the equipment. Incorrect operation of the equipment may lead to hazardous situations, which could result in injury to the operator and damage to the equipment.

1. Anyone who uses the equipment must be familiar with:
 - its operation
 - the location of emergency stops
 - its function
 - the relevant safety precautions
 - welding and cutting or other applicable operation of the equipment
2. The operator must ensure that:
 - no unauthorised person is within the working area of the equipment when it is started up
 - no-one is unprotected when the arc is struck or work is started with the equipment
3. The workplace must:
 - be suitable for the purpose
 - be free from drafts
4. Personal safety equipment:
 - Always wear recommended personal safety equipment, such as safety glasses, flame-proof clothing, safety gloves
 - Do not wear loose-fitting items, such as scarves, bracelets, rings, etc., which could become trapped or cause burns
5. General precautions:
 - Make sure the return cable is connected securely
 - Work on high voltage equipment **may only be carried out by a qualified electrician**
 - Appropriate fire extinguishing equipment must be clearly marked and close at hand
 - Lubrication and maintenance must **not** be carried out on the equipment during operation



NOTE!

Dispose of electronic equipment at a recycling facility!

To conform with the European Directive 2002/96/EC on Waste Electrical and Electronic Equipment and its implementation in accordance with national law, electrical and/or electronic equipment that has reached the end of its life must be disposed of at a recycling facility.

As the person responsible for the equipment, it is your responsibility to obtain information on approved collection stations.

For further information contact the nearest ESAB dealer.



2 INTRODUCTION

To benefit as much as possible from your welding equipment, we recommend that you read this instruction manual.

For general information about operation, see the instruction manuals for the power source and wire feed unit.

The text in the display is available in the following languages: English, Swedish, Finnish, Norwegian, Danish, German, French, Italian, Dutch, Spanish, Portuguese, Hungarian, Polish, American, Czech, Chinese and Turkish.






NOTE!

There may be differences in the way the panel functions, depending on the product in which it is installed.

2.1 Control panel Aristo U82

The control panel is supplied with a mounting bracket with screws and an English instruction manual. A 1.2 m cable is mounted onto the panel. USB memory and an extension cable are available as accessories; see the "ACCESSORIES" chapter of this manual.

Instruction manuals in other languages can be downloaded from the Internet: www.esab.com

1. Connector for USB memory
2. Knob for moving cursor
3. Display
4. Soft keys 
5. Menu 
6. Enter 
7. Knob for increasing or decreasing set values and setting the voltage, #
8. Knob for increasing or decreasing set values and setting the wire feed speed, *



2.1.1 Keys and knobs

Soft keys (4)

The five keys in a row under the display have varying functions. These are "soft" keys, i.e. they can have different functions depending on which menu you are currently working in. The current function for these keys appears in the text in the bottom row of the display.

When the function is active, the key turns white:

WELD
DATA 2



Menu key (5)

The Menu key  always takes you back to the main menu:

MIG/MAG	
PROCESS	MIG/MAG
METHOD	SHORT/SPRAY
QSET	OFF
SYNERGY GROUP	STANDARD
WIRE TYPE	ER70S
SHIELDING GAS	Ar+8%CO2
WIRE DIAMETER	1.2 mm
CONFIGURATION▶	
TOOLS▶	

SET	MEASURE	MEMORY	FAST MODE
-----	---------	--------	--------------

Enter key (6)

The enter key  confirms a selection.

Cursor knob (2)

Use the left knob to move the cursor to different rows in the display.

Plus/minus knobs (7, 8)

The right knobs increase or decrease the value of a setting. To the side of the knobs there is a symbol, a number sign # or a star *. Most numerical settings can be adjusted with either knob, although some settings must be made with a particular knob.

2.2 Location

On the reverse of the control panel, there is a foldout stand that lets you to place the panel onto a surface and view the display in an upright position. The stand also acts as a mounting device, allowing you to hang the control panel on the wire feed unit.

**2.3 USB connection**

External USB memories can be used to transfer programs to and from the control panel. See more in the "Export/Import" section.

The files produced in the control panel are stored as XML files. The USB memory must be formatted in FAT 32.

During normal use, there is no risk of "viruses" infecting the equipment. To eliminate this risk entirely, we recommend that the memory used with this equipment not be used for any other purpose.

Some USB memories may not work with this equipment. We recommend using USB memories from a reputable supplier. ESAB assumes no responsibility for any damage caused as a consequence of the incorrect use of a USB memory.

2.3.1 Insert the USB memory


Insert USB memory as follows:

- Turn off the power source's main switch.
- Open the cover on the left end of the control panel.
- Insert the USB memory into the USB port.
- Close the cover.
- Turn on the power source's main switch.



2.4 First step – choose the language


This menu appears in the display the first time you start the equipment.

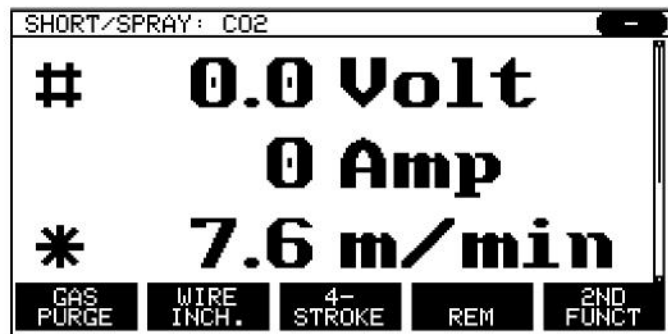

By default, the control panel is set to English. To select your language, proceed as follows.


Press MENU  to open the main menu.

Using the left knob, position the cursor on the CONFIGURATION row.

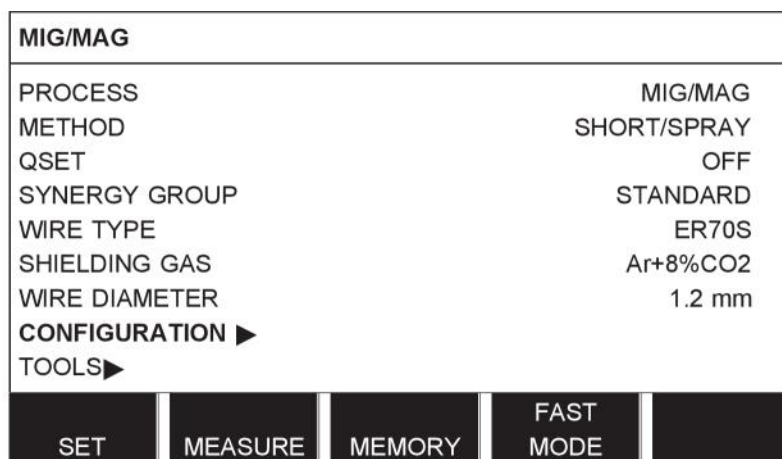

Press ENTER 


Position the cursor on the LANGUAGE row. Press ENTER to bring up a list of the languages that are available in the control panel.

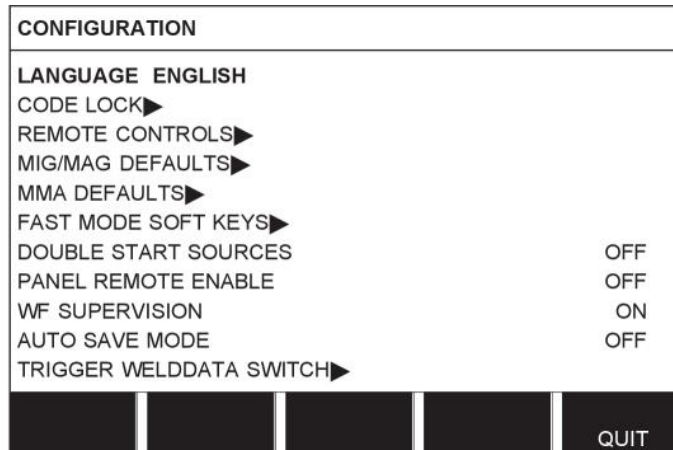

Position the cursor on the row for your language, then press ENTER.



2.5 Display

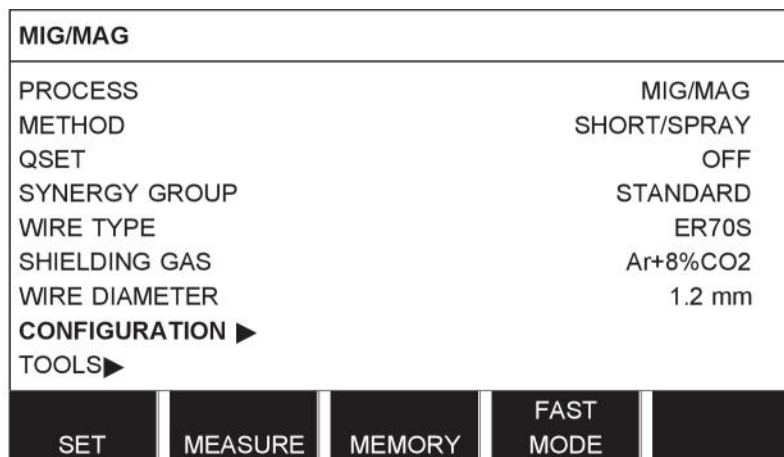


Cursor

The control panel's cursor is presented as a shaded field around the text, with the selected text turning white. The selection is displayed in the instruction manual in bold text.

Arrows and scroll bars

A black arrow behind the text indicates that there is more information behind a row. A scroll bar to the right of the display indicates that there are more rows in the list:

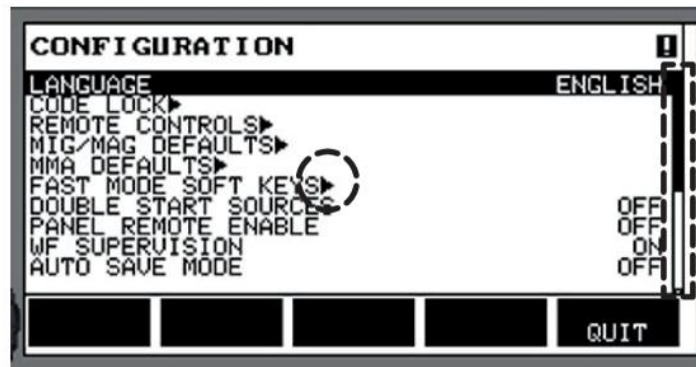


Text boxes

At the bottom of the display are five boxes containing text that describes the current function of the five keys directly below the boxes.

Energy saving mode

To increase the life of the background lighting, it is switched off after three minutes of no activity.

2.5.1 Symbols in the display

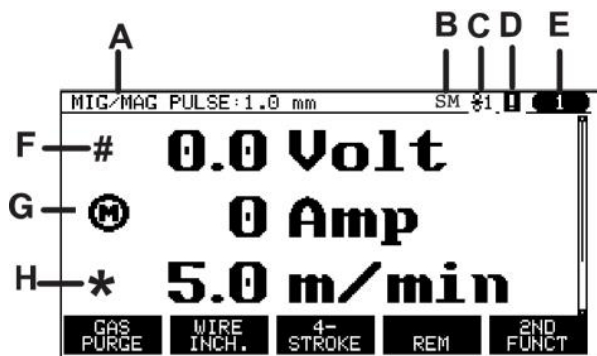

- A The selected weld data set
- B S = Setting limit activated
M = Measure limit activated
- C Selected wire feed unit
- D A fault has occurred; see the "Error log" section in the "TOOLS" chapter.
- E Recalled memory position number
- F Select the plus/minus knob marked # to increase or decrease a parameter value.
- G Measured motor current
- H Select the plus/minus knob marked * to increase or decrease a parameter value.



- I Editing mode, editing memory position

2.6 General information about settings

There are three main types of settings:


- Setting of numerical values
- Setting with given alternatives
- Setting of ON/OFF mode

2.6.1 Setting of numerical values

When setting a numerical value, one of the two plus/minus knobs is used to increase or decrease a given value. A number of values can also be changed using the remote control unit.

2.6.2 Setting with given alternatives

Some settings are made by selecting an alternative from a list. Such a list might look like this:

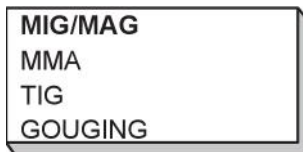

Here, the cursor is placed on the row for MIG/MAG. By pressing ENTER in this position, the MIG/MAG alternative is selected. If you want to choose another alternative instead, position the cursor on the correct row by stepping up or down with the left knob. Then press ENTER. If you want to exit the list without selecting, press QUIT.

2.6.3 Settings ON/OFF

For some functions, it is possible to set the values ON and OFF. The synergy function during MIG/MAG and MMA welding is an example. The ON or OFF settings can be selected from a list of alternatives as described above.

2.6.4 QUIT and ENTER

The “soft” key farthest to the right is used primarily for QUIT, although it is occasionally used for other functions.

- Pressing QUIT moves you back to the previous menu or screen.

The  key is called ENTER in this manual.

- Pressing ENTER involves executing a selected choice in a menu or list.

3 MENUS

The control panel uses several menus. They are the Main, Configuration, Tools, Weld Data Setting, Measure, Weld Data Memory and Fast Mode. The menu structures are presented in the "MENU STRUCTURE" appendix at the end of this manual. During start-up, a start-up screen containing information about the current program version is also displayed briefly.




Start-up screen

3.1 Main menu


In the MAIN MENU, you can change the welding process, welding method, wire type and so on.

From this menu, you can access all other submenus.

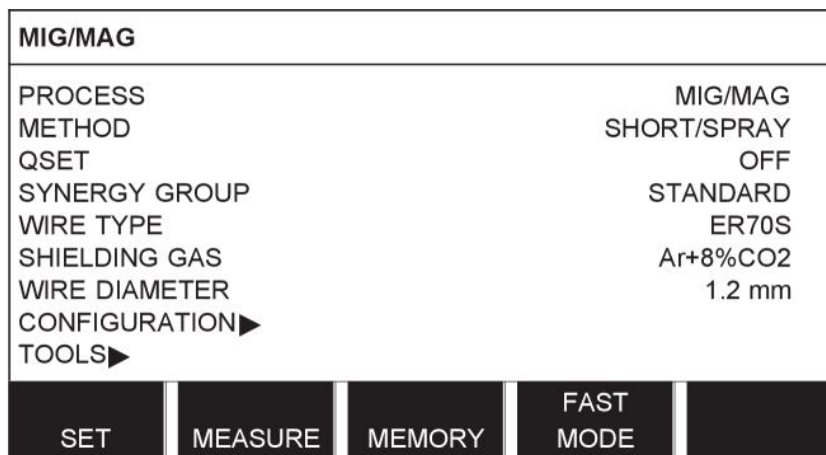


3.1.1 Configuration menu

In the CONFIGURATION menu, you can change language, other basic settings, units of measurement and so on.

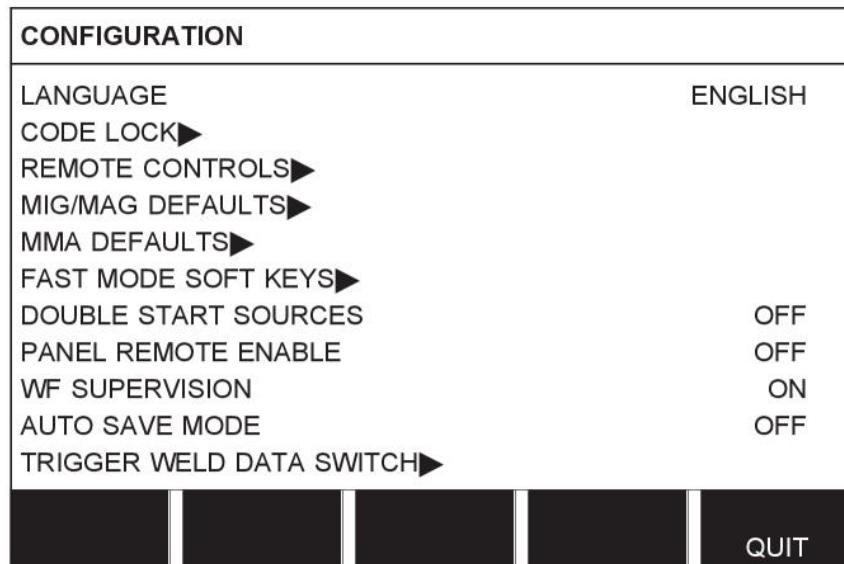

3.1.2 Tools menu

In the TOOLS menu, you can transfer files, view quality and production statistics, view error logs and so on.

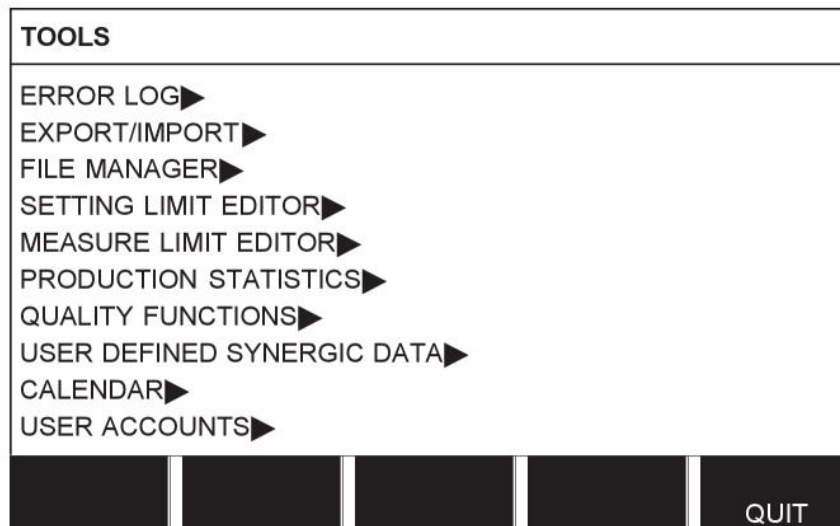

3.1.3 Weld Data Setting menu

SET

In the WELD DATA SETTING menu, you can adjust various welding parameters. This menu appears differently depending on which welding process is selected. The example shows MIG/MAG welding with short-/sprayarc.


WELD DATA SETTING	
VOLTAGE	28.2 (+3.5) V
WIRE SPEED	6.0 M/MIN
INDUCTANCE	80%
SYNERGIC MODE	ON
START DATA▶	
STOP DATA▶	
SETTING LIMITS▶	
MEASURE LIMITS▶	
SPOT WELDING▶	
EDIT DESCRIPTION▶	

CRATER FILL	HOT START	4- STROKE	QUIT
----------------	--------------	--------------	------

3.1.4 Measure

MEASURE

In MEASURE, you can view measured values for various welding parameters while welding is in progress.

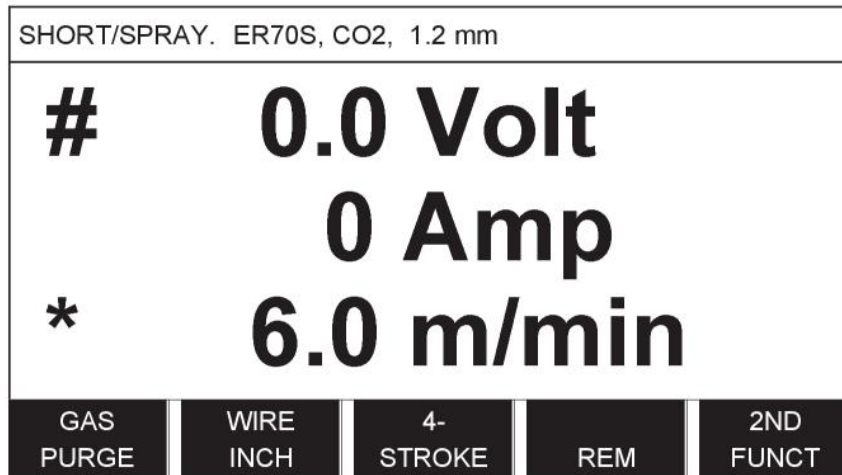

You can change the value of certain parameters in the Measure screen. The parameters you can change depend on which welding process is set. The parameter values that can be adjusted are always marked with # or *.


The measured values remain in the display even after welding has been completed. You can move to different menus without losing the measurement values. If the set value is altered when welding is not in progress, the measurement value is changed to zero in order to avoid confusion.

TIP: When pulsing, you can select whether the voltage value is displayed as an average or a peak value. This setting can be adjusted under MIG/MAG defaults; see the "MIG/MAG defaults" section.

3.1.5 Weld Data Memory menu

MEMORY

In the WELD DATA MEMORY menu, you can store, recall, delete and copy various set weld data. The weld data sets can be stored in 255 different memory positions.

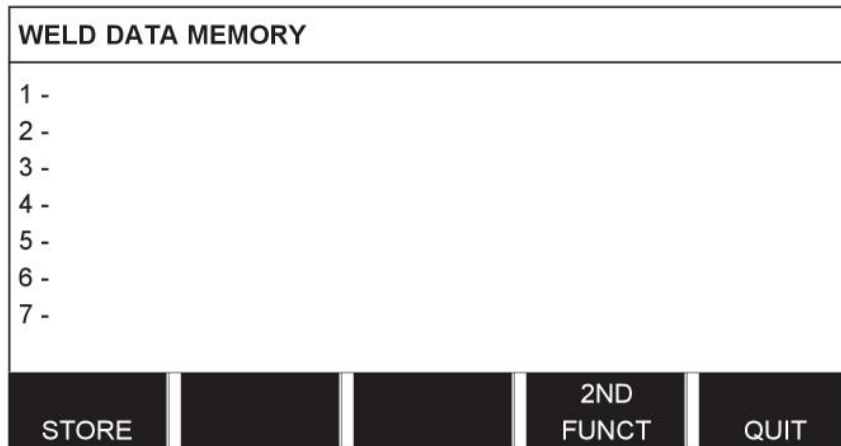


For further information, see the “MEMORY MANAGEMENT” chapter.

3.1.6 Fast mode menu

FAST MODE

In the FAST MODE menu, you can “link” soft keys to weld data memory positions. These settings are carried out in the Configuration menu. The number of the selected memory position is displayed in the upper-right corner.

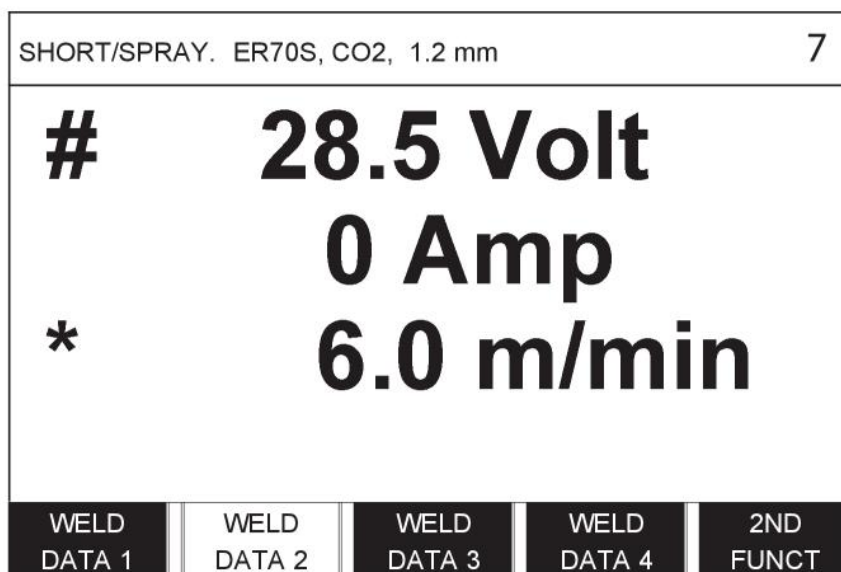

For further information, see the “Fast mode soft keys” section.

4 MIG/MAG WELDING


Main menu → Process

MIG/MAG welding melts a continuously supplied filler wire, with the weld pool protected by shielding gas.

Pulsing is used to influence the transfer of the droplets from the arc so that it remains stable and spatter free, even with low weld data.

For wire diameters that can be used for **MIG/MAG** welding with **SHORT-/SPRAYARC** and with **PULSING**, see the "WIRE AND GAS DIMENSIONS" appendix at the end of this manual.

When the MIG/MAG process is selected, you can choose between four methods by selecting Method with the left knob and then pressing ENTER. Choose between short-/sprayarc, pulse, or superpulse, then press ENTER again.

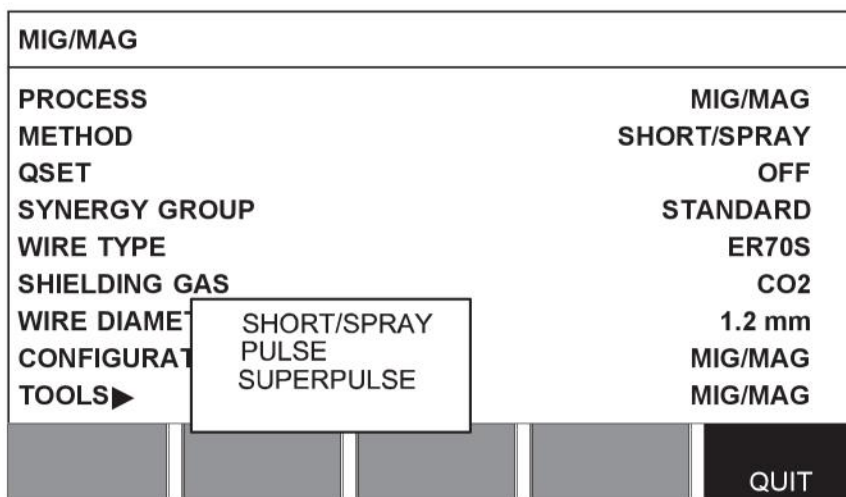

4.1 Settings in the Weld Data Setting menu

4.1.1 MIG/MAG welding with short-/sprayarc

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Voltage	8 - 60 V	0.25 V (displayed with one decimal)	x	x
Wire feed speed**	0.8 - 30.0 m/min	0.1 m/min		x
Inductance	0 - 100%	1%	x	x
Regulator type	1 - 12	1	x	-
Synergy*	OFF or ON	-	-	-
Gas pre-flow	0.1 - 25 s	0.1 s		x
Creep start	OFF or ON	-		x
"Hot start"	OFF or ON	-		x
"Hot start" time	0 - 10 s	0.1 s		x
"Hot start" wire feed	Complete wire feed range	0.1 m/min		x
"Touch sense"	10 - 16 A			
Soft start	OFF or ON	-		x

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Crater filling	OFF or ON	-		x
Crater filling time	0 - 10 s	0.1 s		x
Final crater filling wire feed	1.5 m/min at current wire feed speed	0.1 m/min		x
Final crater filling voltage	8 - 24.7 V		x	
“Release pulse”***	OFF or ON			
Burnback time	0 - 1 s	0.01 s		x
Termination	Final pulse or SCT	-		x
Gas post-flow	0.1 - 25 s	0.1 s		x
Setting limits	1 - 50	-	-	-
Measure limits	1 - 50	-	-	-
Spot welding****	OFF or ON	-		x
Spot welding time	0 - 25 s	0.1 s		x

*) The synergic line on delivery: solid wire (ER70S), shielding gas CO₂ with wire 1.2 mm.

**) The setting range depends on the wire feed unit used.

***) Adjusted in the Configuration menu MIG/MAG defaults.

****) It is not possible to select spot welding (ON) if gun trigger mode is 4-stroke.

4.1.2 MIG/MAG welding with pulsing

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Voltage	10 - 50 V	0.25 V (displayed with one decimal)	x	x
Wire feed speed*	0.8 - 30.0 m/min	0.1 m/min		x
Pulse current**	100 - 650 A	4 A	x	
Pulse time	1.7 - 25.5 ms	0.1 ms	x	
Pulse frequency	16 - 312 Hz	2 Hz	x	
Background current	4 - 300 A	1 A	x	
Slope	1 - 9	1	x	
Synergy***	OFF or ON	-	-	
Ka	0 - 100%	1%	x	
Ki	0 - 100%	1%	x	
Gas pre-flow	0.1 - 25 s	0.1 s		x
Creep start	OFF or ON	-		x
Soft start	OFF or ON	-		x
“Hot start”	OFF or ON	-		x
“Hot start” time	0 - 10 s	0.1 s		x
“Hot start” wire feed	Complete wire feed range	0.1 m/min		x
“Touch sense”	10 - 16 A			

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Crater filling (pulsed/not pulsed)	OFF or ON	-		x
Crater filling time	0 - 10 s	0.1 s		x
Final crater filling wire feed	1.5 m/min at current wire feed speed	0.1 m/min		x
Final crater filling voltage	8 - 33.2 V		x	
Final pulse current	100 - max A		x	
Final background current	12 - 50 A		x	
Final frequency	20 - 270 Hz		x	
“Release pulse”****	OFF or ON			
Burnback time	0 - 1 s	0.01 s		x
Termination	Final pulse or SCT	-		x
Gas post-flow	0.1 - 25 s	0.1 s		x
Setting limits	1 - 50	-	-	-
Measure limits	1 - 50	-	-	-
Spot welding*****	OFF or ON	-		x
Spot welding time	0 - 25 s	0.1 s		x

*) The setting range depends on the wire feed unit used.

**) Minimal background current and pulse current depends on which machine type is used.

***) The synergic line on delivery: solid wire (ER70S), shielding gas CO₂ with wire 1.2 mm.

****) Adjusted in the Configuration menu MIG/MAG defaults.

*****) It is not possible to select spot welding (ON) if gun trigger mode is 4-stroke.

4.1.3 MIG/MAG welding with SuperPulse, primary/secondary, short-/sprayarc/pulsing

Main menu → Process → Method → Phase → Method

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Phase	Primary or Secondary	-		x
Method	Short-/sprayarc or pulsing	-		x
Voltage	10 - 50 V	0.25 V (displayed with 1 decimal)	x	x
Wire feed speed*	0.8 - 30.0 m/min	0.1 m/min		x
Inductance	0 - 100%	1%	x	x
Pulse current**	100 - 650 A	4 A	x	
Pulse time	1.7 - 25.5 ms	0.1 ms	x	
Pulse frequency	16 - 312 Hz	2 Hz	x	
Background current	4 - 300 A	1 A	x	
Slope	1 - 9	1	x	

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Ka	0 - 100%	1%	x	
Ki	0 - 100%	1%	x	
Regulator type		1		
Synergy***	OFF or ON	-	-	-
Phase weld time	0 - 2.50 s	0.01 s		x
Gas pre-flow	0.1 - 25 s	0.1 s		x
Creep start	OFF or ON	-		x
Soft start	OFF or ON	-		x
“Hot start”	OFF or ON	-		x
“Hot start” time	0 - 10 s	0.1 s		x
“Hot start” wire feed	Complete wire feed range	0.1 m/min		x
“Hot start” voltage	-14 to +27 V			-
“Touch sense”	10 - 16 A			x
Crater filling (pulsed/not pulsed)	OFF or ON	-		x
Crater filling time	0 - 10 s	0.1 s		x
Final crater filling wire feed	1.5 m/min at current wire feed speed	0.1 m/min		x
Final crater filling voltage	8 - 33.2 V		x	
Final pulse current	100 - max A		x	
Final background current	12 - 50 A		x	
Final frequency	20 - 270 Hz		x	
Cutoff pulse	%			
Burnback time	0 - 1 s	0.01 s		x
Termination	Final pulse or SCT	-		x
Gas post-flow	0.1 - 25 s	0.1 s		x
Setting limits	1 - 50	-	-	-
Measure limits	1 - 50	-	-	-
Spot welding	OFF or ON	-		x
Spot welding time	0 - 25 s	0.1 s		x
“Release pulse”****	OFF or ON			x

*) The setting range depends on the wire feed unit used.

***) Minimal background current and pulse current depends on which machine type is used.

****) The synergic line on delivery: solid wire (ER70S), shielding gas CO₂ with wire 1.2 mm.

*****) Adjusted in the Configuration menu MIG/MAG basic settings.

4.2 Function explanations for settings

Voltage

Higher voltage increases the arc length and produces a hotter, wider weld pool.

The voltage setting differs between synergy and non-synergy modes. In synergy mode, the voltage is set as a positive or negative offset from the synergic line of the voltage. In non-synergy mode, the voltage is set as an absolute value.

The voltage is set in the Measure, Weld Data Setting, or Fast Mode menus. When the remote control unit is used, the setting can be adjusted from here.

**Wire feed speed**

This sets the required feed speed of the filler wire in m/minute.

The wire feed speed is set in the Measure, Weld Data Setting, or Fast Mode menus. When the remote control unit is used, the setting can be adjusted from here.

**Inductance**

Higher inductance results in a wider weld pool and less spatter. Lower inductance produces a harsher sound, but a stable, concentrated arc.

Inductance is set in the Weld Data Setting menu.

Only applies to MIG/MAG welding with short-/sprayarc.

Regulator type

Affects the short-circuit process and heat in the weld.

The setting should not be altered.

Pulse current

The higher of the two current values in the event of pulsed current.

Pulse current is set in the Weld Data Setting menu with the synergy function switched off.

Only applies to MIG/MAG welding with pulsing.

Pulse time

The time the pulse current is on during a pulse period.

Pulse current is set in the Weld Data Setting menu with the synergy function switched off.

Only applies to MIG/MAG welding with pulsing.

Pulse frequency

Time for background current, which, along with the time for pulse current, gives the pulse period.

Pulse frequency is set in the Weld Data Setting menu with the synergy function switched off.


Only applies to MIG/MAG welding with pulsing.

Background current

The lower of the two current values in the event of pulsed current.

Background current is set in the Weld Data Setting menu with the synergy function switched off.

Only applies to MIG/MAG welding with pulsing.

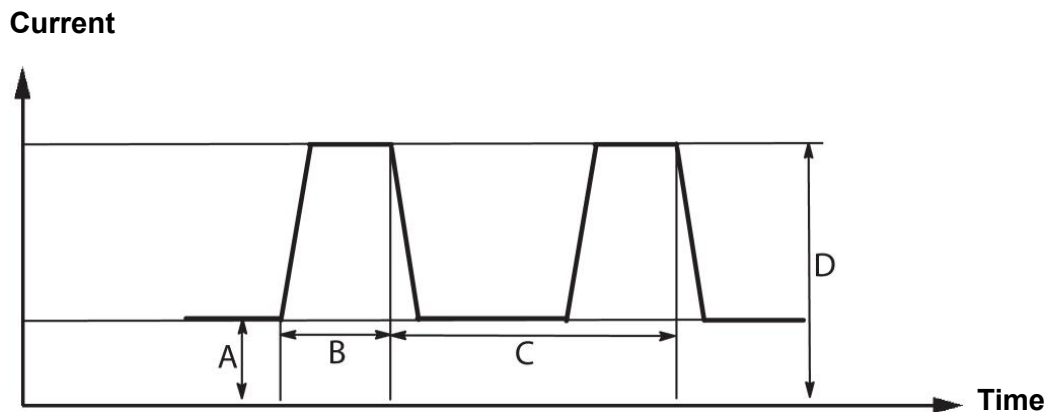

MIG/MAG welding with pulsing

A = Background current

B = Pulse time

C = Pulse period time

D = Pulse current

Slope

“Slope” refers to the pulse current slowly increasing/decreasing to the set value. The “Slope” parameter can be set in nine stages, with each stage corresponding to 100 μ s.

The slope significantly affects the sound. A steep slope produces a louder and sharper sound. Too gentle a slope can, in the worst-case scenario, impair the pulse's ability to cut off the droplet.

Slope is set in the Weld Data Setting menu with the synergy function switched off.

Only applies to MIG/MAG welding with pulsing.

Ka

Ka is the proportional element and corresponds to the regulator's amplification. A low value means that the voltage is not maintained at a constant level as precisely.

Ka is set in the Weld Data Setting menu → Internal constants with the synergy function switched off.

Only applies to MIG/MAG welding with pulsing.

Ki

Ki is the integrating element that attempts to eliminate the fault in the longer term. Here too, a low value produces a weaker regulating effect.

Ki is set in the Weld Data Setting menu → Internal constants with the synergy function switched off.

Only applies to MIG/MAG welding with pulsing.

Synergy

Each combination of wire type, wire diameter and gas mixture requires a unique relationship between wire feed speed and voltage (arc length) to obtain a stable, functioning arc. The voltage (arc length) automatically “conforms” to the preprogrammed synergic line you selected, which makes it much easier to find the correct welding parameters quickly. The link between wire feed speed and other parameters is known as the synergic line.

For wire and gas combinations, see the "WIRE AND GAS DIMENSIONS" appendix at the end of this manual.

It is possible to order different packages of synergic lines, although an authorized ESAB service engineer must install them.

To create your own synergic lines, see the "User defined synergic data" section.

Synergy activation takes place in the Weld Data Setting menu.

Phase

In this function, choose between primary and secondary.

High data is set in primary and low data is set in secondary.

The settings are used to determine whether primary or secondary data is available for editing. It also determines which data is affected in measuring and remote modes. The wire feed speed shown in the Measure screen shows the speed in the selected phase. However, the voltage, current and weld output are based on the measurement under both phases.

You can choose different synergy for the primary and secondary phases.

Primary or secondary phase is set in MIG/MAG SET when SuperPulse is selected and synergy is switched off.



Gas pre-flow

This controls the time during which shielding gas flows before the arc is struck.

Gas pre-flow is set in the Weld Data Setting menu → Start data.



Creep start

Creep start feeds out the wire at 50% of the set speed, until it makes electrical contact with the workpiece.

With hot start, it is 50% of the hot start time.

Creep start is set in the Weld Data Setting menu → Start data.

Soft start

Soft start means that, when the welding wire short-circuits against the workpiece, the wire feed stops. The feed unit begins to reverse the welding wire until the circuit with the workpiece is interrupted and the arc lights. The feed unit then starts to feed the welding wire in the correct direction, and a welding start is performed.

Soft start is set in the Weld Data Setting menu → Start data.

Applies to welding with feed units that support reversed wire feed.

"Hot start"

"Hot start" increases the wire feed speed and the voltage for an adjustable time at the start of the welding process. The main purpose is to provide more energy when starting welding, which reduces the risk of poor fusion at the beginning of the joint.

Synergy – hot start

It is possible to increase the wire feed speed during a specific period compared to the present wire feed speed to provide more energy during the weld start and ensure penetration. The speed is set relative to the ordinary wire feed speed. The time starts when the arc is ignited and the length is the set hot start time. Synergy increases the wire speed by 2 m/min.

Non-synergy – hot start

If non-synergy is selected, the voltage can be set.

During non-synergy and pulsing, voltage, pulse current, background current and frequency can be set.

**NOTE!**

It is possible to set negative values for the hot start wire feed and hot start voltage. This can be used with high weld data to give a smooth weld start by initially "stepping up" the weld data.

Hot start is activated in the Measure screen or in the Weld Data Setting menu → Start data.

Touch sense

The system detects when the wire comes into contact with the workpiece.

Touch sense is set in the Weld Data Setting menu → Start data.

Only applies to robot welding.

Crater filling

Crater filling makes controlled reduction in the heat and size of the weld pool possible when completing the weld. This makes it easier to avoid pores, thermal cracking and crater formation in the weld joint.

In pulse welding mode, it is possible to choose between pulsed and non-pulsed crater filling. Non-pulsed crater filling is the faster process. Pulsed crater filling takes a little longer, yet gives spatter-free crater filling when appropriate values are used.

Synergy – crater filling

In synergy mode, the crater filling time and the final wire feed speed are set in both pulsed and non-pulsed crater filling. The voltage and the pulse parameters drop to the final values with the help of synergy.

Non-synergy - crater filling

In non-synergy mode, the settings can be changed to give another arc length at the end of crater filling. A final time for the final value of crater filling can also be set.

The final voltage can be set for non-pulsed crater filling. The final voltage, final pulse current, final background current and final frequency can be set for pulsed crater filling.

The final parameter values must always be equal to or lower than the set values for continuous welding. If the settings for continuous welding are lowered below the set final values, they also lower the final values. The final parameter values do not increase again if the setting for continuous welding is increased.

Example:

You have 4 m/min as the final wire feed speed and lower the wire feed speed to 3.5 m/min. The final wire feed speed is also lowered to 3.5 m/min. The final wire speed remains at 3.5 m/min even when the wire feed speed is increased again.

Crater filling is activated in the Measure screen or in the Weld Data Setting menu → Stop data.

Pinch-off pulse

Pinch-off pulse is applied to ensure that a ball is not formed on the wire when welding stops.

Applies to MIG/MAG welding with short/spray arc and short pulsing. When pulsing, completion is synchronized with a pulse, the finishing pulse can be set between 20 and 200%.

Pinch-off pulse is set in the Weld Data Setting menu → Stop data.

**Burnback time**

Burnback time is a delay between the time when the wire starts to brake until the time when the power source switches off the welding voltage. Too short a burnback time results in a long wire stickout after finishing the welding, with a risk of the wire catching in the solidifying weld pool. Too long a burnback time results in a shorter stickout, with increased risk of the arc striking back to the contact tip.

Burnback time is set in the Weld Data Setting menu → Stop data.

Termination

Select either Final Pulse or SCT (Short Circuit Termination) here. SCT is a function that generates small, repeated short circuits at the end of welding until the wire feeding has totally stopped and contact with the workpiece has been broken.

Termination is set in the Weld Data Setting menu → Stop data.

Applies to welding with feed units that support reversed wire feed.

Release pulse

The system detects whether the wire becomes trapped in the workpiece. A current pulse is transmitted to release the wire from the surface.

Applies to MIG/MAG welding with short/spray arc and short pulsing. When pulsing, completion is synchronized with a finishing pulse, which can be set between 20 and 200%.

The setting is adjusted in the Configuration menu → MIG/MAG defaults.

**Gas post-flow**

This controls the time during which shielding gas flows after the arc is extinguished.

Gas post-flow is set in the Weld Data Setting menu → Stop data.

Setting limits and measure limits

In limits, a limit number is selected. For settings, see the “Edit setting limits” and “Edit measure limits” sections.

Limits are activated in the Weld Data Setting menu.

Spot welding

Spot welding is used when you want to spot weld thin plates together.



NOTE!

It is **not** possible to shorten the welding time by releasing the trigger switch.

Spot welding is activated and spot welding time is set in the Weld Data Setting menu.

4.2.1 QSet

QSet is used for setting welding parameters. Using the plus/minus knobs, the arc length is increased or decreased from -18 to +18 steps.

SHORT ARC

When first starting welding with a new wire type/gas type, QSet automatically sets all the necessary welding parameters. Subsequently, QSet stores all the data to produce a good weld. The voltage then automatically conforms to changes in the wire feed speed.

SPRAY

When approaching the spray arc area, the value for QSet must be increased. Disengage the QSet function when welding with pure spray arc. All settings are inherited from QSet, with the exception of the voltage which must be set.

Recommendation: Make the first weld (6 seconds) with QSet on a test piece to obtain all the correct data.

The QSet value is set in the Weld Data Setting menu for the MIG/MAG process and SHORT/SPRAY method.


4.2.2 Synergy group

It is possible to choose between the three synergy groups for mechanized welding:

- STANDARD
- ROBOT
- SAT

The relationship between welding speed and plate thickness for the various synergy groups:

Plate thickness

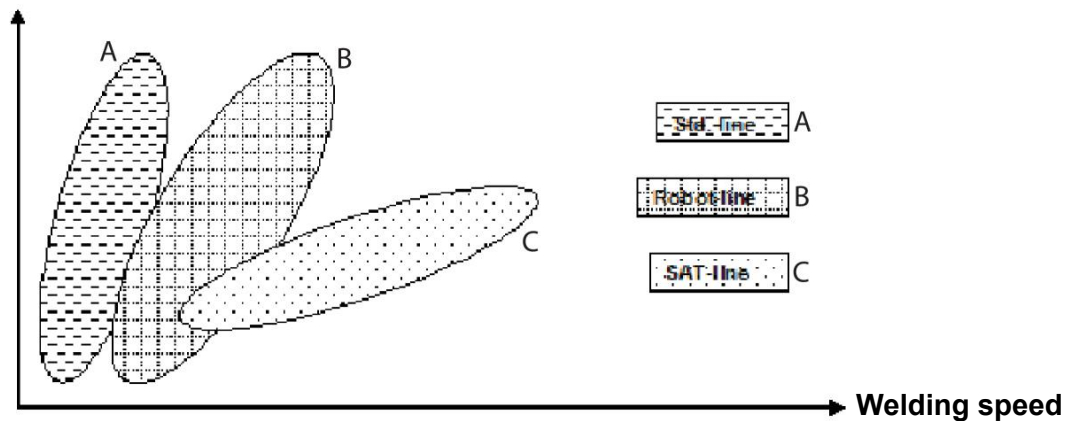

A = STANDARD line

B = ROBOT line

C = SAT line

The **ROBOT** synergy group is used for robotic welding and other mechanized welding. It is suitable for higher transfer speeds than when welding on standard lines.

SAT stands for Swift Arc Transfer. This synergy group is suitable for high transfer-speeds, extreme angles and plate thicknesses of 2–3 mm.

For wire and gas combinations for SAT, see the "WIRE AND GAS DIMENSIONS" appendix at the end of this manual.

The synergy group is set in the Weld Data Setting menu for the MIG/MAG process.

4.3 SuperPulse

Main menu → Process → Method

The SuperPulse method is used for improved control of the weld pool and the solidification process. The weld pool has time to solidify partially between each pulse.

Benefits of using SuperPulse:

- Less sensitivity to root gap variations
- Better control of the weld pool during position welding
- Better control of penetration and penetration profile
- Reduced sensitivity to uneven heat conduction

SuperPulse can be seen as a programmed changeover between two MIG/MAG settings. The time intervals are determined by the primary and secondary phase time settings.


Welding always starts in the primary phase. When hot start is selected, primary data is used during the hot start time in addition to the phase time for the primary data. Crater filling is always based on secondary data. When a stop command has been activated during the primary phase time, the process immediately switches to secondary data. Weld completion is based on secondary data.

4.3.1 Wire and gas combinations

For wire and gas combinations, see the "WIRE AND GAS DIMENSIONS" appendix at the end of this manual.

4.3.2 Different pulsing methods

Below, you can see which pulsing method can be used, depending on the plate thickness to be welded.

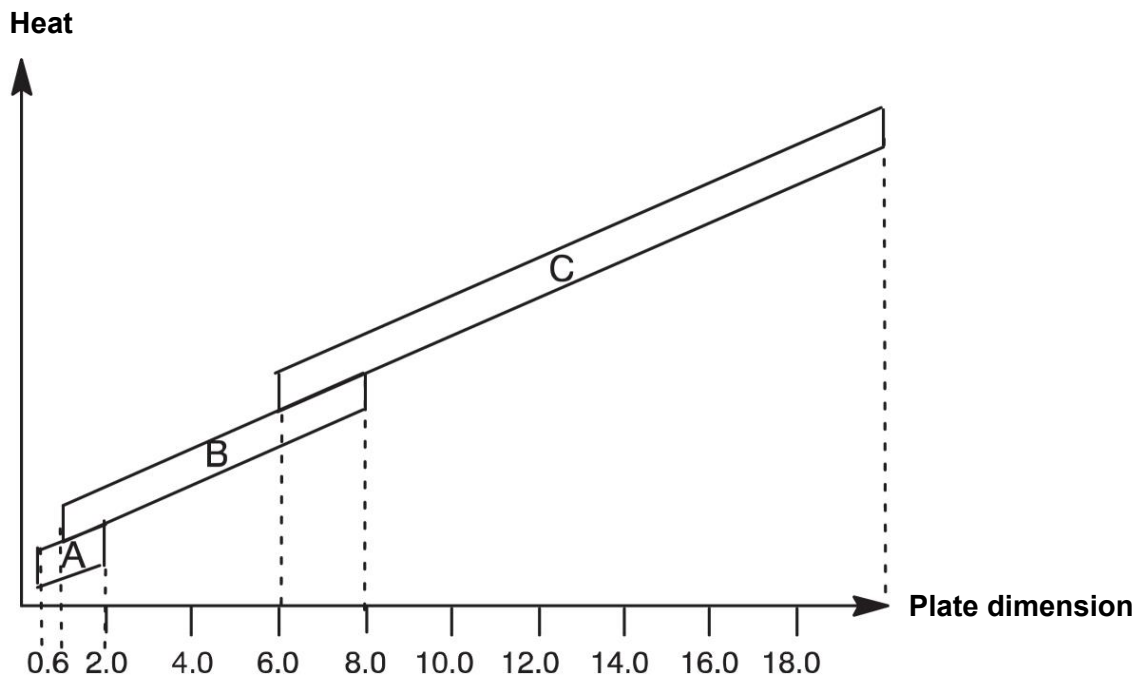

A = Pulsing in primary phase and **short arc** in secondary phase

B = Pulsing in primary phase and **pulsing** in secondary phase

C = Spray in primary phase and **pulsing** in secondary phase


4.3.3 Wire feed unit

Only use wire feed unit Feed 3004 during SuperPulse welding.

Precautionary measures!

When using SuperPulse, there is a considerable load on the wire feed unit. To avoid endangering the functional safety of the wire feed unit, follow the limit values in the following diagram.

Difference in the wire feed speed

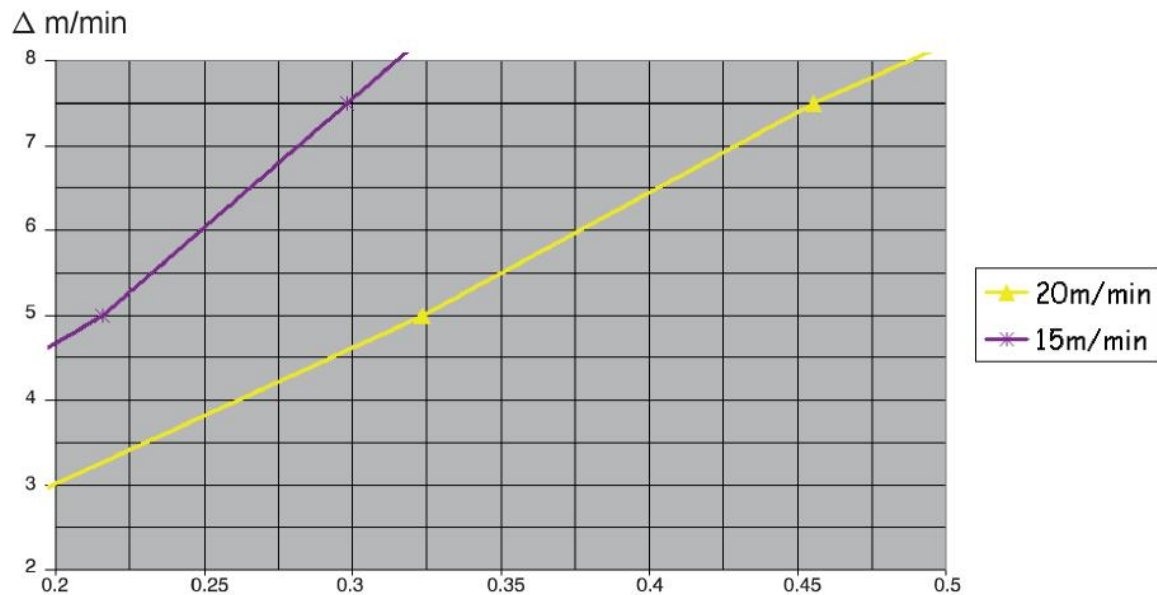

The graphs for 15 m/min and 20 m/min relate to primary wire feed speed. The cycle time is the sum of primary and secondary phase time.

The difference between primary and secondary wire feed speeds must not exceed the speed that is specified by the graphs for primary wire speed.

Example: If the cycle time is 0.25 s and the primary wire feed speed is 15 m/min, the difference between the primary and secondary wire feed speeds must not exceed 6 m/min.

Weld example A

In this example, we will weld a **10 mm plate** with **1.2 mm aluminum wire** and **argon shielding gas**.

Make the following settings using the control panel:

Process	SuperPulse	SuperPulse
Phase	Primary	Secondary
Method	Short-/sprayarc	Pulsing
Wire type	ER5356	ER5356
Shielding gas	Ar	Ar
Wire diameter	1.2 mm	1.2 mm
Voltage	(+1.0 V)	(+3.0 V)
Wire feed speed	15.0 m/min	11.0 m/min
Phase time	0.1 s	0.1 s

Primary and secondary phase times are 0.1 s + 0.1 s = **0.2 s**.

The difference in wire feed speed is 15.0 m/min - 11.0 m/min = **4 m/min**.

Weld example B

In this example, we will weld a **6 mm plate** with **1.2 mm aluminum wire** and **argon shielding gas**.

Make the following settings using the control panel:

Process	SuperPulse	SuperPulse
Phase	Primary	Secondary
Method	Pulsing	Pulsing
Wire type	ER5356	ER5356
Shielding gas	Ar	Ar
Wire diameter	1.2 mm	1.2 mm
Voltage	(+1.0 V)	(+2.0 V)
Wire feed speed	12.5 m/min	9.0 m/min
Phase time	0.15 s	0.15 s

Primary and secondary phase times are $0.15\text{ s} + 0.15\text{ s} = \mathbf{0.3\text{ s}}$.

The difference in wire feed speed is $12.5\text{ m/min} - 9.0\text{ m/min} = \mathbf{3.5\text{ m/min}}$.

5 MMA WELDING

Main menu → Process

MMA welding may also be referred to as welding with coated electrodes. Striking the arc melts the electrode, and its coating forms protective slag.

For electrode diameters that can be used for **MMA** welding, see the "WIRE AND GAS DIMENSIONS" appendix at the end of this manual.

5.1 MMA welding DC

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Current*	16 - 650 A	1 A		x
Arc force	0 - 100%	1%	x	
Min. current factor	0 - 100%	1%	x	
Regulator type	0 - 1		x	
Synergy	OFF or ON	-	-	-
Hot start	OFF or ON	-	x	
Hot start duration	1 - 30	1	x	
Hot start amplitude	%	-	x	
Setting limits	0 - 50	1	-	-
Measure limits	0 - 50	1	-	-

*) Maximum current depending on which machine type is being used.

5.2 MMA welding AC

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Current*	16 - 650 A	1 A		x
Arc force	0 - 100%	1%	x	
Min. current factor	0 - 100%	1%	x	
Regulator type	0 - 1		x	
Synergy	OFF or ON	-	-	-
Hot start	OFF or ON	-	x	
Hot start duration	1 - 30		x	
Hot start amplitude	%	-	x	
Setting limits	0 - 50	1	-	-
Measure limits	0 - 50	1	-	-


*) Maximum current depending on which machine type is being used.

5.3 Function explanations for settings

DC, Direct current

A higher current produces a wider weld pool, with better penetration into the workpiece.

The current is set in the Measure screen and Weld Data Setting or Fast Mode menus.

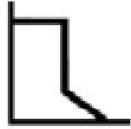

Arc force

The arc force is important in determining how the current changes in response to a change in the arc length. A lower value gives a calmer arc with less spatter.

The arc force is set in the Weld Data Setting menu when the synergy function is deactivated.

Min. current factor

The setting of min. current factor is employed when using certain specific electrodes.

The setting should not be altered.

Regulator type

Affects the short-circuit process and heat in the weld.

The setting should not be altered.

Synergy

Synergy for MMA welding means that the power source automatically optimizes the selected electrode type properties and dimension.

Synergy for MMA welding is activated in the Weld Data Setting menu.



Hot start

Hot start increases the weld current for an adjustable time at the start of welding, thus reducing the risk of poor fusion at the beginning of the joint.

Hot start for MMA is activated in the Weld Data Setting menu.

Setting limits and measure limits

In limits, a limit number is selected. For settings, see the “Edit setting limits” and “Edit measure limits” sections in the “TOOLS” chapter.

Limits are activated in the Weld Data Setting menu.

6 TIG WELDING

Main menu → Process



TIG welding

TIG welding melts the metal of the workpiece, using an arc struck from a tungsten electrode, which does not melt itself. The weld pool and the electrode are protected by shielding gas.



Pulsed current

Pulsing is used to give improved control of the weld pool and the solidification process. The pulse frequency is set so slow that the weld pool has time to solidify at least partially between each pulse. In order to set pulsing, four parameters are required: pulse current, pulse time, background current and background time.

6.1 Settings in the Weld Data Setting menu

6.1.1 TIG welding without pulsing DC

Settings	Setting range	In steps of
HF/LiftArc™	HF or LiftArc™	-
Live TIG-start*	-	-
2/4 stroke	2 stroke or 4 stroke	-
Current*	4 - 500 A	1 A
Slope up time	0 - 25 s	0.1 s
Slope down time	0 - 25 s	0.1 s
Gas pre-flow	0 - 25 s	0.1 s
Gas post-flow	0 - 25 s	0.1 s
HF automatic start pulse	OFF or ON	-
HF start pulse	4 - 500 A	1 A
Setting limits	0 - 50	1
Measure limits	0 - 50	1

*) Depending on which machine type is being used.

6.1.2 TIG welding with pulsing DC

Settings	Setting range	In steps of
HF/LiftArc™	HF or LiftArc™	-
2/4 stroke	2 stroke or 4 stroke	-
Pulse current*	4 - 500 A	1 A
Background current	4 - 500 A	1 A
Pulse time	0.001 - 5 s	0.001 s
Background time	0.001 - 5 s	0.001 s
Slope up time	0 - 25 s	0.1 s
Slope down time	0 - 25 s	0.1 s
Gas pre-flow	0 - 25 s	0.1 s

Settings	Setting range	In steps of
Gas post-flow	0 - 25 s	0.1 s
HF automatic start pulse	OFF or ON	-
HF start pulse	4 - 500 A	1 A
Setting limits	0 - 50	1
Measure limits	0 - 50	1

*) Maximum current depending on which machine type is being used.

6.1.3 TIG welding without pulsing AC

Settings	Setting range	In steps of
HF/LiftArc™	HF or LiftArc™	-
2/4 stroke	2 stroke or 4 stroke	-
Current*	4 - 500 A	1 A
Slope up time	0 - 25 s	0.1 s
Slope down time	0 - 25 s	0.1 s
Gas pre-flow	0 - 25 s	0.1 s
Gas post-flow	0 - 25 s	0.1 s
Preheating	0 - 100	1
Frequency	Hz	?
Balance	%	1%
Offset	A	
Setting limits	0 - 50	1
Measure limits	0 - 50	1


*) Maximum current depending on which machine type is being used.

6.2 Function explanations for settings




HF start

The HF start function strikes the arc, using a spark from the electrode to the workpiece, as the electrode is brought closer to the workpiece.

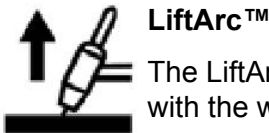

LiftArc™

The LiftArc™ function strikes the arc when the electrode is brought into contact with the workpiece and then lifted away from it.

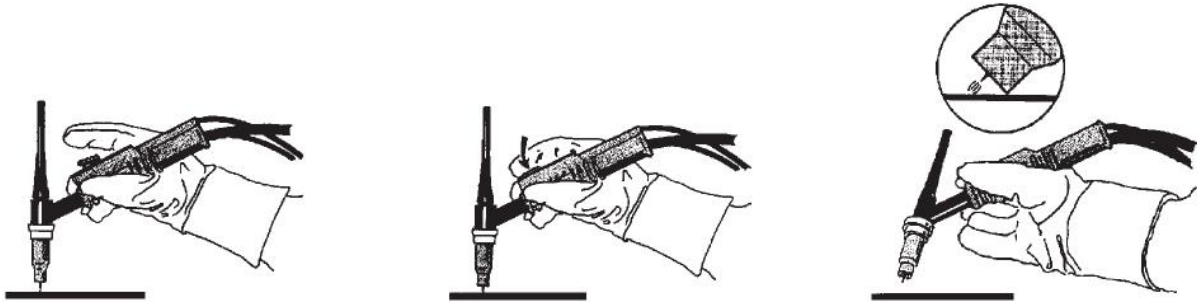


Striking the arc with the LiftArc™ function:

1. The electrode is touched on the workpiece.
2. The trigger switch is pressed, and a low current starts to flow.
3. The welder lifts the electrode from the workpiece: the arc strikes, and the current rises automatically to the set value.

LiftArc™ is activated in the main menu → Start method.


Live TIG-start

With “Live TIG start”, the arc strikes when the tungsten electrode is brought into contact with the workpiece and then lifted away from it.

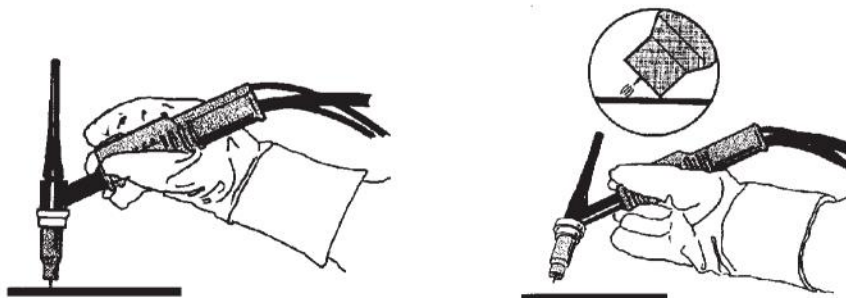

- Activation of “Live TIG-start” performed in the Process menu.

2-stroke

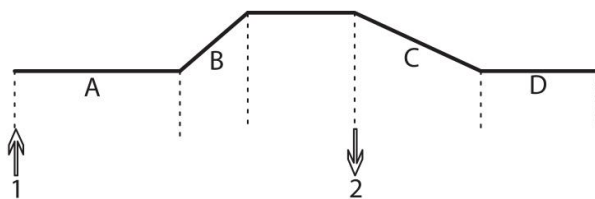


- A = Gas pre-flow**
- B = Slope up**
- C = Slope down**
- D = Gas post-flow**

Functions when using 2-stroke control of the welding torch.

In the 2-stroke control mode, pressing the TIG torch trigger switch (1) starts gas pre-flow (if used) and strikes the arc. The current rises to the set value (as controlled by the slope up function, if in operation). Releasing the trigger switch (2) reduces the current (or starts slope down if in operation) and extinguishes the arc. Gas post-flow follows, if it is in operation.

2-stroke is activated in the main menu → Trigger mode or in the Measure screen.

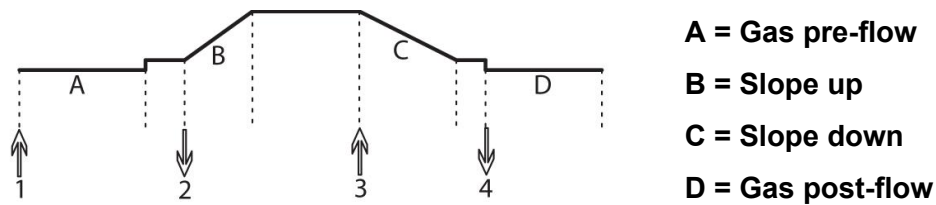4-stroke

Functions when using 4-stroke control of the welding torch.

In the 4-stroke control mode, pressing the trigger switch (1) starts gas pre-flow (if used). At the end of the gas pre-flow time, the current rises to the pilot level (a few amperes), and the arc is struck. Releasing the trigger switch (2) increases the current to the set value (with slope up, if in use). At the end of welding, the welder presses the trigger switch again (3), which reduces the current to pilot level again (with slope down, if in use). Releasing the switch again (4) extinguishes the arc and starts gas post-flow.

4-stroke is activated in the main menu → Trigger mode or in the Measure screen.

Current

A higher current produces a wider weld pool, with better penetration into the workpiece.

The current is set in the Measure screen and Weld Data Setting or Fast Mode menus.

Only applies to TIG welding with constant current.

Pulse current

The higher of the two current values in the event of pulsed current. When pulsing, slope up and slope down are also pulsed.

Pulse current is set in the Weld Data Setting menu.

Only applies to TIG welding with pulsing.

Background current

The lower of the two current values in the event of pulsed current.

Background current is set in the Weld Data Setting menu.

Only applies to TIG welding with pulsing.

Pulse time

The time the pulse current is on during a pulse period.

Pulse time is set in the Weld Data Setting menu.


Only applies to TIG welding with pulsing.

Background time

Time for background current, which, along with the time for pulse current, gives the pulse period.

Background time is set in the Weld Data Setting menu.

Only applies to TIG welding with pulsing.

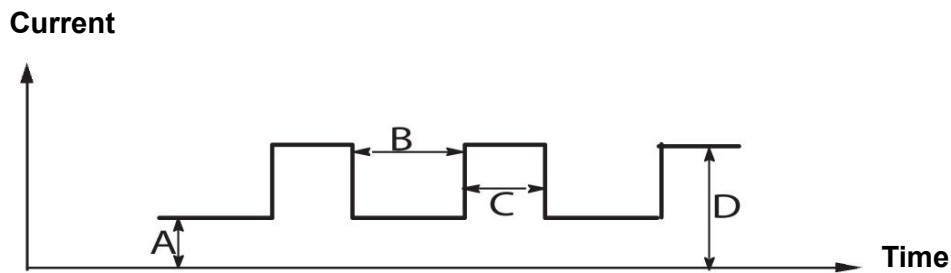


TIG welding with pulsing.

A = Background current

B = Background time

C = Pulse time

D = Pulse current

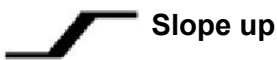

Slope up

The slope up function means that, when the TIG arc strikes, the current rises slowly to the set value. This provides 'gentler' heating of the electrode, and gives the welder a chance to position the electrode properly before the set welding current is reached.

Slope up is set in the Weld Data Setting menu.



Slope down

TIG welding uses "slope down", where the current falls 'slowly' over a controlled time, to avoid craters and/or cracks, when a weld is finished.

Slope down is set in the Weld Data Setting menu.



Gas pre-flow

This controls the time during which shielding gas flows before the arc is struck.

Gas pre-flow is set in the Weld Data Setting menu.



Gas post-flow

This controls the time during which shielding gas flows after the arc is extinguished.

Gas post-flow is set in the Weld Data Setting menu.

Automatic start pulse

This function is used to achieve a stable arc rapidly.


Preheating					
Tungsten electrode				Setting value	
				Shielding gas	
Ø	Color	Type		Ar	Ar + 30% He
1.6	Green	WP	V	-	-
1.6	Green	WP	U	30	35

1.6	Golden	WL15		20	20
1.6	Golden	WL15		30	35
2.4	Green	WP		45	-
2.4	Green	WP		55	60
2.4	Golden	WL15		40	40
2.4	Golden	WL15		45	50
3.2	Green	WP		55	-
3.2	Green	WP		65	65
3.2	Golden	WL15		60	60
3.2	Golden	WL15		70	70
4.0	Green	WP		70	75
4.0	Green	WP		80	85
4.0	Golden	WL15		65	65
4.0	Golden	WL15		70	75

WP = Pure tungsten electrode WL15 = Lanthan alloyed tungsten electrode.

Electrode preheating is set in the Weld Data Setting menu.

Only applies to TIG welding with AC.

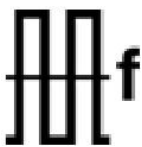


Frequency

Lower frequency (alternating current) transfers more heat to the workpiece and produces a wider weld pool.

Higher frequency produces a narrower arc with higher arc force (narrower weld pool).

Frequency is set in the Weld Data Setting menu.

Only applies to TIG welding with AC.

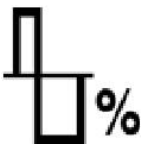

Balance

Setting the balance between the positive (+) electrode and negative (-) electrode half period during alternating current welding (AC).

Lower balance values produce more heat on the electrode and better oxide break-up on the workpiece.

Higher balance values produce more heat on the workpiece and better penetration.

Balance is set in the Weld Data Setting menu.

Only applies to TIG welding with AC.

Offset

Use this function to raise or lower the zero level.

With a raised zero level, the workpiece becomes hotter and achieves better penetration.

With a lowered zero level, the electrode becomes hotter and the workpiece achieves poorer penetration.

Offset is set in the Weld Data Setting menu.

Only applies to TIG welding with AC.

6.3 Other function explanations



Gas purging

Gas purging is used when measuring the gas flow, or to flush any air or moisture from the gas hoses before welding starts. Gas purging takes place for as long as the button is held depressed and takes place without voltage or wire feed starting.

Gas purging is activated in the Measure screen.

7 ARC AIR GOUGING

Main menu → Process

For arc air gouging, a special electrode comprising a carbon rod with a copper casing is used.

An arc is formed between the carbon rod and the workpiece, which melts the material. Air is supplied so that the melted material is blown away.

The following electrode diameters can be selected for arc air gouging: 4.0, 5.0, 6.0, 8.0, 10 and 13 mm.

Arc air gouging is not recommended for power sources below 400 A.

7.1 Settings in the Weld Data Setting menu

Settings	Setting range	In steps of	Synergy dependent	Adjustable in synergy
Voltage	8 - 60 V	1 V	x	x
Synergy*	OFF or ON	-	-	-
Inductance	0 - 100%		x	
Regulator type	1 - 12	1	x	

*) Default synergic line: 5.0 mm electrode (carbon rod).

7.2 Explanation of functions

Voltage

A higher voltage produces a wider weld pool, with better penetration into the workpiece.

The voltage is set in the Measure screen and Weld Data Setting or Fast Mode menus.

Inductance



NOTE!

The setting should not be altered.

Regulator type


Affects the short-circuit process and heat in the weld.

The setting should not be altered.

8 MEMORY MANAGEMENT

8.1 Control panel working method

The control panel comprises two units: working memory and weld data memory.

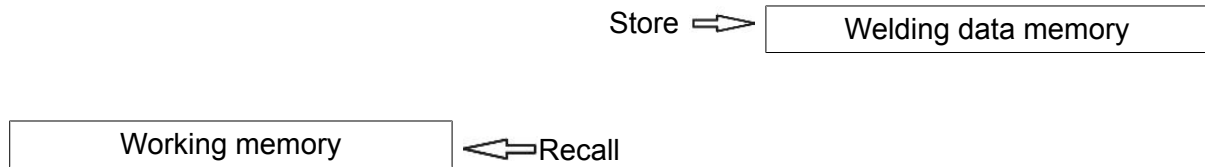

In the working memory, a complete set of weld data settings is created for storage in the weld data memory.

During welding, the content of the working memory controls the process. It is therefore also possible to recall a weld data set from the weld data memory to the working memory.

Note that the working memory always contains the most recently entered weld data settings. They can be recalled from the weld data memory or individually altered settings. In other words, the working memory is never empty or “zeroed.”

Main menu → Memory → Weld data memory

MIG/MAG	
PROCESS	MIG/MAG
METHOD	SHORT/SPRAY
QSET	OFF
SYNERGY GROUP	STANDARD
WIRE TYPE	ER70S
SHIELDING GAS	Ar+8%CO2
WIRE DIAMETER	1.2 mm
CONFIGURATION ▶	
TOOLS ▶	
SET	MEASURE
MEMORY	FAST MODE

It is possible to **store up to 255 sets of** weld data in the control panel. Each set is given a number from 1 to 255.


You can also **delete** and **copy** data sets and **recall** a set of weld data to the working memory.

Below are examples showing how to store, recall, copy and delete.


8.2 Store

If the weld data memory is empty, the following screen appears in the display.


We are now going to store a set of weld data. It will be given memory position 5. Press STORE. Position 1 is displayed. Turn one of the setting knobs until you reach position 5. Press STORE.

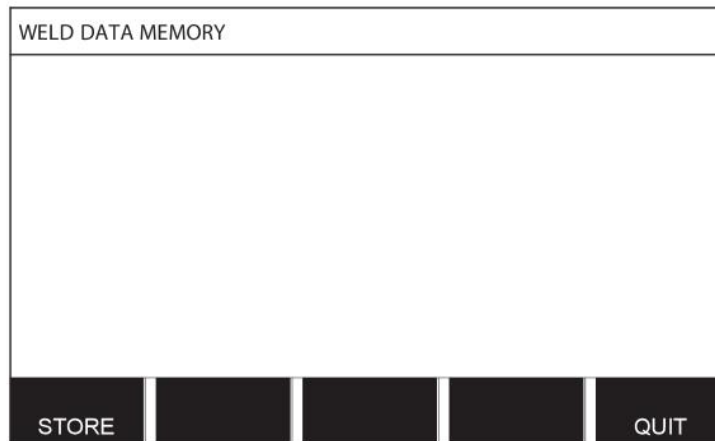

Select row five using one of the knobs. Press STORE.

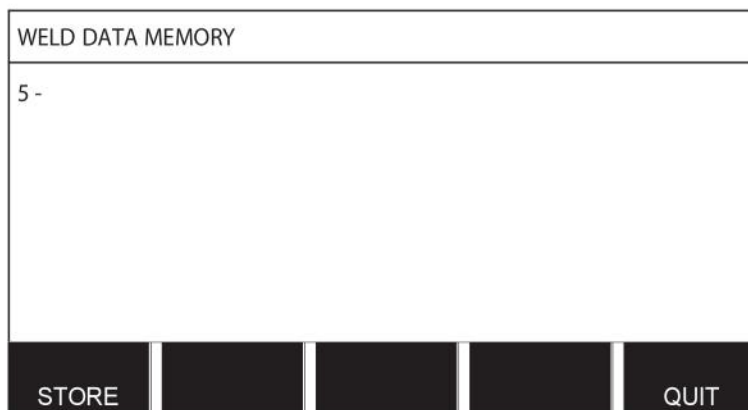

The following screen appears in the display.

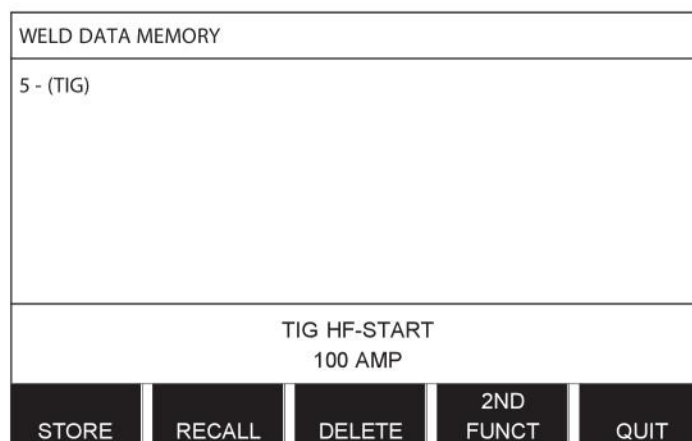


Parts of the content of data set number 5 are presented at the bottom of the display.


8.3 Recall

We are going to recall a stored data set:


Select the row using one of the knobs. Press RECALL.

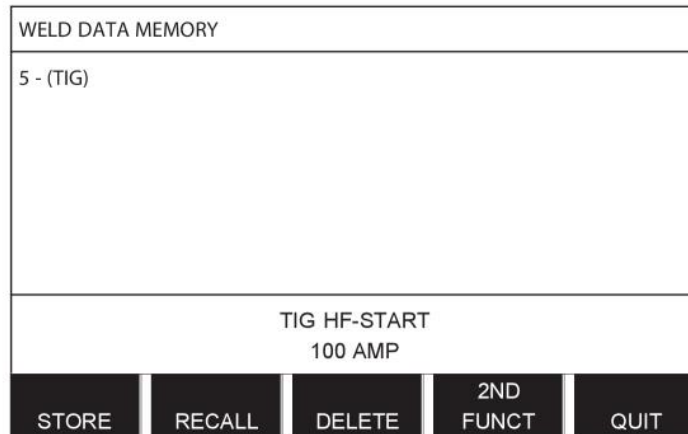

Press YES to confirm that you want to recall data set number 5.

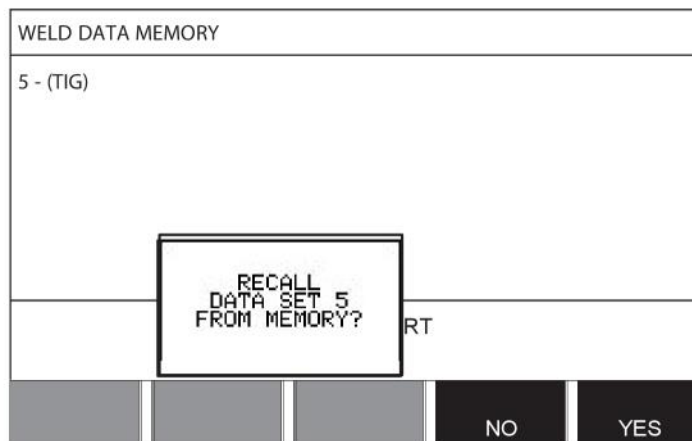

The icon in the upper-right corner of the measurement display shows which memory position number has been recalled.

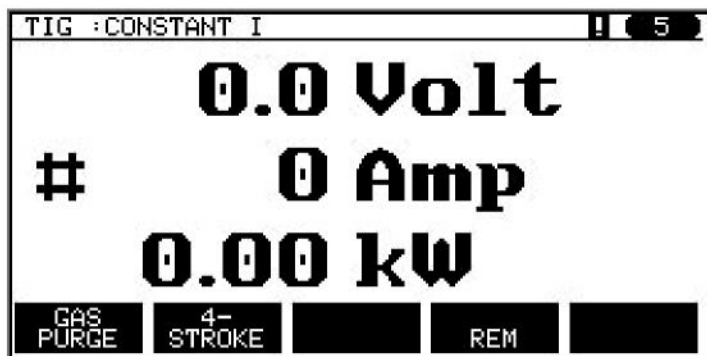

8.4 Delete

It is possible to delete one or more data sets from the Memory menu. We are going to delete the data set we stored in an earlier example. Select the data set. Press DELETE.

WELD DATA MEMORY				
5 - (TIG)				
TIG HF-START 100 AMP				
STORE	RECALL	DELETE	2ND FUNCT	QUIT

Press YES to confirm that you want to delete.

WELD DATA MEMORY				
5 - (TIG)				
DELETE WELD DATA NR. 5? RT				
			NO	YES


Return to the Memory menu with the NO key.

8.5 Copy


To copy the content of a weld data set to a new memory position, proceed as follows: Select the memory position you want to copy, then press 2ND FUNCT.

WELD DATA MEMORY				
5 - (TIG)				
TIG HF-START 100 AMP				
STORE	RECALL	DELETE	2ND FUNCT	QUIT

Press COPY.

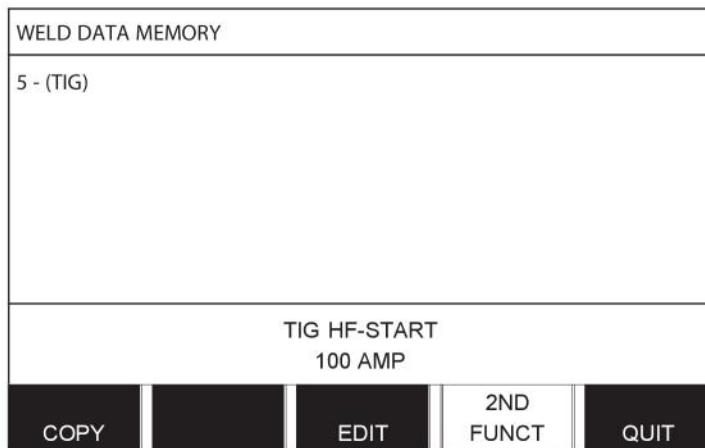


We are now going to copy the content of memory position 5 to position 50.
Use one of the knobs to step to the selected memory position, in this case position 50.
Press YES.

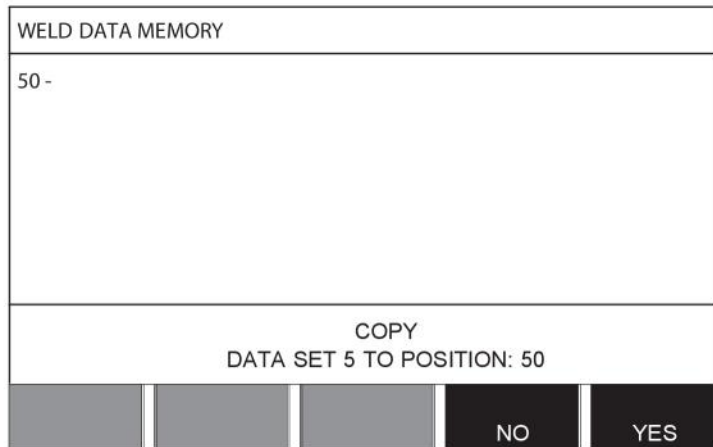


Weld data number 5 has now been copied to memory position 50.
Return to the Memory menu with QUIT.


8.6 Edit

To edit the content of a weld data set, proceed as follows:
Select the memory position you want to edit and press 2ND FUNCTION. Then press EDIT.

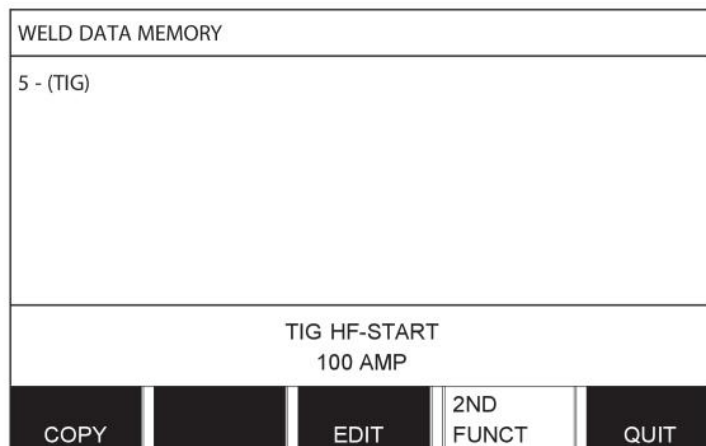


Part of the main menu is displayed, and the menu shows the symbol , which means that you are in an editing mode.

Select the setting you want to edit, then press ENTER. Select from the list, then press ENTER again.

TIG				
START METHOD	HF-START			
GUN TRIGGER MODE	4-STROKE			
TIG HF-START 100 AMP				
SET				QUIT

Press SET to move to WELD DATA SETTING. Select the values you want to edit and adjust with the plus/minus knobs. End with QUIT.


WELD DATA SETTING				
CURRENT	100 A			
SLOPE UP TIME	0.0 S			
SLOPE DOWN TIME	2.0 S			
GAS PREFLOW	0.5 S			
GAS POSTFLOW	5.0 S			
SETTING LIMITS	-			
MEASURE LIMITS	-			
EDIT DESCRIPTION			
GAS PURGE	4-STROKE		REM	QUIT

The setting for weld data number 5 has now been edited and stored.


8.7 Name

To give a stored weld data set its own name, proceed as follows:

Select the memory position you want to name and press 2ND FUNCTION. Then press EDIT.

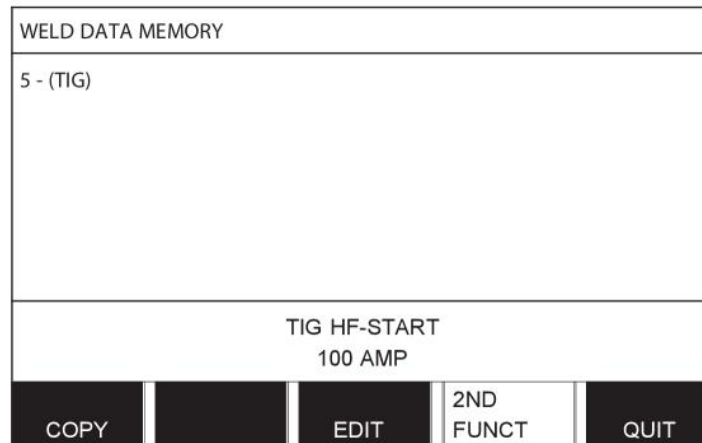


Press SET to move to WELD DATA SETTING. Select EDIT DESCRIPTION. Press ENTER.

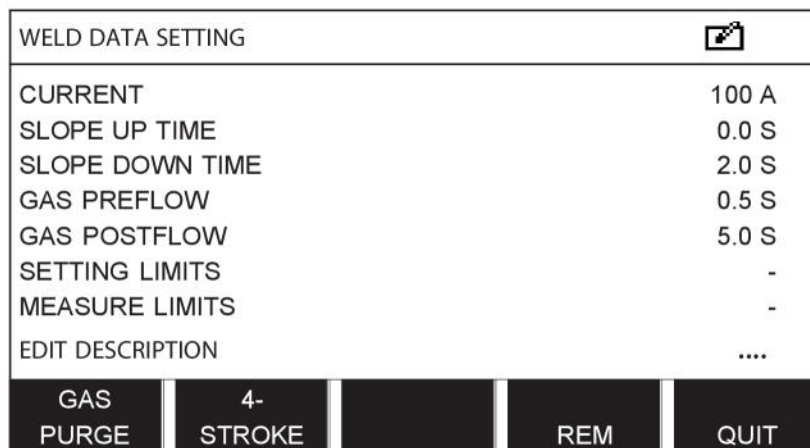

Here, you have access to a keyboard that is used as follows:

- Position the cursor on the desired keyboard character using the left knob and arrow keys. Press ENTER. Enter a complete character string, with a maximum of 40 characters.
- Press DONE to store. The alternative you have named can now be seen in the list.

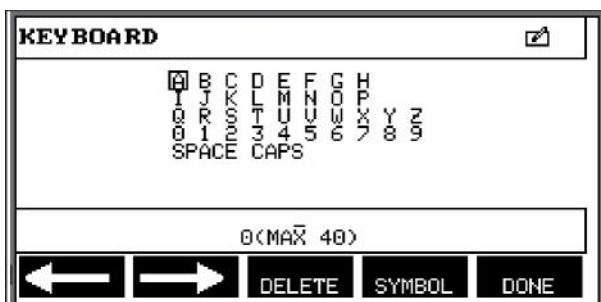

9 CONFIGURATION MENU

Main menu → Configuration menu

This menu contains the following submenus:

- Language, see the "First step – choice of language" section in the "INTRODUCTION" chapter.
- Code lock
- Remote control
- MIG/MAG basic defaults
- MMA basic defaults
- Fast mode soft buttons
- Fast mode soft buttons
- Panel remote enable
- WF supervision
- Auto save mode
- Trigger weld data switch
- Multiple wire feeders
- Quality functions
- Maintenance
- Unit of length
- Measure value frequency
- Register key

9.1 Code lock

Main menu → Configuration menu → Code lock


When the lock function is activated and you are in the Measure screen, remote mode, or Fast Mode menu, a password (lock code) is required to exit from the menus.

CODE LOCK	
LOCK STATUS	OFF
SET / CHANGE LOCK CODE	
QUIT	

Code lock is activated in the Configuration menu.

9.1.1 Lock code status

In lock code status, you can activate/deactivate the lock function without deleting the existing lock code in the event you deactivate the function. If no lock code is stored and you try to activate the code lock, the keyboard is displayed for entering a new lock code.

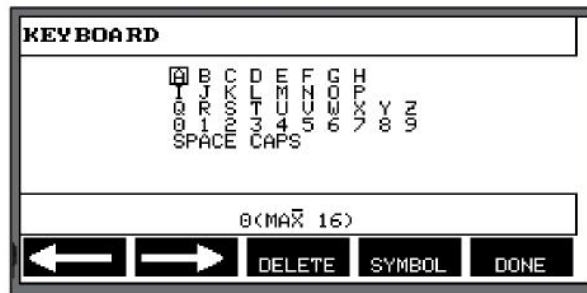


To exit lock status.

When you are in the Measure screen or the Fast Mode menu and the code lock is **deactivated**, you can exit the menus without restrictions by pressing QUIT or MENU to go to the Menu.

If it is **activated** and you try to exit, leave REM, or press software button 2ND FUNCT, the following screen appears in order to warn the user about the lock protection.

 PRESS ENTER FOR LOCK CODE...



Here, you can select QUIT to undo and return to the previous menu, or proceed by pressing ENTER to enter the lock code.

You then move to the menu with the keyboard, where you can enter the code. Press ENTER after each character, and confirm the code by pressing DONE.

The following text box appears:

UNIT UNLOCKED!



If the code is incorrect, an error message is displayed that offers the option of trying again or returning to the original menu, i.e. the Measure screen or Fast Mode menu.

If the code is correct, all blocks to other menus are removed, although *the code lock remains activated*. This means that you can leave the Measure screen and Fast Mode menu temporarily and retain the lock status when you return to the menus.

9.1.2 Specify/edit lock code

In specify/edit lock code, you can edit an existing lock code or enter a new one. A lock code can comprise a maximum of 16 optional letters or figures.

9.2 Remote controls

Main menu → Configuration menu → Remote controls

Non-CAN-bus connected remote control units must be connected via a remote control adapter. This function does not support the SuperPulse method.

After connection, activate the remote control unit in the Measure screen with the soft key REMOTE.

9.2.1 Forget override

Place the cursor on the REMOTE CONTROLS row. Press ENTER to bring up a list of alternatives.

MIG/MAG REMOTE CONTROLS	
FORGET OVERRIDE	ON
DIGITAL OP	5-PROG
ANALOG 1	WIRE SPEED
-MIN	0.8
-MAX	25.0
ANALOG 2	VOLTAGE
-MIN	-10
-MAX	+10
	QUIT

With FORGET OVERRIDE in the “ON” position, the most recently recalled memory is automatically recalled before each new welding start. This eliminates the results of all weld data settings produced during the most recent welding procedure.

9.2.2 Configuration for digital remote control unit

Without remote control adapter


When connecting a CAN-based remote control unit, configuration takes place automatically, DIGITAL OP.

With remote control adapter

When using a digital remote control unit, specify the type of remote control unit being used.

Position the cursor on the DIGITAL OP row, then press ENTER to bring up a list from which you can select an alternative.

- | | |
|--------------|--------------------|
| BINARY CODED | • 32-program unit |
| 10-PROGR | • 10-program unit* |

 

* Or Welding gun with RS3 program selection

9.2.3 Configuration for analog remote control unit

Without remote control adapter

When connecting a CAN-based remote control unit, configuration of ANALOG 1 and ANALOG 2 takes place automatically. The configuration cannot be altered.

With remote control adapter

With remote control adapter When you use an analog remote control unit, you can specify on the control panel which (maximum 2) potentiometers you want to use.

The potentiometers are called ANALOG 1 and ANALOG 2 in the control panel and refer to their own set parameters for the welding process, for example, wire feed parameter (ANALOG 1) and voltage parameter (ANALOG 2) with MIG/MAG.

If you position the cursor on the ANALOG 1 row and press ENTER, a list appears.



You can now select whether the potentiometer ANALOG 1 is used for WIRE SPEED or if it is not to be used (NONE).

Select the WIRE SPEED row and press ENTER.

If you position the cursor on the ANALOG 2 row and press ENTER, a list appears.



You can now select whether the potentiometer ANALOG 2 is used for VOLTAGE or if it is not to be used (NONE).

Select the VOLTAGE row and press ENTER.

All configuration for the remote control unit applies to any connected wire feed units. If you remove ANALOG 1 in the configuration, it applies to both wire feed units when you are using twin units.

9.2.4 Scale on inputs

You can set the control range for the potentiometers used. Do this by specifying minimum and maximum values in the control panel with the plus/minus knobs.

Note that you can set different voltage limits in synergy and non-synergy modes. The voltage setting in synergy is a deviation (plus or minus) of the synergy value. In non-synergy mode, the voltage setting is an absolute value. The value set applies to synergy when you are in synergy mode. If you are not in synergy mode, this is an absolute value.

There are also different voltage control limits for short-/sprayarc welding and pulsing in non-synergy mode.

Value after resetting

Synergy short-/sprayarc and pulsing	min -10 V	max 10 V
Non-synergy short-/sprayarc	min 8 V	max 60 V
Non-synergy pulsing	min 8 V	max 50 V

9.3 MIG/MAG defaults


Main menu → Configuration menu → MIG/MAG defaults

In this menu, you can set:

- Torch trigger mode (2-stroke/4-stroke)
- 4-stroke configuration
- Soft key configuration
- Voltage measurement in pulsing
- AVC feeder
- "Release pulse"

9.3.1 Gun trigger mode (2-stroke/4-stroke)

2-stroke

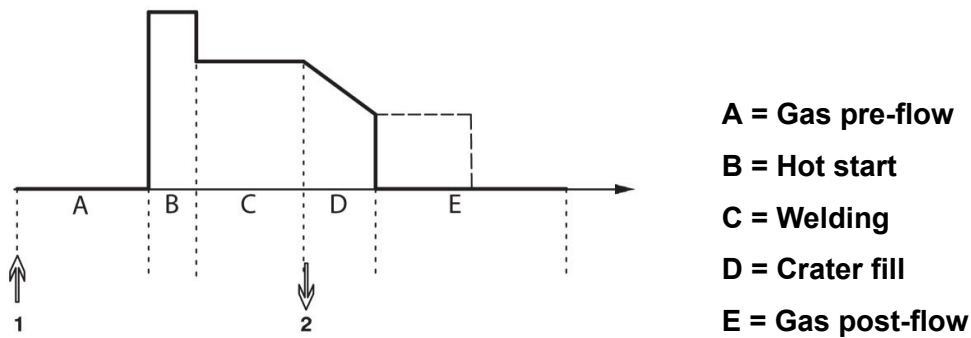

Functions when using 2-stroke control of the welding torch.


Gas pre-flow (if used) starts when the welding gun trigger switch is pressed (1). The welding process then starts. When the trigger switch is released (2), crater filling starts (if selected) and the welding current is stopped. Gas post-flow starts (if selected).

TIP: Pressing the trigger switch again while crater filling is in progress continues crater filling as long as the switch is held depressed (the dotted line). Crater filling can also be interrupted by quickly pressing and releasing the trigger switch while it is in progress.

2-stroke is activated in the Measure screen or Configuration menu or with a soft key in the Measure screen.

4-stroke

There are three start and two stop positions for 4-stroke. This is start and stop position 1. When resetting, position 1 is selected. See the "4-stroke configuration" section.

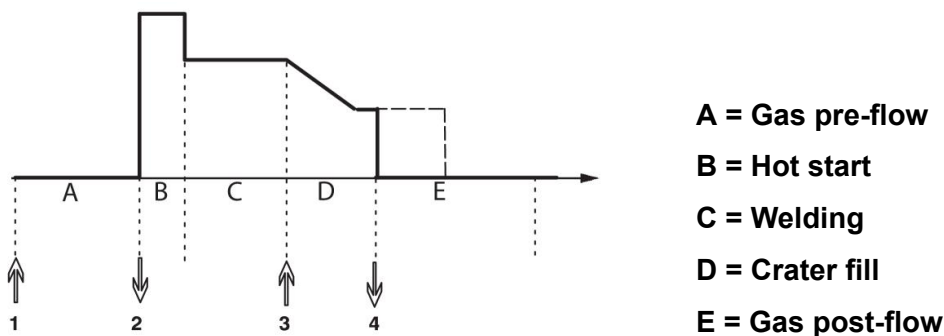

Functions when using 4-stroke control of the welding torch

Gas pre-flow starts when the welding gun trigger switch is pressed (1). Releasing the trigger switch starts the welding process. Pressing the trigger switch again (3) starts crater filling (if selected) and reduces the welding data to a lower value. Releasing the trigger switch (4) stops welding entirely and starts gas post-flow (if selected).

TIP: Crater filling stops, when the trigger switch is released. Keeping it held in instead continues crater filling (the dotted line).


4-stroke is activated in the Measure screen or Configuration menu or with a soft key in the Measure screen. It is not possible to select gun trigger mode (4-stroke) if spot welding is ON.

9.3.2 4-stroke configuration

In 4-stroke configuration, various functions of 4-stroke start and stop can arise.


4-stroke start setting

- Trigger-controlled gas pre-flow; see the “4-stroke” section.
- Time-controlled gas pre-flow.

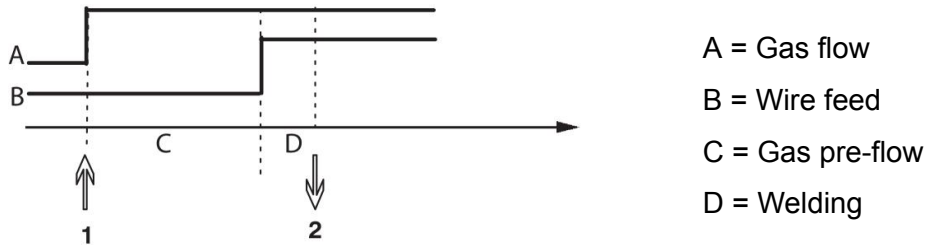

Press in the trigger switch (1), and gas pre-flow starts; after the set gas pre-flow time, the welding process starts. Release the trigger switch (2).


- Trigger-controlled hot start

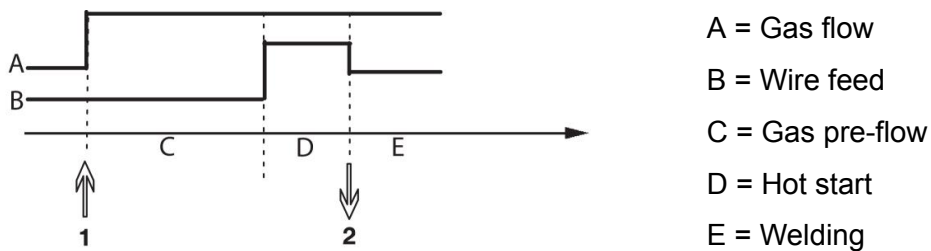

Press the trigger switch (1); gas pre-flow starts and hot start runs until the switch is released (2).

4-stroke stop setting

- Time-controlled crater filling with possible extension; see the "4-stroke" section.
- Trigger controlled crater filling time

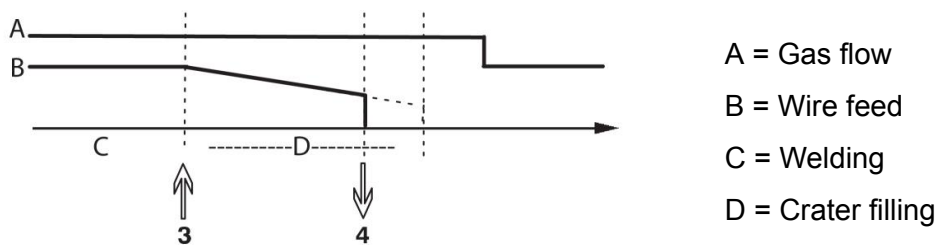

Press the trigger switch (3); crater filling commences and expires. If the trigger switch is released (4) within the crater filling time (crater filling time shortened), welding is interrupted.

9.3.3 Soft key configuration

We previously described the control panel's "soft" keys. When MIG/MAG welding, the user has the option of setting the function of the keys by selecting from a list of set options. There are seven soft keys that can be allocated a function.

Choose between the following options:

- None
- Gas purging
- Wire inching
- 2-stroke/4-stroke
- Crater filling ON/OFF
- Creep start ON/OFF
- Hot start ON/OFF
- Weld data switch with torch

In the display screen, there are two columns: one for **function** and one for **key number**.

SOFT KEYS SETUP	
Function	Soft key
NONE	
GAS PURGE	1
WIRE INCHING	2
TRIGGER MODE (2/4)	3
CRATER FILL ON/OFF	4
CREEP START ON/OFF	5
HOT START ON/OFF	6
TRIGGER SWITCH	7

GAS PURGE	WIRE INCH	4-STROKE	2ND FUNCT	QUIT
-----------	-----------	----------	-----------	------

The panel has five soft keys. By pressing the 2ND FUNCT key, you get five more soft keys.

When you allocate functions to these keys, they are numbered from the left as follows:

1	2	3	2ND FUNCT	QUIT
4	5	6	7	2ND FUNCT

To allocate a new function to a soft key, proceed as follows:

- Position the cursor on the function row with the function NONE, then press the soft key with the function whose key number you want to change.
- Repeat this procedure with the key that has the key number you want to use.
- Position the cursor on the function row where you want to assign a new key number, then press the soft key on which you want to have the function.

You can allocate new functions to the other keys in the same way, by pairing one of the functions in the left column with a key number in the right column.

9.3.4 Voltage measurement in pulsing

Options for voltage methods in pulsing are as follows:

- Peak value in pulse voltage PULSE The voltage is measured only during the pulse section and filtered before the voltage value appears on the display.
- Voltage average value AVERAGE

The voltage is measured continuously and filtered before the voltage value appears.

The measurement values that appear on the display are used as input data for internal and external quality functions.

9.3.5 AVC feeder

Once you have connected an AVC wire feed unit (ARC VOLTAGE CONTROL), access the CONFIGURATION menu under MIG/MAG BASIC SETTINGS. Press ENTER at the AVC wire feed unit row, then select ON. The equipment is then reconfigured automatically to match an AVC wire feed unit.

9.3.6 Release pulse

The system detects whether the wire becomes trapped in the workpiece. A current pulse is transmitted to release the wire from the surface.

In order to obtain this function, select RELEASE PULSE in the list under MIG/MAG BASIC SETTINGS, then press ENTER and select ON.

9.4 MMA defaults

Main menu → Configuration menu → MMA defaults

Drop welding

Drop welding can be used when welding with stainless electrodes. The function involves alternately striking and extinguishing the arc in order to achieve better control of the heat supply. The electrode needs only to be raised slightly to extinguish the arc.

Here, you can select ON or OFF.

9.5 Fast mode soft keys

The soft keys WELD DATA 1 to WELD DATA 4 are displayed in the Fast Mode menu. These are configured as follows:

Position the cursor on the SOFT KEY NUMBER row.

FAST MODE SOFT KEYS	
SOFT KEY NUMBER	1
ASSOCIATED WELD DATA	5
MIG/MAG SHORT/SPRAY SYNERGIC MODE ON ER70S, C=2, 1.2 mm + 3.5 VOLT, 7.6 M/MIN	
STORE	DELETE
QUIT	

The keys are numbered 1 to 4 from left to right. Select the desired key by specifying its number using the plus/minus knobs.

Then step down with the left knob to the next row ASSOCIATED WELD DATA. Here, you can browse through the weld data sets stored in the weld data memory. Select the desired weld data number using the plus/minus knobs. Press STORE to save. To delete the stored set, press DELETE.

9.6 Double start sources

When this option is activated (ON), you can start MIG/MAG welding both from the wire feed unit's start input and from the power source's TIG-start input and vice versa. When welding is started from a start signal input, it must be stopped from the same input.

9.7 Panel remote enable

Main menu → Configuration menu → Panel remote enable

Ordinarily, you cannot make settings using the pushbuttons when the panel is in remote control mode. When PANEL REMOTE ENABLE is ON, the current/wire feed or voltage can be set using the control panel and remote control.

If PANEL REMOTE ENABLE is used in combination with limits, machine usage can be limited to a specific setting range. This applies to the following settings: wire feed and voltage for MIG/MAG welding, current setting for MMA and TIG welding, pulse current with pulsed TIG.

9.8 WF supervision

Main menu → Configuration menu → WF supervision

WF SUPERVISION is normally activated (ON). This function is used for customer-specific solutions.

9.9 Auto save mode

Main menu → Configuration menu → Auto save mode

When a weld data set has been recalled from a memory position in the weld data memory and you change the settings, the changes are automatically saved to the memory position when you recall a new weld data set from memory.

Saving weld data manually to a memory position disables the next automatic save.

The memory position in which the weld data set is stored is displayed in the upper-right corner of the Measure screen.

9.10 Trigger weld data switch

Main menu → Configuration menu → Trigger weld data switch

This function permits changing to different preset weld data alternatives by double-clicking the welding gun's trigger.

It is possible to change between a maximum of five selected memory positions; see the "MEMORY MANAGEMENT" chapter.

OFF – No changeover between weld data.

ARC OFF – The user cannot change between memory positions during welding.

ON – The user can always change between memory positions.

Activating weld data switch

Position the cursor on the TRIGGER WELD DATA SWITCH row, then press ENTER. Select OFF, ARC OFF, or ON. Press ENTER.

TRIGGER WELD DATA SWITCH	
TRIGGER WELD DATA SWITCH	OFF
ADD/DELETE WELD DATA	5
SELECTED WELD DATA	
MIG/MAG SHORT/SPRAY SYNERGIC MODE ON	
ER70S, CO ₂ , 1.2 mm	
+ 3.5 VOLT, 7.6 M/MIN	
	QUIT

Choice of weld data from memory

Position the cursor on the ADD/DELETE WELD DATA row.

TRIGGER WELD DATA SWITCH	
TRIGGER WELD DATA SWITCH	OFF
ADD/DELETE WELD DATA	19
SELECTED WELD DATA 5 19	
MIG/MAG SHORT/SPRAY SYNERGIC MODE OFF	
ER70S, CO ₂ , 1.2 mm	
+ 6 VOLT, 9 M/MIN	
STORE	DELETE
	QUIT

Select the numbers for the memories where current weld data is stored using the plus/minus knobs, then press STORE.

The SELECTED WELD DATA row shows which weld data has been selected and in what order they occur, from left to right. The weld data set for the most recently selected position is displayed under the line in the display.

To remove weld data, follow the same procedure as above, but press the DELETE key.

9.11 Multiple wire feeders

Main menu → Configuration menu → Multiple wire feeders

When connecting several wire feed units (max. 4), you must use wire feed units without a weld data unit, i.e. with an empty panel.

All wire feed units supplied have identity number 1.

The first thing you must do when connecting several wire feed units is to change the identity number (node address) of one wire feed unit.

To change the ID number, proceed as follows:

- Connect the first wire feed unit, then go to the MULTIPLE WIRE FEEDERS menu.
- Press and release the trigger switch to activate the wire feed unit.
- Read on the first row which ID number the wire feed unit has (should be 1 the first time). Then select a new ID number between 2 and 4.

Position the cursor on the SELECT A NEW ID NUMBER row. Set the desired number between 1 and 4 by stepping with the plus/minus knobs. Press ENTER.

MULTIPLE WIRE FEEDERS	
CURRENT ID NUMBER	-
SELECT A NEW ID NUMBER	1
CONNECTED WIRE FEEDERS ID:	
QUIT	

On the top row, the figure for the ID number changes to the desired number.

- Connect the next wire feed unit.
- Press and release the trigger switch to activate this wire feed unit. You can now see that the unit has ID number 1.

Configuration is now complete, and you can start using the equipment normally. In the same way, it is possible to configure and run four wire feed units. What is important when using several wire feed units is that they are given different numbers so they can be distinguished; the specific ID numbers are not crucial.

Be careful not to give the same ID to two wire feed units. If this occurs, rectify the situation by disconnecting one of the units and then starting the above procedure again from the


beginning. You can always go to the "MULTIPLE WIRE FEEDERS" menu and check the ID number of the connected wire feed units by pressing the trigger switch.

On the CONNECTED WIRE FEEDERS ID row, you can see the ID number of all connected wire feed units.

9.12 Quality functions

Main menu → Configuration menu → Quality functions

The conditions for logging completed welds are set under Quality functions in the Configuration menu.

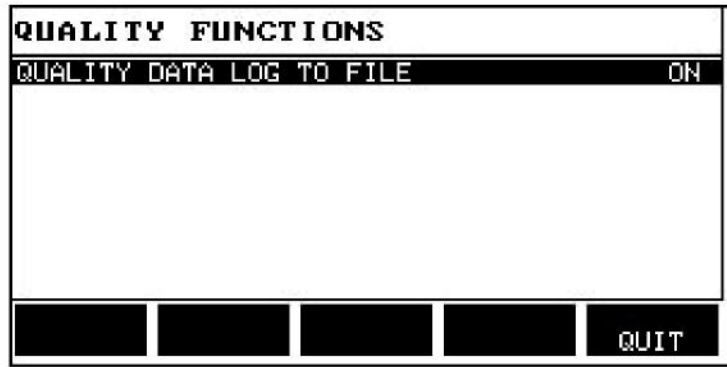

Select the row and press ENTER. If ON is selected, each weld is stored as a text file with the extension .aqd, with a new file every day. The following information is registered here:

- Time of welding start
- Duration of welding
- Maximum, minimum and average current during welding
- Maximum, minimum and average voltage during welding
- Maximum, minimum and average output during welding

Read more about the quality function in the "Quality functions" section.

9.13 Maintenance

Main menu → Configuration menu → Maintenance

In this menu, you set how often the contact tip is changed. Specify the number of weld starts after which the tip is changed by selecting the CONTACT TIP CHANGE INTERVAL row and pressing ENTER. Then adjust the plus/minus knobs until you arrive at the value you want. When the interval has been passed, fault code 54 is displayed in the error log. Reset by pressing the RESET soft key.


When TOTAL RUNNING TIME LIMIT is selected instead of the number of starts, an authorized ESAB service technician is contacted.

SERVICE	
CONTACT TIP CHANGE INTERVAL	0 Welds
WELD COUNT	0 Welds
TOTAL RUNNING TIME LIMIT	0d00:00:00
TOTAL RUNNING TIME	0d00:00:00

RESET QUIT

9.14 Unit of length

 Main menu → Configuration menu → Unit of length



The unit of measurement is selected here, metric or inches:

9.15 Measure value frequency

Main menu → Configuration menu → Measure value frequency

The frequency of the measurement value is set here by stepping to a value between 1 and 10 Hz using one of the plus/minus knobs. Measure value frequency affects only measure data in the calculations of quality data.

9.16 Register key

Configuration menu → Register key

With the function REGISTER KEY, you can unlock particular functions that are not included in the basic version of the control panel. For information regarding these functions, see the "MIG/MAG section in the "MENU STRUCTURE" chapter.

For access to these functions, you must contact ESAB. When you indicate the unit serial number, you get a key code, which is entered into the REGISTER KEY menu.

REGISTER KEY	
Serial No:	00000 - 00000 - 00000
Key:	AAA

ENTER KEY ACTVTE QUIT

Press ENTER KEY and write the key code on the keyboard, which appears in the display. Position the cursor on the desired keyboard character using the left knob and arrow keys. Press ENTER. When the character string is registered, press DONE.

To activate the key, press ACTVTE. A message is shown: KEY ACTIVATED. If registration is unsuccessful, the message is: INCORRECT KEY. Check the key code and try again.

10 TOOLS


Main menu → Tools

This menu contains the following submenus:

- Error log
- Export/Import
- File Manager
- Edit setting limits
- Edit measurement value settings
- Production statistics
- Quality functions
- User-defined synergic data
- Calendar
- User accounts
- Unit information

10.1 Error log

Main menu → Tools → Error log

Fault management codes are used to indicate that a fault has occurred in the welding process. This is specified in the display with a pop-up menu. An exclamation mark  appears in the upper-right corner of the display.

**NOTE!**

 disappears from the display as soon as you enter the error log menu.

All errors that arise during the use of the welding equipment are documented as error messages in the error log. Up to 99 error messages can be saved. If the error log becomes full, i.e. if 99 error messages have been saved, the oldest message is automatically deleted when the next fault occurs.

The following information appears in the error log menu:

- Error number
- Error date
- Error time
- Unit in which the error occurred
- Error management code

ERROR LOG					
Index	Date	Time	Unit	Error	
1	080917	11:24:13	8	19	
2	080918	10:24:18	8	17	
Lost contact with wire feeder					
DELETE		DELETE ALL	UPDATE	VIEW TOTAL	QUIT

Units

- | | |
|--------------------|-------------------------|
| 1 = cooling unit | 4 = remote control unit |
| 2 = power source | 5 = AC-unit |
| 3 = wire feed unit | 8 = control panel |

10.1.1 Error code descriptions

Fault code	Description
1	<p>Program memory error (EPROM) There is a fault in the program memory. This fault does not disable any functions. Action: Restart the machine. If the fault persists, send for a service technician.</p>
2	<p>Microprocessor RAM error The microprocessor is unable to read/write from/to a certain memory position in its internal memory. This fault does not disable any functions. Action: Restart the machine. If the fault persists, send for a service technician.</p>
3	<p>External RAM error The microprocessor is unable to read/write from/to a certain memory position in its external memory. This fault does not disable any functions. Action: Restart the machine. If the fault persists, send for a service technician.</p>

Fault code	Description
4	<p>5 V power supply low The power supply voltage is too low.</p> <p>The current welding process is stopped, and cannot be restarted.</p> <p>Action: Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.</p>
5	<p>Intermediate DC voltage outside limits The voltage is too low or too high. Too high a voltage can be due to severe transients on the mains power supply or to a weak power supply (high inductance of the supply or loss of a phase).</p> <p>The power unit is stopped, and cannot be restarted.</p> <p>Action: Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.</p>
6	<p>High temperature The thermal overload cutout has operated.</p> <p>The current welding process is stopped, and cannot be restarted until the cutout has reset.</p> <p>Action: Check that the cooling air inlets or outlets are not obstructed or clogged with dirt. Check the duty cycle being used, to make sure that the equipment is not being overloaded.</p>
7	<p>High primary current The power unit takes too much current from the DC voltage that supplies it. The power unit is stopped and cannot be started.</p> <p>Action: Turn off the mains power supply to reset the unit. If the error persists, send for a service technician.</p>
12	<p>Communication error (warning) The load on the system CAN bus is temporarily too high.</p> <p>The power unit or wire feed unit may have lost contact with the control panel.</p> <p>Action: Check the equipment to ensure that only one wire feed unit or remote control unit is connected. If the fault persists, send for a service technician.</p>
14	<p>Communication error The system's CAN bus has temporarily ceased to work due to excessive load.</p> <p>The current welding process is stopped.</p> <p>Action: Check the equipment to ensure that only one wire feed unit or remote control unit is connected. Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.</p>
15	<p>Messages lost The microprocessor is unable to process incoming messages sufficiently quickly, with the result that information has been lost.</p> <p>Action: Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.</p>

Fault code	Description
16	<p>High open-circuit voltage The open-circuit voltage has been too high.</p> <p>Action: Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.</p>
17	<p>Lost contact with another unit The current activities are stopped, and the welding start is prevented.</p> <p>This error can be caused by a brake in the connection (i.e. the CAN cable) between the welding data unit and another unit. The unit concerned is displayed in the error log.</p> <p>Action: Check the CAN cabling. If the error persists, send for a service technician.</p>
19	<p>Memory error in battery-powered data memory RAM The battery lost voltage</p> <p>Action: Turn off the mains power supply to reset the unit. The control panel is reset. The settings are in English, with MIG/MAG, SHORT/SPRAY, Fe, CO₂, 1.2 mm. If the error persists, send for a service technician.</p>
22	<p>Transmitter buffer overflow The control panel is unable to transmit information to the other units at a sufficiently high speed.</p> <p>Action: Turn off the mains power supply to reset the unit.</p>
23	<p>Receiver buffer overflow The control panel is unable to process information from the other units at a sufficiently high speed.</p> <p>Action: Turn off the mains power supply to reset the unit.</p>
25	<p>Incompatible weld data format Attempt to save weld data to a USB memory. The USB memory has a different data format than the weld data memory.</p> <p>Action: Use a different USB memory.</p>
26	<p>Program error Something prevented the processor from performing its normal tasks in the program.</p> <p>The program restarts automatically. The current welding process will be stopped. This fault does not disable any functions.</p> <p>Action: Review the handling of welding programs during welding. If the error persists, send for a service technician.</p>
28	<p>Program data lost Program execution does not work.</p> <p>Action: Turn off the mains power supply to reset the unit. If the error persists, send for a service technician.</p>
40	<p>Incompatible units Incorrect wire feed unit is connected. Start is prevented</p> <p>Action: Connect the correct wire feed unit.</p>

Fault code	Description
54	<p>Service interval passed The service interval for changing the contact tip has passed.</p> <p>Action: Replace contact tip.</p>
60	<p>Communication error The system's internal CAN bus has temporarily stopped working due to an excessively high load. The current welding process stops.</p> <p>Action: Check that all the equipment is correctly connected. Turn off the mains power supply to reset the unit. If the error persists, send for a service technician.</p>
64	<p>Measurement value limit passed The measurement values have exceeded their limits.</p> <p>Action: Check that the limit is correctly set as well as the quality of the weld.</p>
70	<p>Current measurement value limit passed The current measurement values have exceeded their limits.</p> <p>Action: Check that the current limit is correctly set as well as the quality of the joint.</p>
71	<p>Voltage measurement value limit passed The voltage measurement values have exceeded their limits.</p> <p>Action: Check that the voltage limit is correctly set as well as the quality of the joint.</p>
72	<p>Power measurement value limit passed The power measurement values have exceeded their limits.</p> <p>Action: Check that the power limit is correctly set as well as the quality of the joint.</p>
73	<p>WF current measurement value limit passed The WF current measurement values have exceeded their limits.</p> <p>Action: Check that the WF current limit is correctly set as well as the quality of the joint.</p>

10.2 Export/Import


Main menu → Tools → Export/Import

In the Export/Import menu, it is possible to transfer information to and from the control panel through a USB memory.

The following information can be transferred:

- Weld data sets Export/Import
- System settings Export/Import
- Setting limits Export/Import
- Measure limits Export/Import
- Error log Export
- Quality function log Export
- Production statistics Export
- Synergic lines Export/Import
- Basic settings Export/Import

Insert the USB memory. See the "USB connection" section for a description of how to insert the USB memory. Select the row with the information to transfer. Press EXPORT or IMPORT, depending on whether you want to import or export the information.

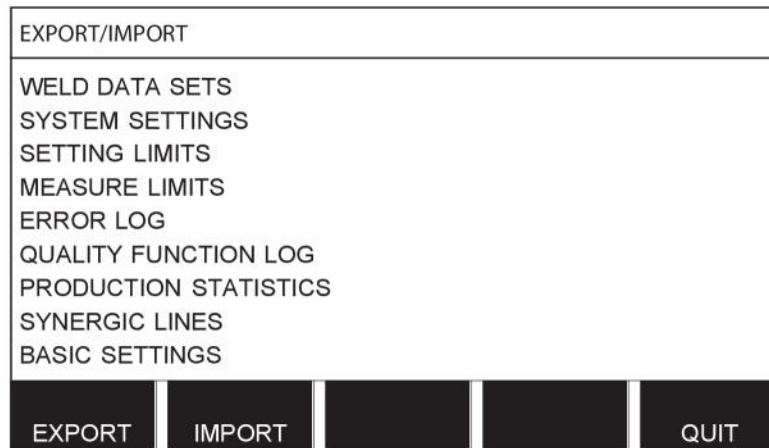


10.3 File Manager

Main menu → Tools → File Manager

In File Manager, you can process information in a USB memory (C:\). File Manager makes it possible to delete and copy weld data and quality data manually.

When the USB memory is inserted, the display shows the basic folder of the memory if no folder has been chosen.


The control panel remembers where you were the last time you used File Manager, so you return to the same place in the file structure when you come back.

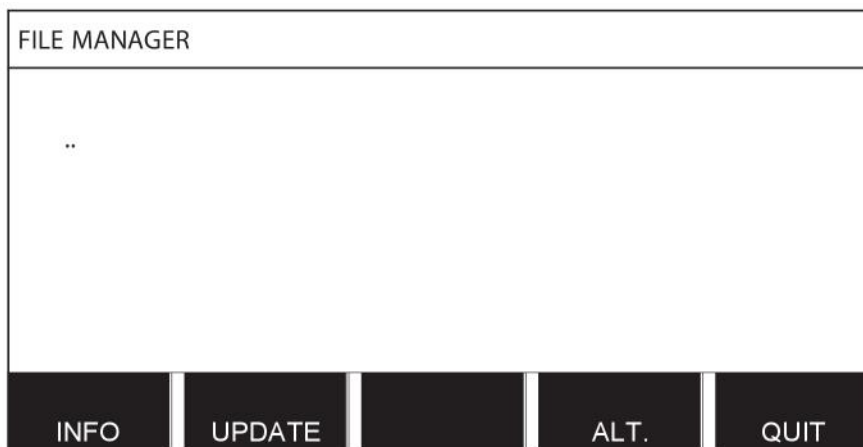


In order to ascertain how much storage space remains in the memory, use the INFO function. Update the information by pressing UPDATE.

When you want to delete, change name, create new folder, copy or paste, press ALT. A list then appears from which you can choose. If (..) or a folder is selected, you can only create a new folder or paste into a file that you have previously copied. If you select a file, the options RENAME, COPY, or PASTE is added if you previously copied a file.

Select a folder or file and press ALT.

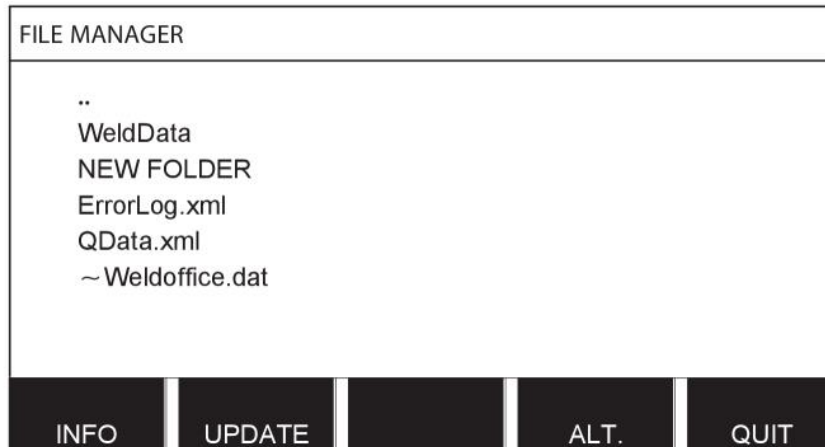

This list is displayed when you have pressed ALT.

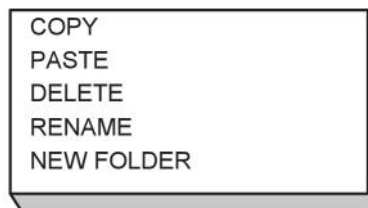

10.3.1 Deleting a file/folder

Select the file or folder you want to delete, then press ALT.

Select DELETE and press ENTER.



The file/folder is now removed. In order to delete a folder, it must be empty, i.e. first delete the files contained in the folder.

10.3.2 Renaming a file/folder

Select the file or folder you want to rename, then press ALT.

Select RENAME and press ENTER.



A keyboard appears in the display. Use the knob to the left to change row and the arrow keys to move left and right. Select the character/function to use, then press ENTER.

10.3.3 Creating new folder

Select where you want to put the new folder, then press ALT.

Select NEW FOLDER and press ENTER.




A keyboard then appears in the display. Use the knob to the left to change row and the arrow keys to move left and right. Select the character/function to use, then press ENTER.

10.3.4 Copying and pasting files


Select the file you want to copy, then press ALT.

Select COPY and press ENTER.

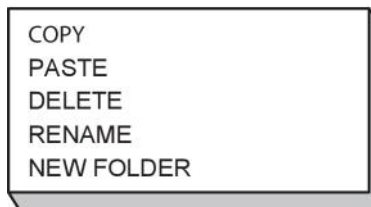

Position the cursor in the folder where you want to copy the file, then press ALT.

Select PASTE and press ENTER.

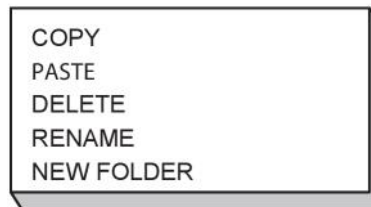

The copy is saved as "Copy of" plus the original name, e.g. Copy of WeldData.awd.


10.4 Edit setting limits

Main menu → Tools → Edit settings limits

In this menu, you set your own maximum and minimum values for various welding methods. The limits cannot be above or below the values for which the power source is dimensioned. There are 50 storage points. Select the row for an empty storage point, then press ENTER. Select process (MIG/MAG, MMA, TIG) and press ENTER. For MIG/MAG, the maximum and minimum values for voltage and wire feed speed can be selected.

EDIT SETTING LIMITS	
PROCESS	MIG/MAG
VOLTAGE	
- MIN	8.0 V
- MAX	60.0 V
WIRE SPEED	
- MIN	0.8 M/MIN
- MAX	25.0 M/MIN
STORE	AUTO
DELETE	QUIT

For MMA and TIG, the maximum and minimum values for current can be changed.

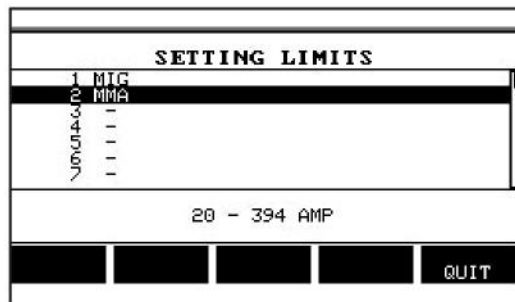

Once the values have been adjusted, press STORE. When asked whether to save the limit value to the selected storage point, press YES or NO. The storage point's values can be seen under the line at the bottom. In this case, storage point 2 for the MMA limit values is 20 to 394 A.

With AUTO, the limits are set automatically based on the limits set for each welding method.

When asked whether to set the setting limits automatically, press YES or NO, then STORE if you want to save the setting.

10.5 Edit measure limits

Main menu → Tools → Edit measure limits

In this menu, you set your own measurement values for the various welding methods. There are 50 storage points. Select the row for an empty storage point, then press ENTER. Select the process by pressing ENTER. Then select the welding process from the list that appears and press ENTER again.

The following values can be selected:

For MIG/MAG

- Voltage: min., max., min. average, max. average
- Current: min., max., min. average, max. average
- Output: min., max., min. average, max. average
- Wire feed unit current: min., max., min. average, max. average

TIP: To prevent feed problems, especially when robot welding, it is recommended that a max value is given for the feed unit motor current. High motor current indicates feed problems. To determine the correct max. value, it is recommended to monitor the motor current during one month of welding. Then a suitable maximum value is given.

For MMA and TIG

- Voltage: min., max., min. average, max. average
- Current: min., max., min. average, max. average
- Output: min., max., min. average, max. average

Set the desired value with one of the right knobs, then press STORE.

In the dialog box, you are asked if you want to store the selected storage point. Press YES to save the value. The storage point's values can be seen under the line at the bottom.

MEASURE LIMITS	
1 - MIG	
2 - TIG	
3 -	
4 -	
5 -	
6 -	
7 -	
24.0 - 34.0 VOLT, 90 - 120 AMP 2000 - 3000 Kw	
QUIT	

With AUTO, the limits are set automatically based on the most recently used measurement values.

When asked if the measurement values are to be set automatically, press NO or YES and then STORE if the setting is to be retained.

10.6 Production statistics

Main menu → Tools → Production statistics

The production statistics keep track of the total arc time, the total amount of material and the number of welds since the most recent reset. They also keep track of the arc time and the amount of material used in the most recent weld. For informational purposes, the melted wire material per length unit calculated and when the most recent reset occurred are also displayed.

The number of welds does not increase if the arc time was shorter than 1 second. For this reason, the amount of material used for a short weld of this type is not displayed. However, material consumption and time are included in the total material consumption and time.

PRODUCTION STATISTICS		
	LAST WELD	TOTAL
ARC TIME	0s	0s
CONSUMED WIRE	0g	0g
BASED ON	0g/m	
NUMBER OF WELDS		0
LAST RESET	081114	08:38:03
RESET	UPDATE	QUIT

When you press RESET, all counters are reset. Date and time show the most recent reset.

If you do not reset the counters, they are all automatically reset when one of them has reached its maximum value.

Maximum counter values

Time	999 hours, 59 minutes, 59 seconds
Weight	13350000 grams
Quantity	65535

Material consumption is not counted when using customer-specific synergy lines.

10.7 Quality functions

Main menu → Tools → Quality functions

Quality functions keep track of various interesting weld data for individual welds.

These functions are:

- Time of welding start
- Duration of welding
- Maximum, minimum and average current during welding
- Maximum, minimum and average voltage during welding
- Maximum, minimum and average output during welding

To calculate the heat input, the selected weld is highlighted Browse between the welds with the upper-right knob (#), and adjust the length of the joint with the lower knob (*). Press UPDATE and the welding unit calculates the heat input for the selected weld.

The number of welds since the most recent reset is displayed in the row at the bottom. Information can be stored about a maximum of 100 welds. In the event of more than 100 welds, the first one is overwritten. Welding must last for longer than one second to be registered.

The most recently noted weld appears in the display, although it is also possible to browse between other noted welds. All logs are deleted when you press RESET.

QUALITY FUNCTIONS			
#WELD: 1 / 4 *W LENGTH: 102 cm			
START 20081009 10:14:48			
WELD TIME 00:00:03 WELD DATA:			
HEAT INPUT: 3.12 kJ/mm			
	MAX	MIN	AVE.
I (Amp)	120.00	58.00	81.00
U (V)	12.50	6.50	8.75
P (kW)	3.11	1.47	2.10
NUMBER OF WELDS SINCE RESET: 4			
RESET	UPDATE		QUIT

Description of welding data schedule

Each welding data schedule can have a short description. Under the SET menu and EDIT DESCRIPTION, the welding data schedule that has just been called up can be given a description of up to 40 characters using the integral keyboard. The current description can also be modified or deleted.

If the requested schedule has a description, it is shown in the MEMORY, MEASURE and REMOTE menu screens instead of the welding data parameters that are otherwise displayed.


10.7.1 Store quality data

Main menu → Tools → Export/Import

The files produced in the control panel are stored as XML files. The USB memory must be formatted in FAT in order to work. The control panel can be used with ESAB's WeldPoint software, which is available separately.

Insert a USB memory into the control panel; see the "File Manager" section.

Select QUALITY FUNCTION LOG, then press EXPORT.

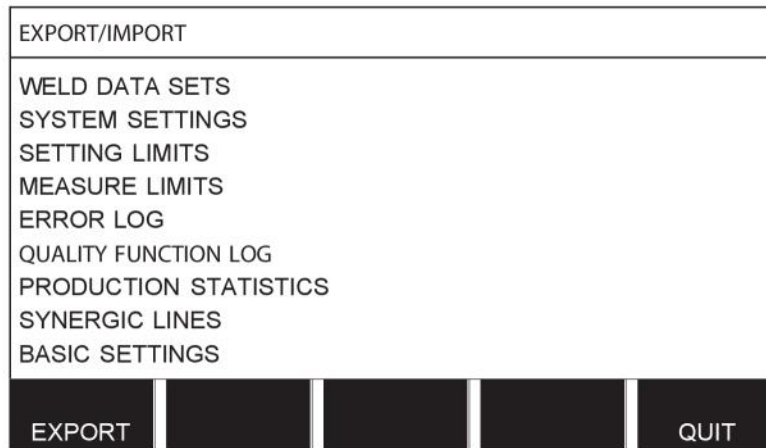

The entire set of quality data (information about the 100 most recent welds) stored in the control panel is now saved to the USB memory.

The file is in a folder called QData. QData is created automatically when you insert a USB memory.

Read more about the quality function in the "Quality function" section.


10.8 User-defined synergic data

Main menu → Tools → User-defined synergic data

It is possible to create your own synergic lines with respect to wire feed speed and voltage. A maximum of 10 such synergic lines can be saved.

A new synergic line is created in two steps:

- Define the new synergic line by specifying a number of voltage/wire speed coordinates; see points A to D in the following figure:

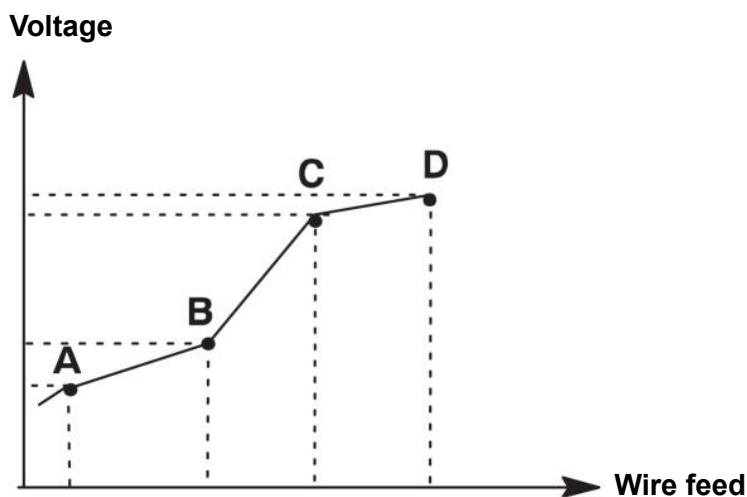

- Specify the wire/gas combination to which the synergic line applies.

10.8.1 Specify voltage/wire coordinates

To create a synergic line for the short-/sprayarc method, four coordinates are required; for the pulsing method, two coordinates are required. These coordinates must then be saved under separate weld data numbers in the weld data memory.

Short-/sprayarc

- Bring up the main menu and select the MIG/MAG SHORT/SPRAY method.
- Key in the desired values for voltage and wire feed speed for the first coordinate.
- Bring up the MEMORY menu and store the first coordinate to any number.

The four coordinates for a short-/sprayarc line each can be saved as any number. By default, they are saved as numbers 96, 97, 98 and 99.

A higher weld data number should contain higher values for voltage and wire feed speed than the nearest preceding weld data number.

The welding parameters inductance and regulator type must have the *same value* in all four weld data numbers.

- Define the number of coordinates required, then proceed to the “Specify valid wire/gas combination” section.

Pulsing

- Bring up the main menu and select the MIG/MAG PULSING method.
- Key in the desired values for voltage and wire feed speed for the first coordinate.
- Bring up the MEMORY menu and store the first coordinate to any number.

A higher weld data number should contain higher values for voltage, wire feed speed, pulse frequency, pulse amplitude and background current than the nearest preceding weld data number.

The welding parameters pulse time, Ka, Ki and “slope” must have the *same value* in both weld data numbers.

- Define the number of coordinates required, then proceed to the “Specify valid wire/gas combination” section.

10.8.2 Specify valid wire/gas combination

Position the cursor on the WIRE TYPE row, then press ENTER.

MAKE CUSTOMISED SYNERGIC LINES	
WIRE TYPE	ER 70S
SHIELDING GAS	CO2
WIRE DIMENSION	0.6 mm
SYNERGIC DESIGN SCHEDULE 1	96
SYNERGIC DESIGN SCHEDULE 2	97
SYNERGIC DESIGN SCHEDULE 3	98
SYNERGIC DESIGN SCHEDULE 4	99
	DELETE
	QUIT

Select an alternative displayed in the list, then press ENTER.

ER70S
ER316LSi
ER2209
ER5356
ER4043
E70 MCW

Select in the same way for SHIELDING GAS, then press ENTER.

CO2
Ar 18%CO2
Ar2%O2
Ar
He
ArHeO2

Select in the same way for WIRE DIAMETER, then press ENTER.

0.6 mm
0.8 mm
1.0 mm
1.2 mm
1.4 mm
1.6 mm

Select the SYNERGIC DESIGN SCHEDULE 1 row, then press STORE.

The operation is now complete—a synergic line has been defined.



NOTE!

A corresponding short-/sprayarc synergy is needed for each pulsing instance.

When you create a new synergic line for the pulsing method, you therefore always receive a warning message stating that a corresponding line has not been created for the short-/sprayarc method. The message reads: *WARNING! No corresponding synergic line for short-/sprayarc.*

10.8.3 Create your own wire/gas alternative

The lists of wire/gas alternatives can be extended with up to 10 alternatives of your own. At the bottom of each list, there is a blank row (---). By positioning the cursor on this row and pressing ENTER, you gain access to a keyboard that enables you to enter your own alternatives.

Select the row "---" and press ENTER.

Ar15%CO2
Ar8%O2
Ar30%He
Ar30%He2%H2
Ar30%HeO5%CO2

The control panel's keyboard is used as follows:

- Position the cursor on the desired keyboard character using the left knob and arrow keys. Press ENTER. Enter a complete character string, with a maximum of 16 characters.
- Press DONE. The alternative you named appears in the list.



Delete a named alternative as follows:

- Select your own wire/gas alternative from the relevant list.
- Press DELETE.



NOTE!


A named wire/gas alternative *cannot be deleted* if it is included in the weld data set that is currently in the working memory.

10.9 Calendar

Main menu → Tools → Calendar

Date and time are set here.

Select the row you want to set: year, month, day, hour, minutes and seconds. Set the correct value using one of the right-hand knobs. Press SET.

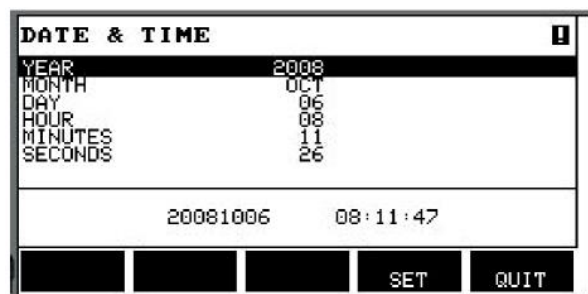


10.10 User accounts

Main menu → Tools → User accounts

Occasionally, it is particularly important from a quality perspective that the power source cannot be used by unauthorized parties.

User name, account level and password are registered in this menu.

Select USER NAME and press ENTER. Step down to an empty row, then press ENTER. Key in a new user name on the keyboard using the left knob and right and left arrows, then press ENTER. There is space for 16 user accounts. In the quality data files, it is evident which users executed a particular weld.

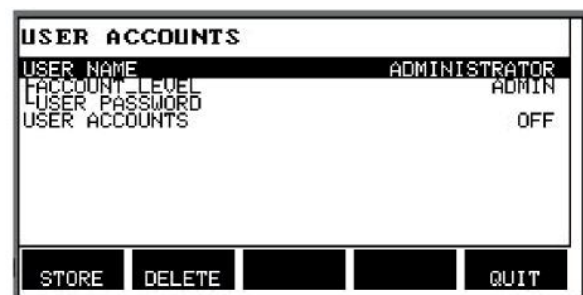

Under ACCOUNT LEVEL, choose from:

- Administrator, full access (can add new users)
- Senior user, can access everything except:
 - Code lock
 - Multiple wire feeders
 - Calendar
 - User accounts
- Normal user, can access the Measure menu

In the USER PASSWORD row, key in a password using the keyboard. When the power source is switched on and the control panel activated, you are asked in the display to enter your password.

If you choose not to have this function but instead want the power source and control panel to be unlocked for all users, select USER ACCOUNTS OFF.

Change user

When USER ACCOUNTS is ON, this menu is visible. It makes it possible to change user. Enter a password for a user and log in or choose QUIT to return to the Tools menu.

10.11 Unit information

Main menu → Tools → Unit information

In this menu, you can see the following information:

- Machine ID
- Node ID
 - 2 = power source
 - 3 = wire feed
 - 8 = control panel
- Software version

UNIT INFORMATION		
Machine ID	Node ID	Software Version
44	8	1.00A
23	2	2.00 A
5	3	1.18A

WELD DATA UNIT

QUIT

11 ORDERING SPARE PARTS



CAUTION!

Repair and electrical work should be performed by an authorised service technician. Use only original spare and wear parts.

U8₂ is designed and tested in accordance with the international and European standards 60974-1 and 60974-10. It is the obligation of the service unit that has carried out the service or repair work to make sure that the product still conforms to the said standard.

Spare parts may be ordered through your nearest ESAB dealer, see the back cover of this document. When ordering, please state product type, serial number, designation and spare part number in accordance with the spare parts list. This facilitates dispatch and ensures correct delivery.

MENU STRUCTURE

MIG/MAG

MIG/MAG	
PROCESS	MIG/MAG
METHOD	SHORT/SPRAY
QSET	OFF
WIRE TYPE	ER70S
SYNERGY GROUP	STANDARD
SHIELDING GAS	Ar+8%CO2
WIRE DIAMETER	1/16"
CONFIGURATION	▶
TOOLS	▶
SET	MEASURE
MEMORY	FAST MODE

Short/Spray	Pulse	Superpulse
SET	SET	SET
Voltage Wire speed Inductance Control type Synergic Mode Start data - gas preflow - creep start - hot start - touch sense current - soft start Stop data - crater fill - burn back time - termination final pulse - pinch off pulse SCT - gas postflow Setting limits Measure limits Spot welding Edit description	Voltage Wire speed Pulse current Pulse time Pulse frequency Background current Slope Synergic Mode Internal constants -Ka -Ki Start data - gas preflow - creep start - soft start - hot start - touch sense current Stop data - crater fill - termination - final pulse - pinch off pulse - SCT - burn back time - gas postflow Setting limits Measure limits Spot welding Edit description	Voltage Wire speed Pulse current Pulse time Pulse frequency Background current Slope Synergic Mode Phase weldtime Internal constants -Ka -Ki Start data - gas preflow - creep start - hot start - soft start - touch sense Stop data - crater fill - termination - final pulse - pinch off pulse - SCT - burn back time - gas postflow Setting limits Spot welding Edit description

MMA

MMA	
PROCESS	MMA
METHOD	DC
ELECTRODE TYPE	BASIC
ELECTRODE DIAMETER	3.2 MM
CONFIGURATION ▶	
TOOLS ▶	

SET MEASURE MEMORY FAST MODE

MMA DC

SET


- Current
- Arc Force
- Min current factor
- Control type
- Synergic mode
- Hot start
- Setting limits
- Measure limits
- Edit description

TIG

TIG				
PROCESS				TIG
METHOD				CONSTANT I
START METHOD				HF-START
GUN TRIGGER MODE				4-STROKE
CONFIGURATION ▶				
TOOLS▶				
SET	MEASURE	MEMORY	FAST MODE	

TIG Constant I	TIG Pulsed I
SET	SET
Current Slope up time Slope down time Gas preflow Gas postflow Setting limits Measure limits Edit description	Current Background current Pulse time Background time Slope up time Slope down time Gas preflow Gas postflow Setting limits Measure limits Edit description

GOUGING

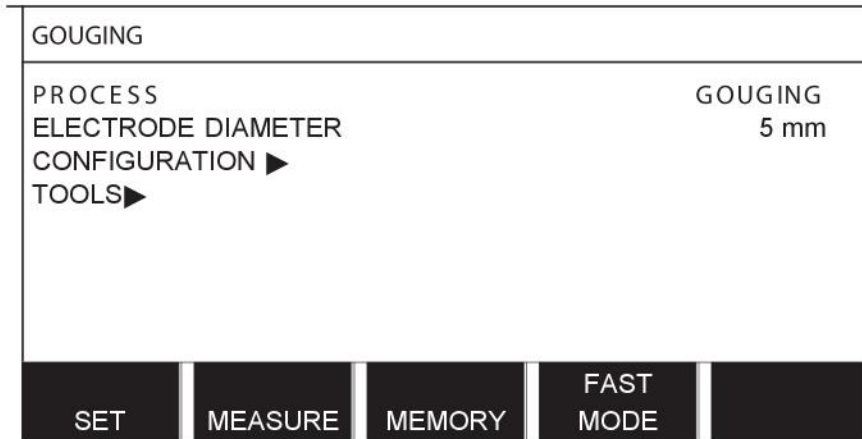

Gouging

SET

- Voltage
- Synergic mode
- Inductance
- Control type
- Setting limits
- Measure limits
- Edit description

CONFIGURATION - TOOLS

MIG/MAG	
PROCESS	MIG/MAG
METHOD	SHORT/SPRAY
QSET	OFF
WIRE TYPE	ER70S
SYNERGY GROUP	STANDARD
SHIELDING GAS	Ar+8%CO2
WIRE DIAMETER	1/16"
CONFIGURATION ▶	
TOOLS ▶	
SET	MEASURE
MEMORY	FAST MODE

MIG/MAG
MMA
TIG
GOUGING

Configuration	Tools
Language	Error log
Code lock	Export/import
Remote controls	-weld data sets
MIG/MAG defaults	-system settings
-gun trigger mode	-setting limits
-4-stroke configuration	-measure limits
-soft keys configuration	-error log
-volt.measure in pulsed	-quality function log
-AVC feeder	-production statistics
-release pulse	-synergic lines
MMA defaults	-basic settings
-droplet welding	File manager
Fast mode soft buttons	Setting limit editor
Double start sources	Measure limit editor
Panel remote enable	Production statistics
WF Supervision	Quality functions
Auto save mode	User defined synergic data
Trigger welddata switch	Calendar
Multiple wire feeders	User accounts
Quality functions	Unit information
Maintenance	
Unit of length	
Measure value frequency	
Register key	
Error category config	

Functional differences

Functions	U8₂ Basic	U8₂ Plus
Super Pulse	No	Yes
Limit editor	Yes	Yes
File manager	No	Yes
Auto save mode	No	Yes
Release pulse	Yes	Yes
Synergic lines	Basic package = 111 lines	Complete no of available lines
User defined synergic data	No	Yes
Production statistics	No	Yes

WIRE AND GAS DIMENSIONS

U8₂ Basic – MIG/MAG welding with SHORT-/SPRAYARC

Wire type	Shielding gas	Wire diameter
Low alloy or unalloyed wire (ER70S)	CO ₂	0.8 1.0 1.2 1.6*
	Ar + 18% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 8% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 23% CO ₂	0.8 1.0 1.2 1.6*
Stainless solid wire (ER316LSi)	Ar + 2% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 2% O ₂	0.8 1.0 1.2 1.6*
Magnesium-alloyed aluminium wire (ER5356)	Ar	1.0 1.2 1.6*
Silicon-alloyed aluminium wire (ER4043)	Ar	1.0 1.2 1.6*
	Ar + 50% He	1.0 1.2 1.6*
Metal powder cored wire (E70 MCW)	Ar + 18% CO ₂	1.2 1.4* 1.6*
	Ar + 8% CO ₂	1.2 1.4* 1.6*
Rutile flux cored wire (E70 RFCW)	Ar + 18% CO ₂	1.2 1.4* 1.6*
Basic flux cored wire (E70 BFCW)	CO ₂	1.2 1.4* 1.6*
	Ar + 18% CO ₂	1.2 1.4* 1.6*
Metal powder cored stainless wire (Ss MCW)	Ar + 8% CO ₂	1.2
	Ar + 2% O ₂	1.2
	Ar + 18% CO ₂	1.2
	Ar + 2% CO ₂	1.2
Silicon bronze (ERCuSi-A)	Ar	1.0 1.2
	Ar + 1% O ₂	1.0 1.2

*) Only for Mig 4000i, 4001i, 4002c, 5000i, 5002c, 6502c

U8₂ Basic - MIG/MAG welding with PULSE

Wire type	Shielding gas	Wire diameter
Low-alloy or non-alloy wire (ER70S)	Ar + 18% CO ₂	1.0 1.2 1.6*
	Ar + 8% CO ₂	1.0 1.2 1.6*
Stainless wire (ER316LSi)	Ar + 2% O ₂	0,8 1.0 1.2 1.6*
	Ar + 2% CO ₂	0,8 1.0 1.2 1.6*
Stainless solid wire (ER308LSi)	Ar + 2% CO ₂	0.9 1.0 1.2 1.6
Stainless solid wire (ER309LSi)	Ar + 2% CO ₂	1.0 1.2
Stainless solid wire (SS309MoL)	Ar + 2% CO ₂	1.0 1.2
Stainless duplex wire (ER2209)	Ar + 30% He + 1% O ₂	1.2

Wire type	Shielding gas	Wire diameter
Magnesium-alloyed aluminium wire (ER5356)	Ar	1.0 1.2 1.6*
Magnesium-alloyed al wire (ER5183)	Ar	1.6
Silicon-alloyed aluminium wire (ER4043)	Ar	1.0 1.2 1.6*
	Ar + 50% He	1.0 1.2 1.6*
Silicon-alloyed al wire (ER4043)	Ar + 30% He	0.9 1.0 1.2
Silicon-alloyed al wire (ER4047)	Ar	1.2 1.6
Silicon bronze (ERCuSi-A)	Ar	1.0 1.2
	Ar + 1% CO ₂	1.0 1.2
Aluminium solid wire (ER1100)	Ar	1.2
Metal powder-filled cored wire (E70MCW)	Ar + 8% CO ₂	1.2 1.4 1.6
	Ar + 18% CO ₂	1.2 1.4 1.6
Metal powder cored Stainless wire (Ss MCW)	Ar + 2% O ₂	1.2
	Ar + 2% CO ₂	1.2
	Ar + 8% CO ₂	1.2

U8₂ Plus - MIG/MAG welding with SHORT-/SPRAYARC

Wire type	Shielding gas	Wire diameter
Low alloy or unalloyed wire (ER70S)	CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 18% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 2% O ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 5% O ₂ + 5% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 8% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 23% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 15% CO ₂ + 5% O ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 16% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 25% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 2% CO ₂	0.8 1.0 1.2 1.6*
Stainless solid wire (ER316LSi)	Ar + 5% O ₂	1.0 1.2
	Ar + 2% O ₂	0.8 1.0 1.2 1.6*
	Ar + 30% He + 1% O ₂	0.8 1.0 1.2 1.6*
	Ar + 2% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 3% CO ₂ + 1% H ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 32% He + 3% CO ₂ + 1% H ₂	0.8 0.9 1.0 1.2 1.6*

Wire type	Shielding gas	Wire diameter
Stainless duplex wire (ER2209)	Ar + 2% O ₂	1.0
	Ar + 30% He + 1% CO ₂	1.0
Magnesium-alloyed aluminium wire (ER5356)	Ar	0.9 1.0 1.2 1.6*
Silicon-alloyed aluminium wire (ER4043)	Ar	0.9 1.0 1.2 1.6*
	Ar + 50% He	0.9 1.0 1.2 1.6*
Metal powder cored wire (E70 MCW)	Ar + 18% CO ₂	1.0 1.2 1.4* 1.6*
	Ar + 8% CO ₂	1.0 1.2 1.4* 1.6*
Rutile flux cored wire (E70 RFCW)	CO ₂	1.2 1.4* 1.6*
	Ar + 18% CO ₂	1.2 1.4* 1.6*
Basic flux cored wire (E70 BFCW)	CO ₂	1.0 1.2 1.4* 1.6*
	Ar + 18% CO ₂	1.0 1.2 1.4* 1.6*
	SELF-SHIELDING	1.2 1.6*
Stainless flux cored wire (Ss RFCW)	Ar + 18% CO ₂	1.2
	Ar + 8% CO ₂	1.2
	SELF-SHIELDING	1.6* 2.4*
Duplex rutile flux cored wire (E2209)	Ar + 18% CO ₂	1.2
Metal powder cored stainless wire (Ss MCW)	Ar + 8% CO ₂	1.2
	Ar + 2% O ₂	1.2
	Ar + 18% CO ₂	1.2
	Ar + 2% CO ₂	1.2
ERNiCrMo	Ar + 50% He	0.9
Silicon bronze (ERCuSi-A)	Ar + 1% O ₂	1.0 1.2
	Ar	1.0 1.2
Copper and aluminum wire (ERCuAl-A1)	Ar	1.0 1.2
	Ar + 1% O ₂	1.0 1.2
Rutile flux cored wire (Fe RCW DualShield)	CO ₂	1.2

*) Only for Mig 4000i, 4001i, 4002c, 5000i, 5002c, 6502c

U8₂ Plus - MIG/MAG welding with PULSE

Wire type	Shielding gas	Wire diameter
Low alloy or unalloyed wire (ER70S)	Ar + 18% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 2% O ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 2% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 5% O ₂ + 5% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 8% CO ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 23% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 16% CO ₂	0.8 1.0 1.2 1.6*
	Ar + 25% CO ₂	0.9
Stainless solid wire (ER316LSi)	Ar + 2% O ₂	0.8 0.9 1.0 1.2 1.6*
	Ar 30% He + O ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 2% O ₂	0.8 0.9 1.0 1.2 1.6*
	Ar + 3% CO ₂ + 1% H ₂	0.8 0.9 1.0 1.2 1.6
	Ar + 32% He + 3% CO ₂ + 1% H ₂	0.8 0.9 1.0 1.2 1.6
Stainless solid wire (ER308LSi)	Ar + 2% CO ₂	0.9 1.0 1.2 1.6
Stainless solid wire (ER308LSi)	Ar + 2% O ₂	0.9
Stainless solid wire (ER309LSi)	Ar + 2% CO ₂	1.0 1.2
Stainless solid wire (SS309MoL)	Ar + 2% CO ₂	1.0 1.2
Stainless duplex wire (ER2209)	Ar + 30% He + 1% O ₂	1.0 1.2
	Ar + 2% O ₂	1.0
Magnesium-alloyed aluminium wire (ER5356)	Ar	0.8 0.9 1.0 1.2 1.6*
	Ar + 50% He	1.2
Magnesium-alloyed al wire (ER5356)	Ar + 30% He	1.2
Magnesium-alloyed al wire (ER5183)	Ar	1.6
Silicon-alloyed aluminium wire (ER4043)	Ar	0.9 1.0 1.2 1.6*
	Ar + 50% He	0.9 1.0 1.2 1.6*
Silicon-alloyed al wire (ER4043)	Ar + 30% He	0.9 1.0 1.2
Silicon-alloyed al wire (ER4047)	Ar	1.2 1.6
Metal powder cored wire (E70 MCW)	Ar + 18% CO ₂	1.0 1.2 1.4* 1.6*
	Ar + 8% CO ₂	1.0 1.2 1.4* 1.6*

Wire type	Shielding gas	Wire diameter
Metal powder cored stainless wire (Ss MCW)	Ar + 2% O ₂	1.2
	Ar + 2% CO ₂	1.2
	Ar + 8% CO ₂	1.2
ERNiCrMo	Ar	1.0 1.2
	Ar + 50% He	0.9 1.0 1.2
	Ar + 30% He + 2% H ₂	1.0
	Ar + 30% He + 0.5% CO ₂	1.0
Silicon bronze (ERCuSi-A)	Ar + 1% O ₂	1.0 1.2
	Ar	1.0 1.2
Stainless wire (1.3964)	Ar + 8% O ₂	1.0LOW 1.0HIGH
Copper and aluminum wire (ERCuAl-A1)	Ar	1.0 1.2
	Ar + 1% O ₂	1.0 1.2
Aluminium solid wire (ER1100)	Ar	1.2

*) Only for Mig 4000i, 4001i, 4002c, 5000i, 5002c, 6502c

MMA welding

Electrode type	Electrode diameter
Basic	1.6 2.0 2.5 3.2 4.0 4.5 5.0 5.6* 6.0*
Rutile	1.6 2.0 2.5 3.2 4.0 4.5 5.0 5.6* 6.0* 7.0*
Cellulose	2.5 3.2

*) Only for Mig 4000i, 4001i, 5000i

Carbon, arc air

Electrode diameters (mm): 4.0 5.0 6.0 10.0 13.0

U8₂ Plus - MIG/MAG - ROBOT synergy group - with SHORT-/SPRAYARC

Wire type	Shielding gas	Wire diameter (mm)
ER5356	Ar	1.2, 1.6
ER4043	Ar	1.2, 1.6
ERCuSi-A	Ar	0.8, 1.0
ERCuAl-A1	Ar	1.0
ERCuSi-A	Ar + 1% CO ₂	0.8, 1.0
ER70S	Ar + 18% CO ₂	0.8, 0.9, 1.0, 1.2
ER70S	Ar + 8% CO ₂	0.8, 0.9, 1.0, 1.2
ER70S	CO ₂	0.8, 0.9, 1.0, 1.2

Wire type	Shielding gas	Wire diameter (mm)
Fe MCW 14.11	Ar + 18% CO ₂	1.2, 1.4
Fe MCW 14.11	Ar + 8% CO ₂	1.2, 1.4
Fe MCW 14.13	Ar + 18% CO ₂	1.2, 1.4
Fe MCW 14.13	Ar + 8% CO ₂	1.2, 1.4
SS 307	Ar + 2% CO ₂	0.8, 1.0, 1.2
SS 307	Ar + 2% CO ₂	0.8, 1.0, 1.2
ER308LSi	Ar + 2% CO ₂	0.8, 0.9, 1.0, 1.2
SS 430LNb-Ti	Ar + 2% CO ₂	1.0
SS 430LNb	Ar + 2% CO ₂	1.0
SS 430Ti	Ar + 2% CO ₂	0.9, 1.0

U8₂ Plus - MIG/MAG - ROBOT synergy group - with PULSE

Wire type	Shielding gas	Wire diameter (mm)
ER5356	Ar	1.2, 1.6
ER4043	Ar	1.2, 1.6
ERCuAl-A1	Ar	1.0
ERCuSi-A	Ar + 1% CO ₂	1.0
ER70S	Ar + 18% CO ₂	0.8, 0.9, 1.0, 1.2
ER70S	Ar + 8% CO ₂	0.8, 0.9, 1.0, 1.2
SS 307	Ar + 2% CO ₂	0.8, 1.0, 1.2
ER308LSi	Ar + 2% CO ₂	0.8, 0.9, 1.0, 1.2
SS 430LNb	Ar + 2% CO ₂	0.8, 1.0
SS 430Ti	Ar + 2% CO ₂	0.9, 1.0

U8₂ Plus - MIG/MAG - SAT synergy group

Wire type	Shielding gas	Wire diameter (mm)	Work area m/min
ER70S	Ar + 8% CO ₂	1.0	16 - 25
ER70S	Ar + 18% CO ₂	1.0	16 - 25
ER70S	Ar + 8% CO ₂	0.9	16 - 29
ER70S	Ar + 18% CO ₂	0.9	17 - 29
ER70S	Ar + 8% CO ₂	0.8	19 - 29
ER70S	Ar + 18% CO ₂	0.9	19 - 29
SS 307	Ar + 2% CO ₂	0.8	20 - 26
SS 307	Ar + 2% CO ₂	1.0	12 - 21
Fe MCW 14.11	Ar + 8% CO ₂	1.2	6.5 - 14

WIRE AND GAS DIMENSIONS

Wire type	Shielding gas	Wire diameter (mm)	Work area m/min
Fe MCW 14.11	Ar + 18% CO ₂	1.2	7 - 14
Fe MCW 14.11	Ar + 8% CO ₂	1.4	5.9 - 12
Fe MCW 14.11	Ar + 18% CO ₂	1.4	6.6 - 12
SS 430LNb	Ar + 2% CO ₂	1.0	14.2 - 25
SS 430Ti	Ar + 2% CO ₂	0.9	16 - 27
SS 430Ti	Ar + 2% CO ₂	1.0	14.2 - 25
SS 430LNb-Ti	Ar + 2% CO ₂	1.0	14.2 - 27.5
ER308LSi	Ar + 2% CO ₂	1.0	15-27.5
ER308LSi	Ar + 2% CO ₂	0.9	16 - 28
ER308LSi	Ar + 2% CO ₂	0.8	18 - 29.5




ORDERING NUMBERS

Ordering no.	Denomination
0460 820 880	Control panel Aristo™ U8 ₂ *
0460 820 881	Control panel Aristo™ U8 ₂ Plus*
0460 820 882	Control panel Aristo™ U8 ₂ Plus I/O*
0460 896 270	Instruction manual SE
0460 896 271	Instruction manual DK
0460 896 272	Instruction manual NO
0460 896 273	Instruction manual FI
0460 896 274	Instruction manual GB
0460 896 275	Instruction manual DE
0460 896 276	Instruction manual FR
0460 896 277	Instruction manual NL
0460 896 278	Instruction manual ES
0460 896 279	Instruction manual IT
0460 896 280	Instruction manual PT
0460 896 281	Instruction manual GR
0460 896 282	Instruction manual PL
0460 896 283	Instruction manual HU
0460 896 284	Instruction manual CZ
0460 896 285	Instruction manual SK
0460 896 286	Instruction manual RU
0460 896 287	Instruction manual US
0460 896 289	Instruction manual EE
0460 896 290	Instruction manual LV
0460 896 291	Instruction manual SI
0460 896 292	Instruction manual LT
0460 896 293	Instruction manual CN
0460 896 288	Instruction manual TR
0459 839 037	Spare parts list

* For functional differences, see the "Functional differences" section.

Instruction manuals and the spare parts list are available on the Internet at www.esab.com

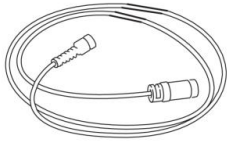ACCESSORIES

0460 877 891	Extension cable (connectors included) 7.5 m 12-poles	
0457 043 880	Adapter set 230 V AC / 12 V DC, for control box (for training with the control box disconnected from the machine).	
0462 062 001	USB Memory stick Gb 2	

ESAB subsidiaries and representative offices

Europe

AUSTRIA

ESAB Ges.m.b.H
Vienna-Liesing
Tel: +43 1 888 25 11
Fax: +43 1 888 25 11 85

BELGIUM

S.A. ESAB N.V.
Brussels
Tel: +32 2 745 11 00
Fax: +32 2 745 11 28

BULGARIA

ESAB Kft Representative Office
Sofia
Tel: +359 2 974 42 88
Fax: +359 2 974 42 88

THE CZECH REPUBLIC

ESAB VAMBERK s.r.o.
Vamberk
Tel: +420 2 819 40 885
Fax: +420 2 819 40 120

DENMARK

Aktieselskabet ESAB
Herlev
Tel: +45 36 30 01 11
Fax: +45 36 30 40 03

FINLAND

ESAB Oy
Helsinki
Tel: +358 9 547 761
Fax: +358 9 547 77 71

GREAT BRITAIN

ESAB Group (UK) Ltd
Waltham Cross
Tel: +44 1992 76 85 15
Fax: +44 1992 71 58 03

ESAB Automation Ltd
Andover
Tel: +44 1264 33 22 33
Fax: +44 1264 33 20 74

FRANCE

ESAB France S.A.
Cergy Pontoise
Tel: +33 1 30 75 55 00
Fax: +33 1 30 75 55 24

GERMANY

ESAB GmbH
Solingen
Tel: +49 212 298 0
Fax: +49 212 298 218

HUNGARY

ESAB Kft
Budapest
Tel: +36 1 20 44 182
Fax: +36 1 20 44 186

ITALY

ESAB Saldatura S.p.A.
Bareggio (Mi)
Tel: +39 02 97 96 8.1
Fax: +39 02 97 96 87 01

THE NETHERLANDS

ESAB Nederland B.V.
Amersfoort
Tel: +31 33 422 35 55
Fax: +31 33 422 35 44

NORWAY

AS ESAB
Larvik
Tel: +47 33 12 10 00
Fax: +47 33 11 52 03

POLAND

ESAB Sp.zo.o.
Katowice
Tel: +48 32 351 11 00
Fax: +48 32 351 11 20

PORTUGAL

ESAB Lda
Lisbon
Tel: +351 8 310 960
Fax: +351 1 859 1277

ROMANIA

ESAB Romania Trading SRL
Bucharest
Tel: +40 316 900 600
Fax: +40 316 900 601

RUSSIA

LLC ESAB
Moscow
Tel: +7 (495) 663 20 08
Fax: +7 (495) 663 20 09

SLOVAKIA

ESAB Slovakia s.r.o.
Bratislava
Tel: +421 7 44 88 24 26
Fax: +421 7 44 88 87 41

SPAIN

ESAB Ibérica S.A.
Alcalá de Henares (MADRID)
Tel: +34 91 878 3600
Fax: +34 91 802 3461

SWEDEN

ESAB Sverige AB
Gothenburg
Tel: +46 31 50 95 00
Fax: +46 31 50 92 22

ESAB International AB
Gothenburg
Tel: +46 31 50 90 00
Fax: +46 31 50 93 60

SWITZERLAND

ESAB AG
Dietikon
Tel: +41 1 741 25 25
Fax: +41 1 740 30 55

UKRAINE

ESAB Ukraine LLC
Kiev
Tel: +38 (044) 501 23 24
Fax: +38 (044) 575 21 88

North and South America

ARGENTINA

CONARCO
Buenos Aires
Tel: +54 11 4 753 4039
Fax: +54 11 4 753 6313

BRAZIL

ESAB S.A.
Contagem-MG
Tel: +55 31 2191 4333
Fax: +55 31 2191 4440

CANADA

ESAB Group Canada Inc.
Mississauga, Ontario
Tel: +1 905 670 02 20
Fax: +1 905 670 48 79

MEXICO

ESAB Mexico S.A.
Monterrey
Tel: +52 8 350 5959
Fax: +52 8 350 7554

USA

ESAB Welding & Cutting
Products
Florence, SC
Tel: +1 843 669 44 11
Fax: +1 843 664 57 48

Asia/Pacific

AUSTRALIA

ESAB South Pacific
Archerfield BC QLD 4108
Tel: +61 1300 372 228
Fax: +61 7 3711 2328

CHINA

Shanghai ESAB A/P
Shanghai
Tel: +86 21 2326 3000
Fax: +86 21 6566 6622

INDIA

ESAB India Ltd
Calcutta
Tel: +91 33 478 45 17
Fax: +91 33 468 18 80

INDONESIA

P.T. ESABindo Pratama
Jakarta
Tel: +62 21 460 0188
Fax: +62 21 461 2929

JAPAN

ESAB Japan
Tokyo
Tel: +81 45 670 7073
Fax: +81 45 670 7001

MALAYSIA

ESAB (Malaysia) Snd Bhd
USJ
Tel: +603 8023 7835
Fax: +603 8023 0225

SINGAPORE

ESAB Asia/Pacific Pte Ltd
Singapore
Tel: +65 6861 43 22
Fax: +65 6861 31 95

SOUTH KOREA

ESAB SeAH Corporation
Kyungnam
Tel: +82 55 269 8170
Fax: +82 55 289 8864

UNITED ARAB EMIRATES

ESAB Middle East FZE
Dubai
Tel: +971 4 887 21 11
Fax: +971 4 887 22 63

Africa

EGYPT

ESAB Egypt
Dokki-Cairo
Tel: +20 2 390 96 69
Fax: +20 2 393 32 13

SOUTH AFRICA

ESAB Africa Welding & Cutting
Ltd
Durbanville 7570 - Cape Town
Tel: +27 (0)21 975 8924

Distributors

For addresses and phone numbers to our distributors in other countries, please visit our home page

www.esab.com



www.esab.com

